

N RUTAN AVE

E MILDRED ST

N CLIFTON AVE

MH 5747-646
3416 E. Mildred
Estimated depth = 8.0 ft

Install 275 lf of 8"
Cured-in-Place Liner

MH 5747-644
Approx. depth = 11.5 ft

School
Playground

School
211 N. Clifton

275'

262'


211'

E 1ST ST N



SITE 1

Sheet 3 of 42

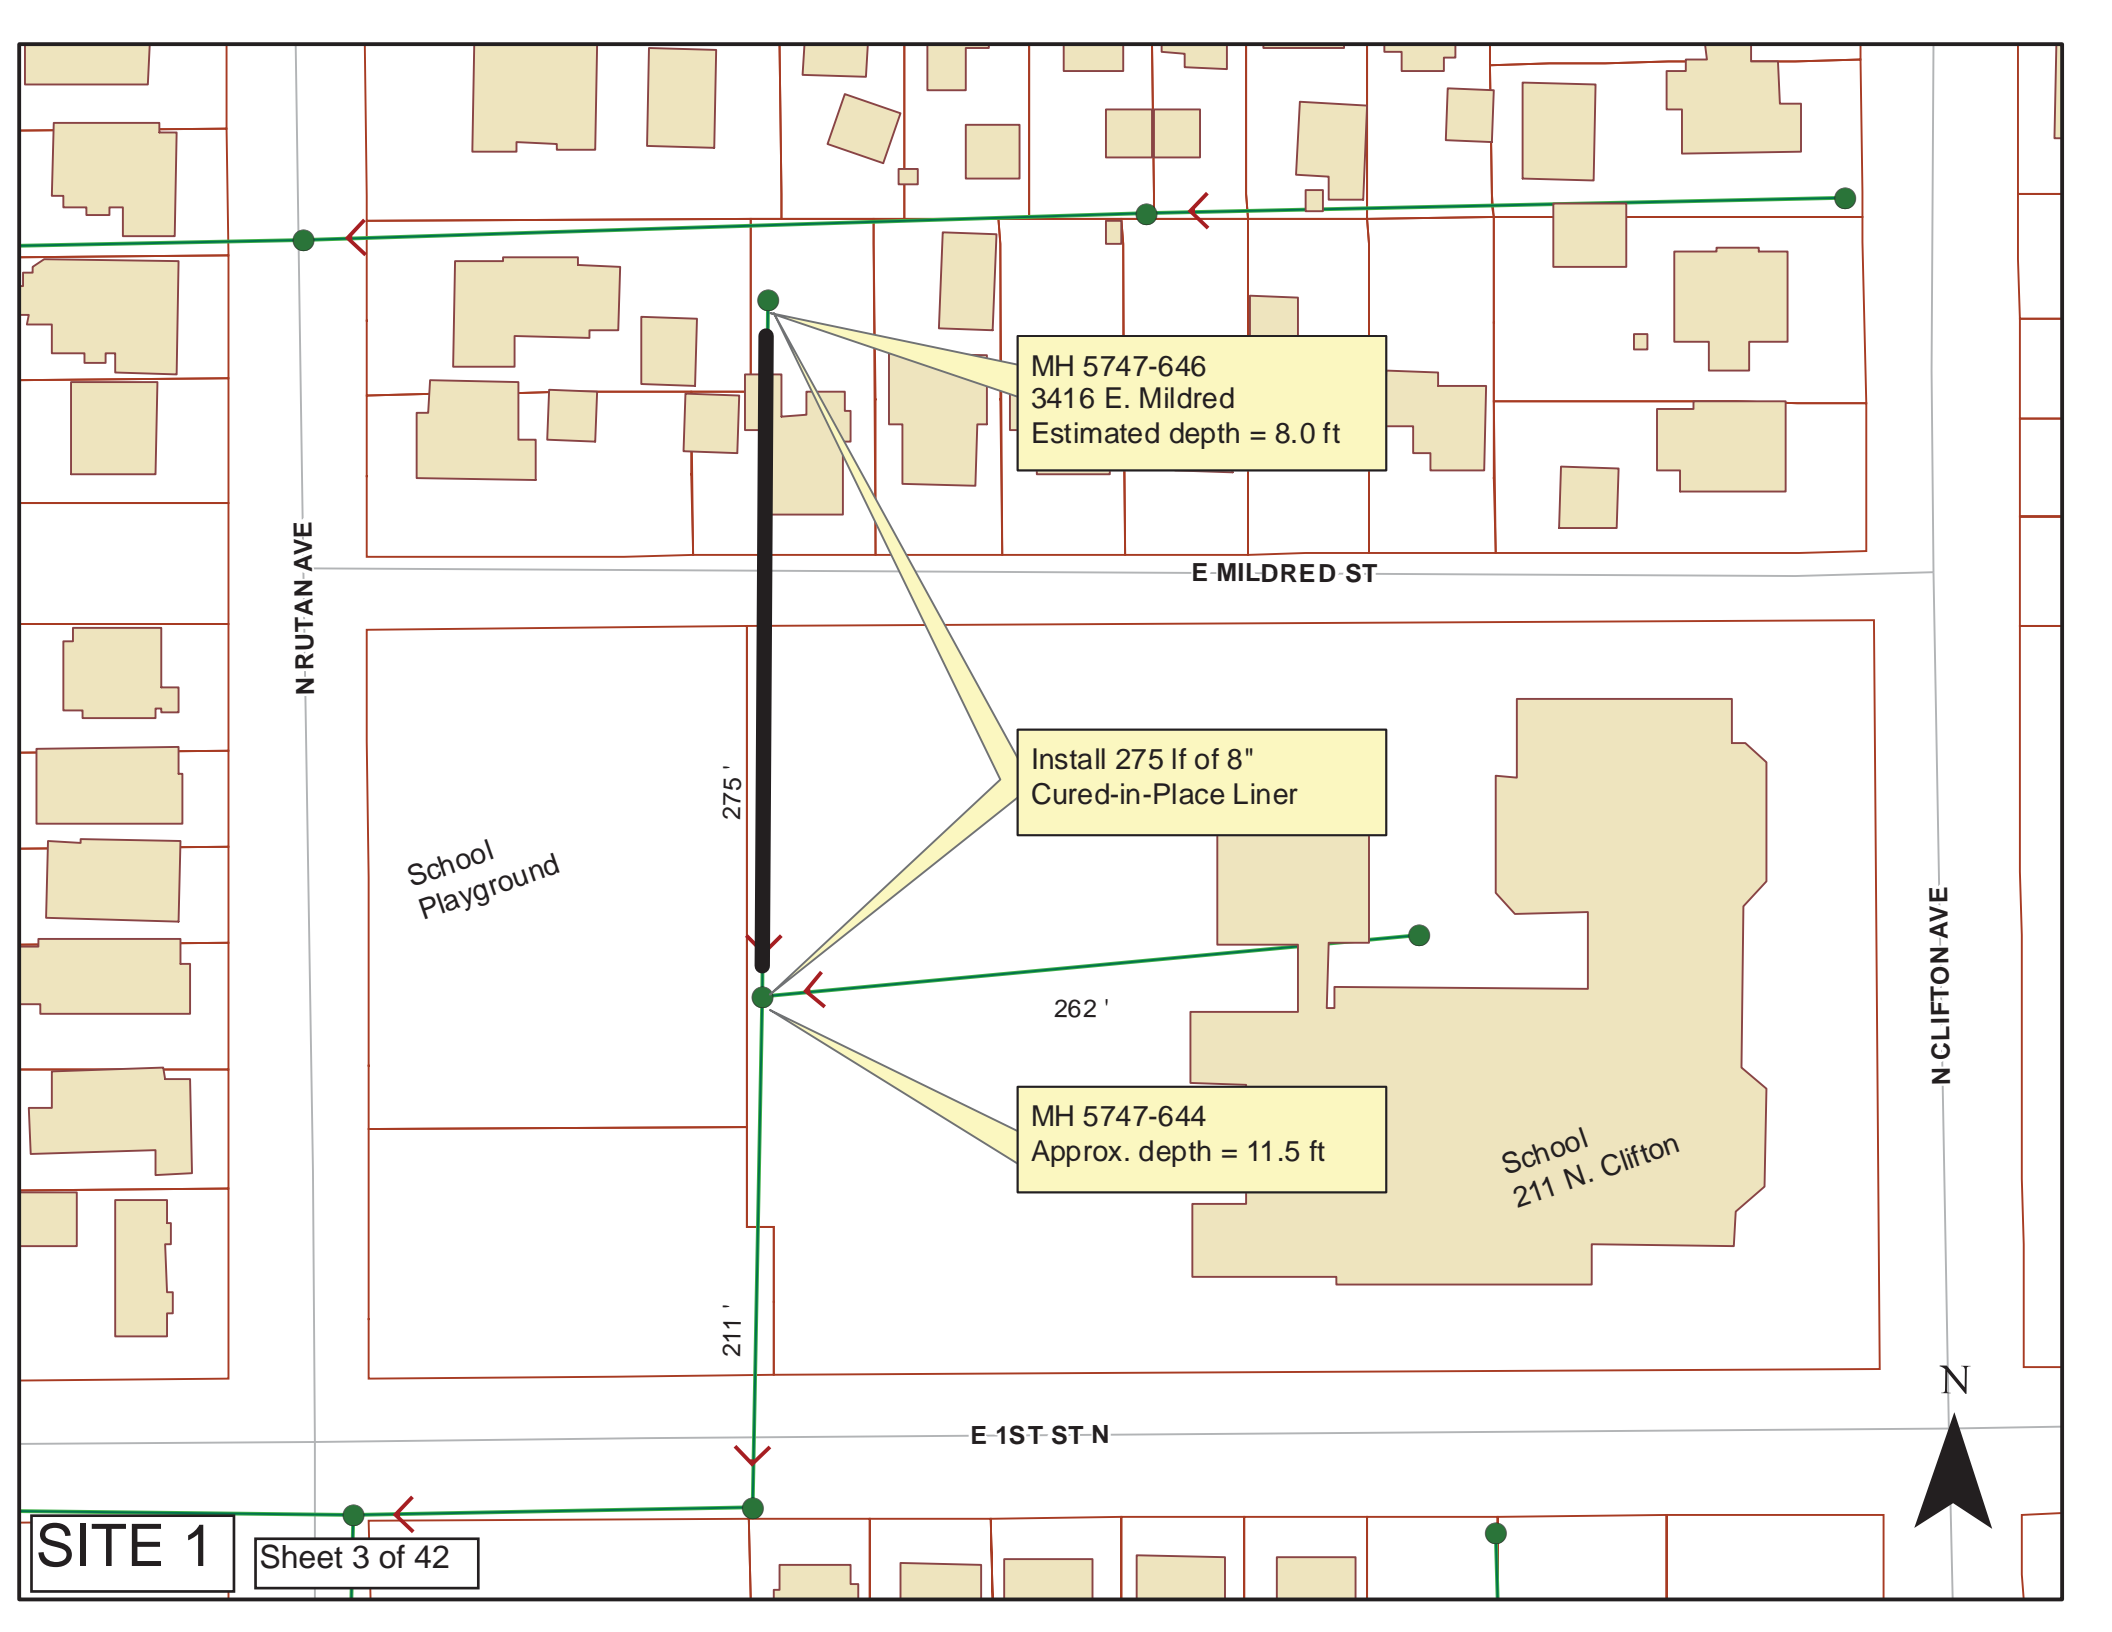

Video Inspection Master Report

3/6/2012
10:13 AM

US Structure: **5747-646** 3416 E MILDRED Date Insp: 5/18/2011 Basin: **EC02A**
 DS Structure: **5747-644** 211 N CLIFTON AVE Dir Televised: Downstream To Upstream

Pipe Information
 Project No. : C-113 Dia: 8 Material: VCP Length: 275.9 Slope: 0.015 DVD #0653

Obs. #	VTR Counter	Distance	Location	Description	Rating	Ratings			
						Obsrvd (gpm)	Est. (gpm)	Remain (gpm)	
1		0.0	TV AGAINST FLOW	5747-644 DS Manhole	1	0.000	0	0	0.000
		3.0		Radial Cracks					
2		4.9		Wye Service	1	0.000	0	0	0.000
3		30.0	heavy mineral deposits at wye	Wye Service	2	0.000	0	0	0.000
4		57.8		Wye Service	1	0.000	0	0	0.000
5		82.8		Wye Service	1	0.000	0	0	0.000
6		98.0	vacant lot / wye not sealed at the main	Wye Service / debris		0.000	0	0	0.000
7		102.9	vacant lot / old service broken down	Wye Service	3	0.000	2	0	0.000
8		105.1	vacant lot / wye not sealed at the main	Wye Service / mineral deposits					
9		130.5		Wye Service	1	0.000	0	0	0.000
10		154.4	Observation Hole	Broken Pipe	5	0.060	100	0	0.060
<p>Pipe broken & missing around the OH. OH lid in street pavement is vented and allows inflow. INTERNAL CIPP SLEEVE INSTALLED BY SEWER MAINTENANCE, JUNE 2012. SHOULD BE READY TO INSTALL CIPP.</p>									
11		189.0	(camera does not stop to look)	West Wye Service					
12		193.7		Wye Service	1	0.000	0	0	0.000
13		215.4	240 N RUTAN	W Break-In Conn	3	TAP HAS A LOT OF ROOTS			
14		216.6	3416 W MILDRED	E Break-In Conn	3	TAP HAS A LOT OF ROOTS			
15		218.9		Wye Service	1	0.000	0	0	0.000
16		241.4		Wye Service	1	0.000	0	0	0.000
17		244.0		Wye Service	1	0.000	0	0	0.000
18		260.2		Crack-Horizontal	3	0.004	5	0	0.004
19		261.5	244 N RUTAN	Wye Service	1	0.000	0	0	0.000
20		264.2		Wye Service	1	0.000	0	0	0.000
21		266.7	Wye in crown / this could possibly be an old flushing hole / if not a connection, then seal it off with CIPP						
22		270.1	5747-646 US Manhole	MH is visible north of the house.	2				

NOTE: If there is no address shown for a Wye Service, this indicates that the wye is clearly sealed off at the main.