


**SITE 5**

Sheet 22 of 42



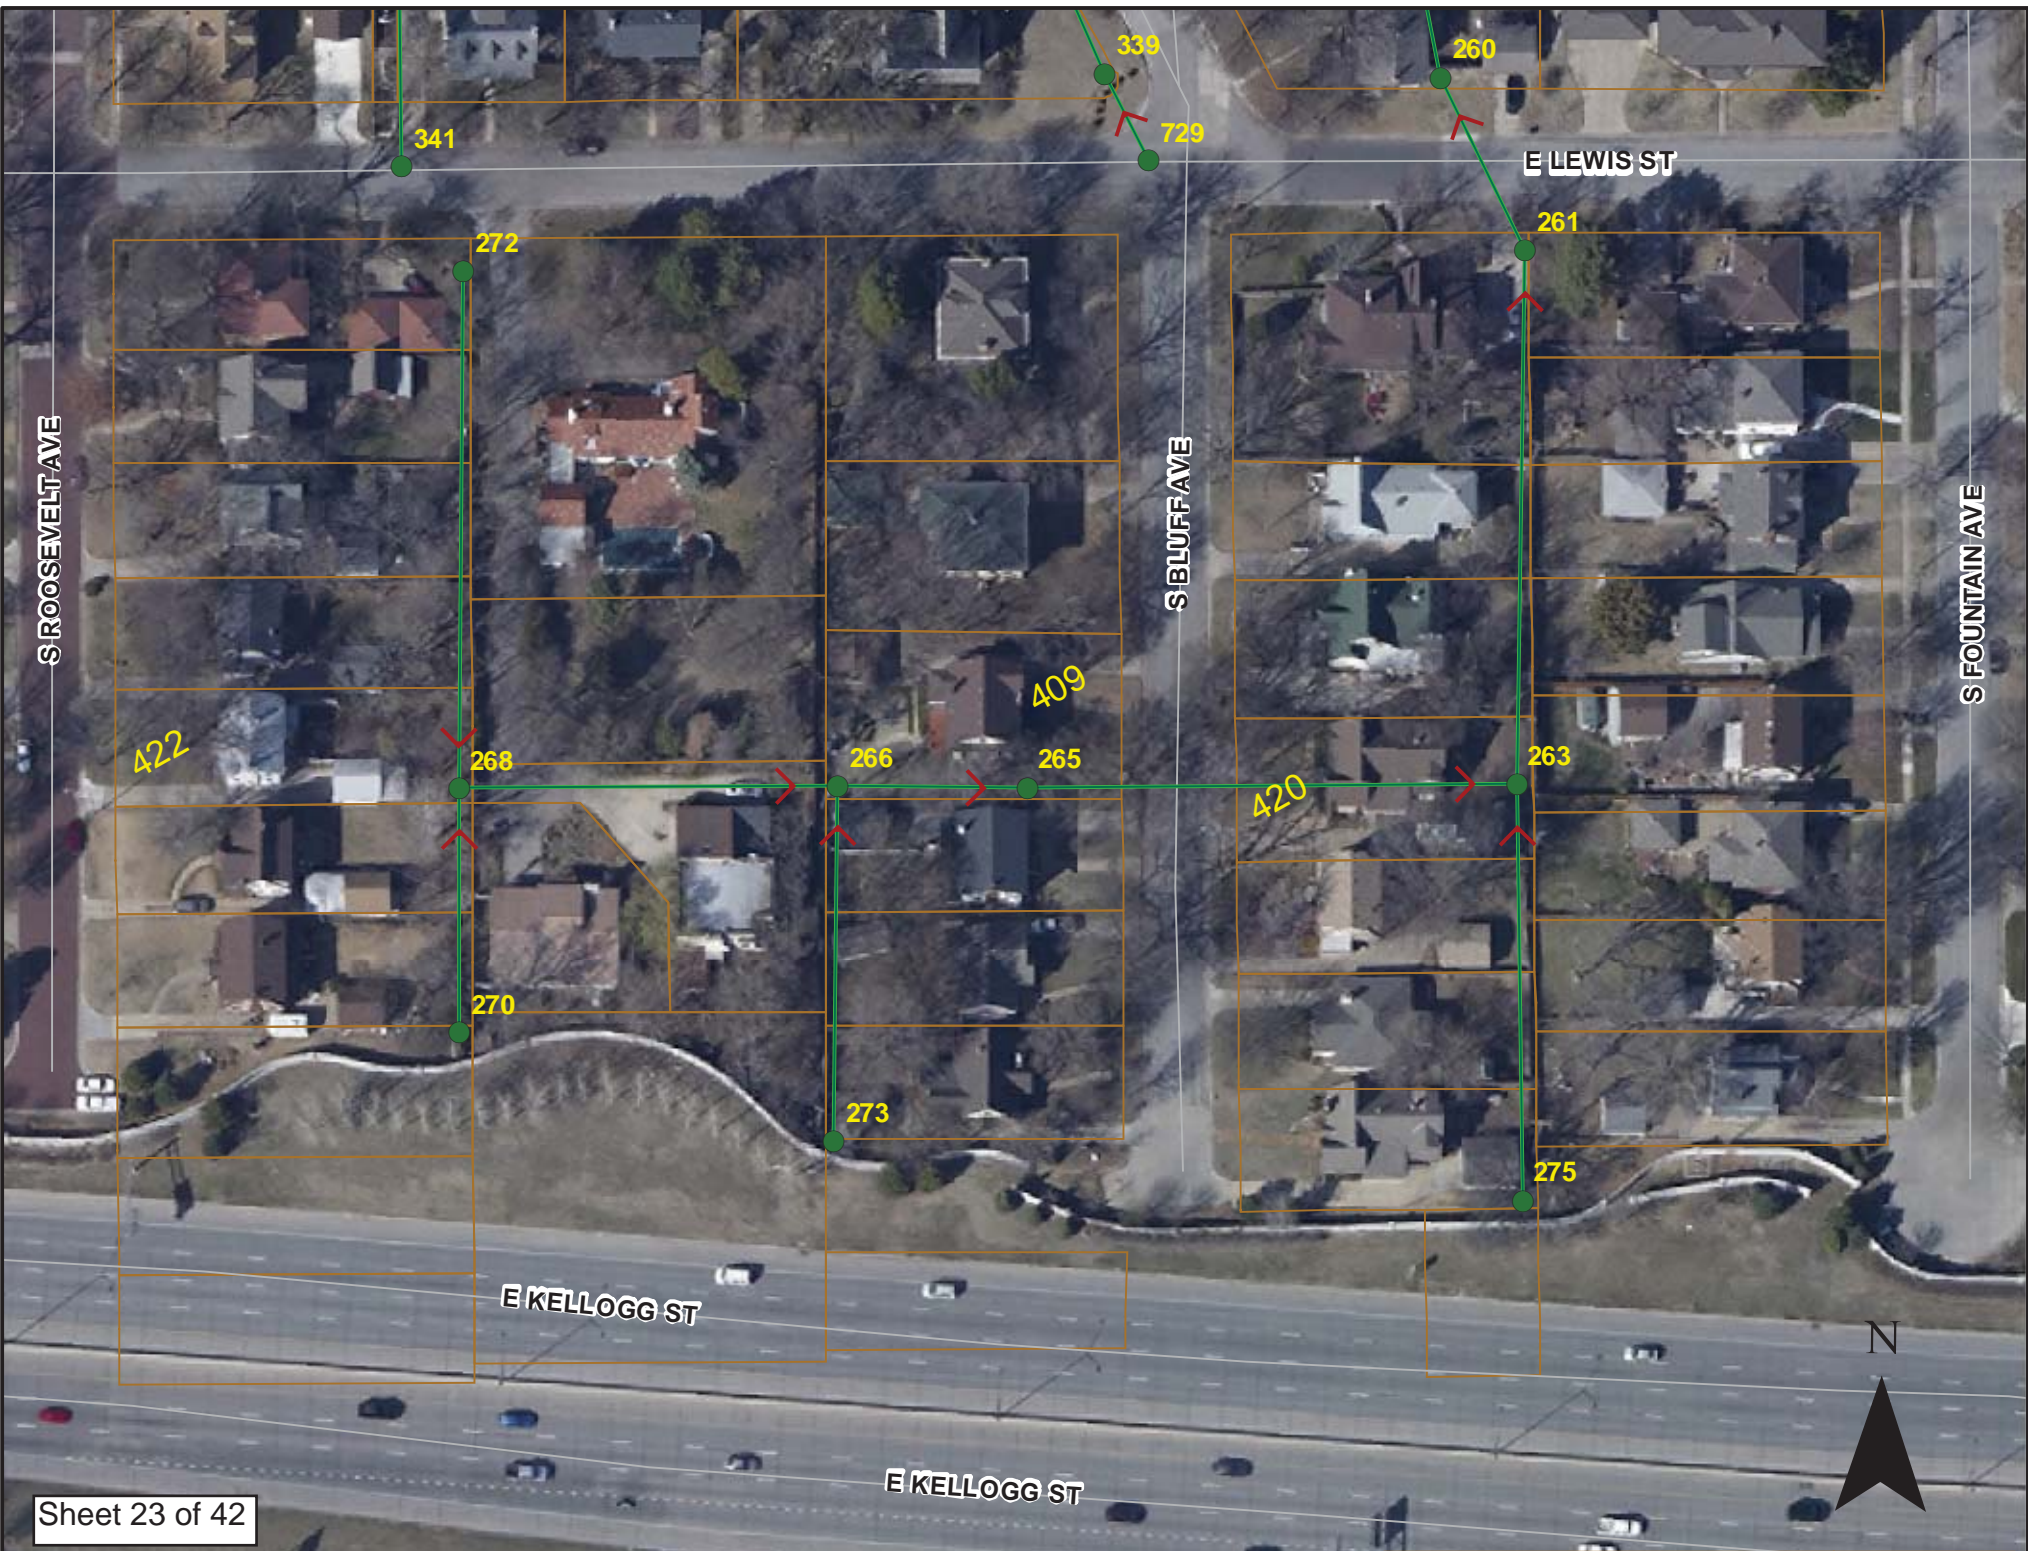

# Video Inspection Master Report

8/3/2012  
1:19 PM

US Structure: 5747-268      422 S ROOSEVELT ST      Date Insp: 6/11/2012      Basin: EC01G  
 DS Structure: 5747-266      409 S BLUFF ST      Dir Televised: Upstream To Downstream

**Pipe Information**  
 Project No. : C-085      Dia: 8      Material: VCP      Length: 154.5      Slope: 0.400

Comments: POINT REPAIR 113 FEET EAST OF M.H 5747-268 FOR BROKEN PIPE. LINE SEGMENT 3

Obs. #	VTR	Counter	Distance	Location	Description	Rating	Ratings		
							Obsrvd (gpm)	Est. (gpm)	Remain (gpm)
1			0.0		5747-268 US Manhole	1			
2			4.1		Sealed Off Wye	1			
3			7.7		Sealed Off Wye	1			
4			28.1		Sealed Off Wye	1			
5			30.4		Sealed Off Wye	1			
6			53.5		Sealed Off Wye	1			
7			56.0		Sealed Off Wye	1			
8			79.4		Sealed Off Wye	1			
9			81.7		Sealed Off Wye	1			
10			104.3		Sealed Off Wye	1			
11			106.7		Sealed Off Wye	1			
12			113.0		Observation Hole	5			
OH is cracked all around, including the invert of the pipe at that point. We should be able to line through this.									
13			129.6		Sealed Off Wye	1			
14			132.2		Sealed Off Wye	1			
15			157.3		Sealed Off Wye	1			
16			158.8		5747-266 DS Manhole New frame & cover to be installed "by others"	1			

NO TAPS

## Video Inspection Master Report

8/3/2012  
1:19 PM

**US Structure:** 5747-266      **409 S BLUFF ST**      **Date Insp:** 6/11/2012      **Basin:** EC01G  
**DS Structure:** 5747-265      **409 S BLUFF ST**      **Dir Televised:** Upstream To Downstream

Pipe Information

**Project No. :** C-085      **Dia:** 8      **Material:** VCP      **Length:** 79.2      **Slope:** 0.400      **Surface:** Rear Easement

Obs. #	VTR Counter	Distance	Location	Description	Rating	Ratings			
						Obsrvd (gpm)	Est. (gpm)	Remain (gpm)	
1		0.0		US Manhole 5747-266	1				
2		9.9		Crack-Horizontal	2				
3		20.1		Broken Pipe	2				
4		22.1		Crack-Radial	2				
5		23.9		Sealed Off Wye	1				
6		26.3		Sealed Off Wye	1				
7		27.5		Broken Pipe	3				
8		30.3		Broken Pipe	4				
9		32.6		Crack-Radial	5				
10		49.2		Sealed Off Wye	1				
11		51.8		Sealed Off Wye	1				
12		55.2		Roots	2				
13		55.9	409 S BLUFF	Break-in Conn	5				
			Ball of roots at this location. Should be tap for 409 S Bluff?						
14		60.0		Roots	3				
15		66.6		Sealed Off Wye	1				
16		69.4		Sealed Off Wye	1				
		72.0		Loose tile piled up from cleaner					
17		79.2		DS Manhole 5747-265	1				

## Video Inspection Master Report

8/3/2012  
1:19 PM

**US Structure:** 5747-265      **409 S BLUFF ST**      **Date Insp:** 3/23/2011      **Basin:** EC01G  
**DS Structure:** 5747-263      **420 S BLUFF ST**      **Dir Televised:** Upstream To Downstream

**Pipe Information**

Shape: Round	Length Status: VCP	Project No. : C-085
Dia/Ht: 8	Material: VCP	DVD #0640
Length: 235.8	Slope: 0.400	Surface: Rear Easement

Obs. #	VTR Counter	Distance	Location	Description	Rating	Ratings		
						Obsrvd (gpm)	Est. (gpm)	Remain (gpm)
1		0.0		5747-265 US Manhole	1	0.000	0	0.000
2		24.0		Sealed Off Wye	1	0.000	0	0.000
3		25.6		Sealed Off Wye	1	0.000	0	0.000
4		48.5		Sealed Off Wye	1	0.000	0	0.000
5		50.9		Sealed Off Wye	1	0.000	0	0.000
6		54.7		Roots	1	0.002	1	0.002
7		65.1		(roots extend across the pipe / heavy roots)	4	0.010	10	0.010
8		73.9		Sealed Off Wye	1	0.000	0	0.000
9		75.9		Sealed Off Wye	1	0.000	0	0.000
10		98.2		Sealed Off Wye	1	0.000	0	0.000
11		100.7		Sealed Off Wye	1	0.000	0	0.000
12		114.4		Observation Hole / pipe busted all around the OH opening (located in a front yard / we should be able to line through this)	5	0.000	0	0.000
13		123.3		Sealed Off Wye	1	0.000	0	0.000
14		125.8		Sealed Off Wye	1	0.000	0	0.000
15		148.6		Sealed Off Wye	1	0.000	0	0.000
16		151.1		Sealed Off Wye	1	0.000	0	0.000
17		173.8		Sealed Off Wye	1	0.000	0	0.000
18		176.2		Sealed Off Wye	1	0.000	0	0.000
19		197.4		Sealed Off Wye	1	0.000	0	0.000
20		200.1		Sealed Off Wye	1	0.000	0	0.000
21		224.3		Sealed Off Wye	1	0.000	0	0.000
22		225.5		Sealed Off Wye	1	0.000	0	0.000
23		234.1		5747-263 DS Manhole New frame & cover to be installed "by others"	1	0.000	0	0.000

**LINE RUNS UNDER A HOUSE**

There are roots, gapped joints and offset joints not listed on the log.