


MH 5744-117  
 Replace Manhole Frame & Cover  
 Estimated Pipe Depth (West) = 6 ft  
 Approx MH Depth = 18.8 ft  
 Modify Existing Outside Drop (West)  
 SEE GENERAL NOTES

5744-244CO (cleanout)  
 Construct Shallow Manhole  
 (removal of an existing cleanout  
 shall be incidental)  
 Depth unknown / not found

Remove 85 lf of 6" Pipe  
 Install 85 lf of 8" Pipe

Estimated 5 Service Reconnections (4")  
 Estimated 20 lf Silt Fence

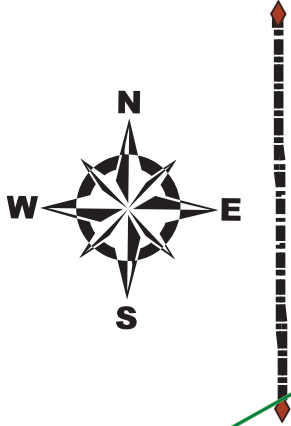

**SITE 4**

E ROSEBERRY ST

E ROSEBERRY CT

3952

3961

3967

3971

3955

3959

3951

3943

3947

3935

3937





# Television Inspection Master Report

6/3/2009  
9:48 AM

US Structure: 5744-244CO      3943 E. Roseberry      Date Insp: 9/30/2008      Basin: C01A  
 DS Structure: 5744-117      3955 E. Roseberry      Dir Televised: Down->Up

Pipe Information

Dia: 6      Material: VCP      Length: unknown      Project No.: I-077      DVD #0442

Obs. #	VTR	Counter	Distance	Location	Description	Rating	Ratings					
							Obsrvd (gpm)	Est. (gpm)	Struct	Clean	Remain (gpm)	
1					0.0 DS Manhole TV AGAINST THE FLOW		3955 E. Roseberry					
2			1.5	Crack	Radial	1		0.002	1	1	0.002	
3			2.0	Outside drop hole	Invert							
4			6.0		Sag begins							
5			6.6		Grease							
6			7.2	Offset Joint								
7			7.2	Pipe dips downward just past the offset joint	/ CAMERA CANNOT PASS							

**NO TELEVISIONING OF THIS LINE IS AVAILABLE**

Estimate the pipe to be between 5' to 6' deep.

Caution: SWS crossing at or near this breakdown point