

5948-310 - 5948-309 Approx. 3 Taps
 5948-309 - 5948-308 Approx. 3 Taps
 5948-308 - 5948-307 Approx. 4 Taps
 5948-307 - 5948-306 Approx. 4 Taps

MH 5948-310
 Approx Depth = 9.8

MH 5948-309
 Approx Depth = 9.8



MH 55948-308
 Approx Depth = 9.8

MH 55948-307
 Approx Depth = 11.19

MH 5948-306
 Approx Depth = 11.53

Install 1184 lf of 8" Cured-in-Place Liner
 from MH 5948-310 to MH 5948-306

SITE #10

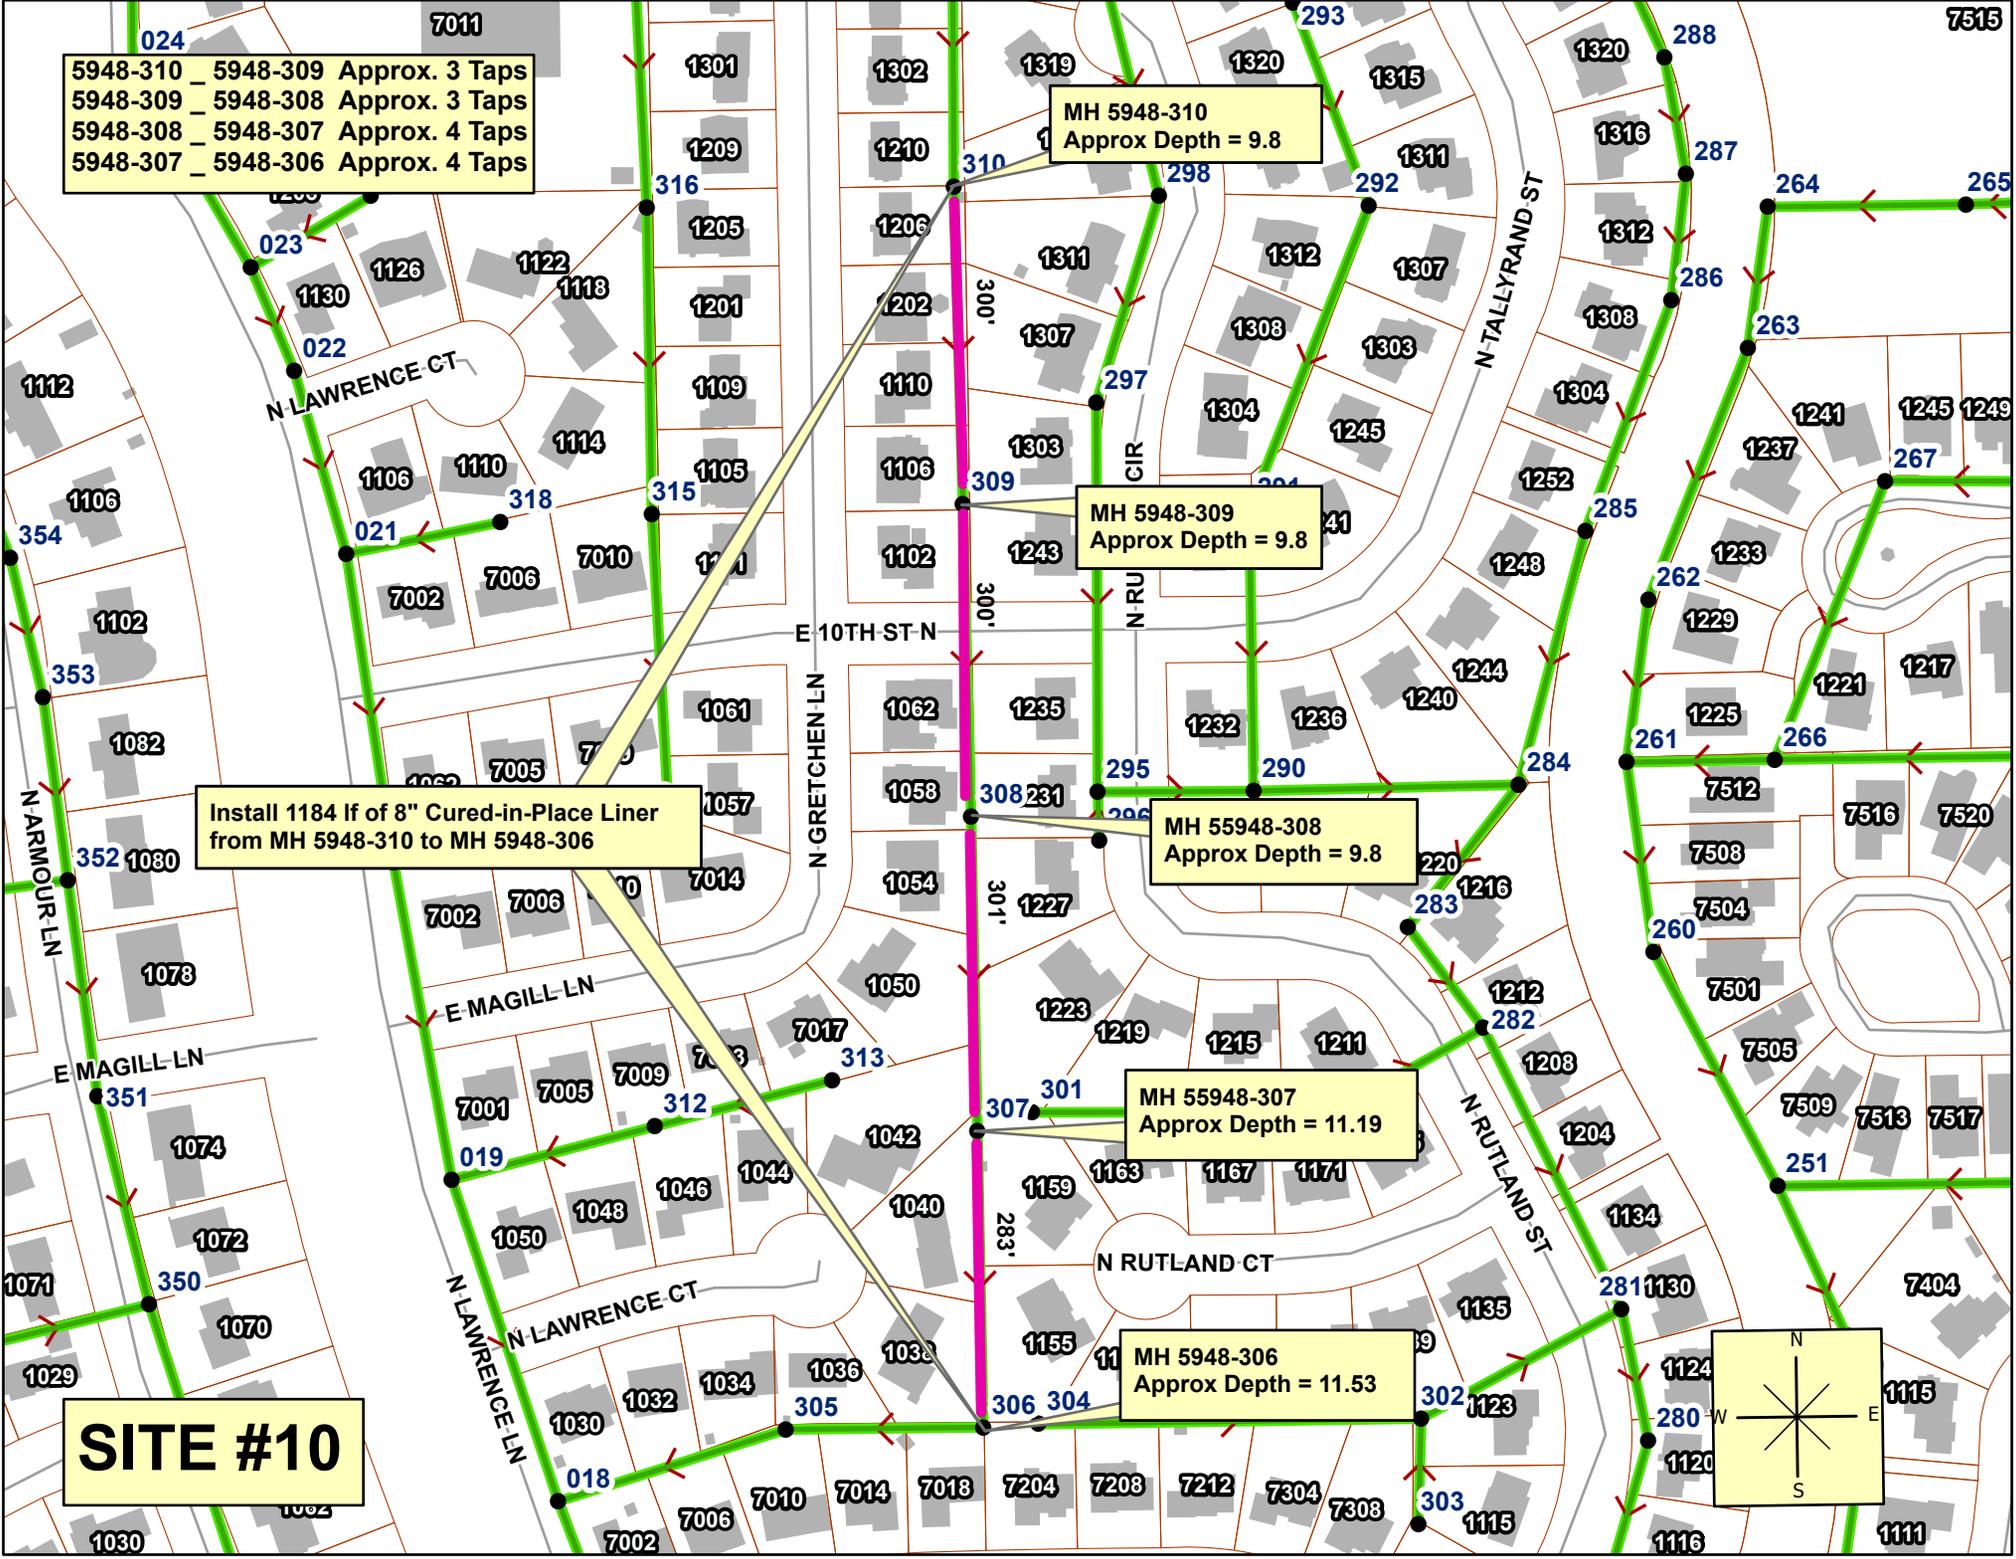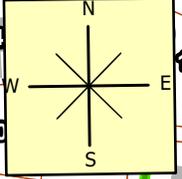

Sewer CCTV Observations

5/1/2024

10:45 AM

Alt Pipe ID:		35832		Inspected Date:		9/17/2021 12:45 pm		Survey Direction:			Downstream
Distance:	CCTV Defect :		Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:	
0.00	AMH	Manhole					False	0	0	5948-307	
0.00	MWL	Miscellaneous Water Level			5		False	0	0		
29.30	CM	Crack Multiple				S01	False	3	0		
35.40	CM	Crack Multiple				F01	False	3	0		
37.60	FM	Fracture Multiple				S02	False	4	0		
42.50	FM	Fracture Multiple				F02	False	4	0		
57.30	CM	Crack Multiple				S03	False	3	0		
66.80	CM	Crack Multiple				F03	False	3	0		
75.30	TFC	Tap Factory Capped	2				False	0	0		
94.30	FL	Fracture Longitudinal	8				False	3	0		
103.30	FM	Fracture Multiple	7	5		S04	False	4	0		
116.20	FM	Fracture Multiple	7	5		F04	False	4	0		
117.00	TB	Tap Break-in/Hammer	2				False	0	0	1040 N LAWRENCE	
157.20	TFC	Tap Factory Capped	2				False	0	0		
229.70	RMJ	Roots Medium Joint			30		False	0	3		
256.80	TFC	Tap Factory Capped	2				False	0	0		
269.60	FL	Fracture Longitudinal	4				False	3	0		
278.60	FC	Fracture Circumferential	7	6			False	2	0		
281.20	AMH	Manhole					False	0	0	5948-306	

Sewer CCTV Observations

5/1/2024

10:43 AM

Alt Pipe ID:	35833	Inspected Date:	9/17/2021	11:24 am	Survey Direction:	Downstream			
Distance:	CCTV Defect :	Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH Manhole				False	0	0		5948-308
0.00	MWL Miscellaneous Water Level			5	False	0	0		
86.90	CC Crack Circumferential	5	8		False	1	0		
49.30	FC Fracture Circumferential	5	8		False	2	0		
98.50	RBC Roots Ball Connection	3		75	False	0	4		
98.90	TFA Tap Factory Activity	2			False	0	0		1054 N GRETCHEN
132.50	CC Crack Circumferential	7	8		False	1	0		
161.30	TFC Tap Factory Capped	2			False	0	0		
186.50	CM Crack Multiple	7	5		S1 False	3	0		
191.80	CM Crack Multiple	7	5		F1 False	3	0		
208.00	TSA Tap Saddle Activity	2			False	0	0		1050 N GRETCHEN
245.00	CM Crack Multiple	12	9		S2 False	3	0		
250.00	CM Crack Multiple	12	9		F2 False	3	0		
266.40	TFC Tap Factory Capped	2			False	0	0		
291.60	FM Fracture Multiple	7	5		False	4	0		
301.50	AMH Manhole				False	0	0		5948-307

Sewer CCTV Observations

5/1/2024

10:40 AM

Alt Pipe ID:	35834	Inspected Date:	9/17/2021	10:43 am	Survey Direction:	Downstream			
Distance:	CCTV Defect :	Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH Manhole					False	0	0	5948-309
0.00	MWL Miscellaneous Water Level			5		False	0	0	
47.50	TSA Tap Saddle Activity	3				False	0	0	1102 N GRETCHEN
81.40	TFC Tap Factory Capped	2				False	0	0	
86.60	CM Crack Multiple	6	5		S1	False	3	0	
95.30	CM Crack Multiple	6	5		F1	False	3	0	
122.50	RMJ Roots Medium Joint					False	0	3	
125.40	FM Fracture Multiple	7	5			False	4	0	
126.80	BSV Broken Soil Visible	12	6			False	5	0	
138.60	RMJ Roots Medium Joint					False	0	3	
223.70	RMJ Roots Medium Joint			20		False	0	3	
225.30	TRD Tap Rehabilitated Defective	2				False	0	3	1062 E MAGILL
283.20	CC Crack Circumferential	5	7			False	1	0	
300.40	AMH Manhole					False	0	0	5948-308

Sewer CCTV Observations

5/1/2024

10:38 AM

Alt Pipe ID:	35835	Inspected Date:	9/20/2021	12:11 pm	Survey Direction:	Downstream			
<u>Distance:</u>	<u>CCTV Defect :</u>	<u>Clock 1:</u>	<u>Clock 2:</u>	<u>%</u>	<u>Contin:</u>	<u>Doc:</u>	<u>Struct:</u>	<u>O&M:</u>	<u>Remarks:</u>
0.00	MWL	Miscellaneous Water Level		5		False	0	0	
61.60	MSA	Miscellaneous Survey Abandon				False	0	0	PLUMBING SNAKE AND HEAD
0.00	AMH	Manhole				False	0	0	5948-310
61.30	RMJ	Roots Medium Joint		25		False	0	3	

Alt Pipe ID:	35835	Inspected Date:	9/17/2021	9:18 am	Survey Direction:	Upstream			
<u>Distance:</u>	<u>CCTV Defect :</u>	<u>Clock 1:</u>	<u>Clock 2:</u>	<u>%</u>	<u>Contin:</u>	<u>Doc:</u>	<u>Struct:</u>	<u>O&M:</u>	<u>Remarks:</u>
0.00	AMH	Manhole				False	0	0	5948-309
0.00	MWL	Miscellaneous Water Level		5		False	0	0	
1.00	FM	Fracture Multiple	1	12		False	4	0	
5.00	JOL	Joint Offset Large				False	4	0	
10.00	TFA	Tap Factory Activity	10			False	0	0	1106 N GRETCHEN
14.10	JOL	Joint Offset Large				False	4	0	
75.40	CM	Crack Multiple	9	3		False	3	0	
84.70	TSA	Tap Saddle Activity	10			False	0	0	1110 N GRETCHEN
164.20	RMJ	Roots Medium Joint		20		False	0	3	
167.00	TFA	Tap Factory Activity	10			False	0	0	1202 N GRETCHEN
218.30	MSA	Miscellaneous Survey Abandon				False	0	0	PLUMBERS SNAKE AND HEAD