



5948-088 _ 5948-087 Approx. 10 Taps

MH 5948-088
Approx Depth = 12.42

Install 247 lf of 8" Cured-in-Place Liner
from MH 5948-088 to MH 5948-087

MH 5948-087
Approx Depth = 11.31

SITE 6

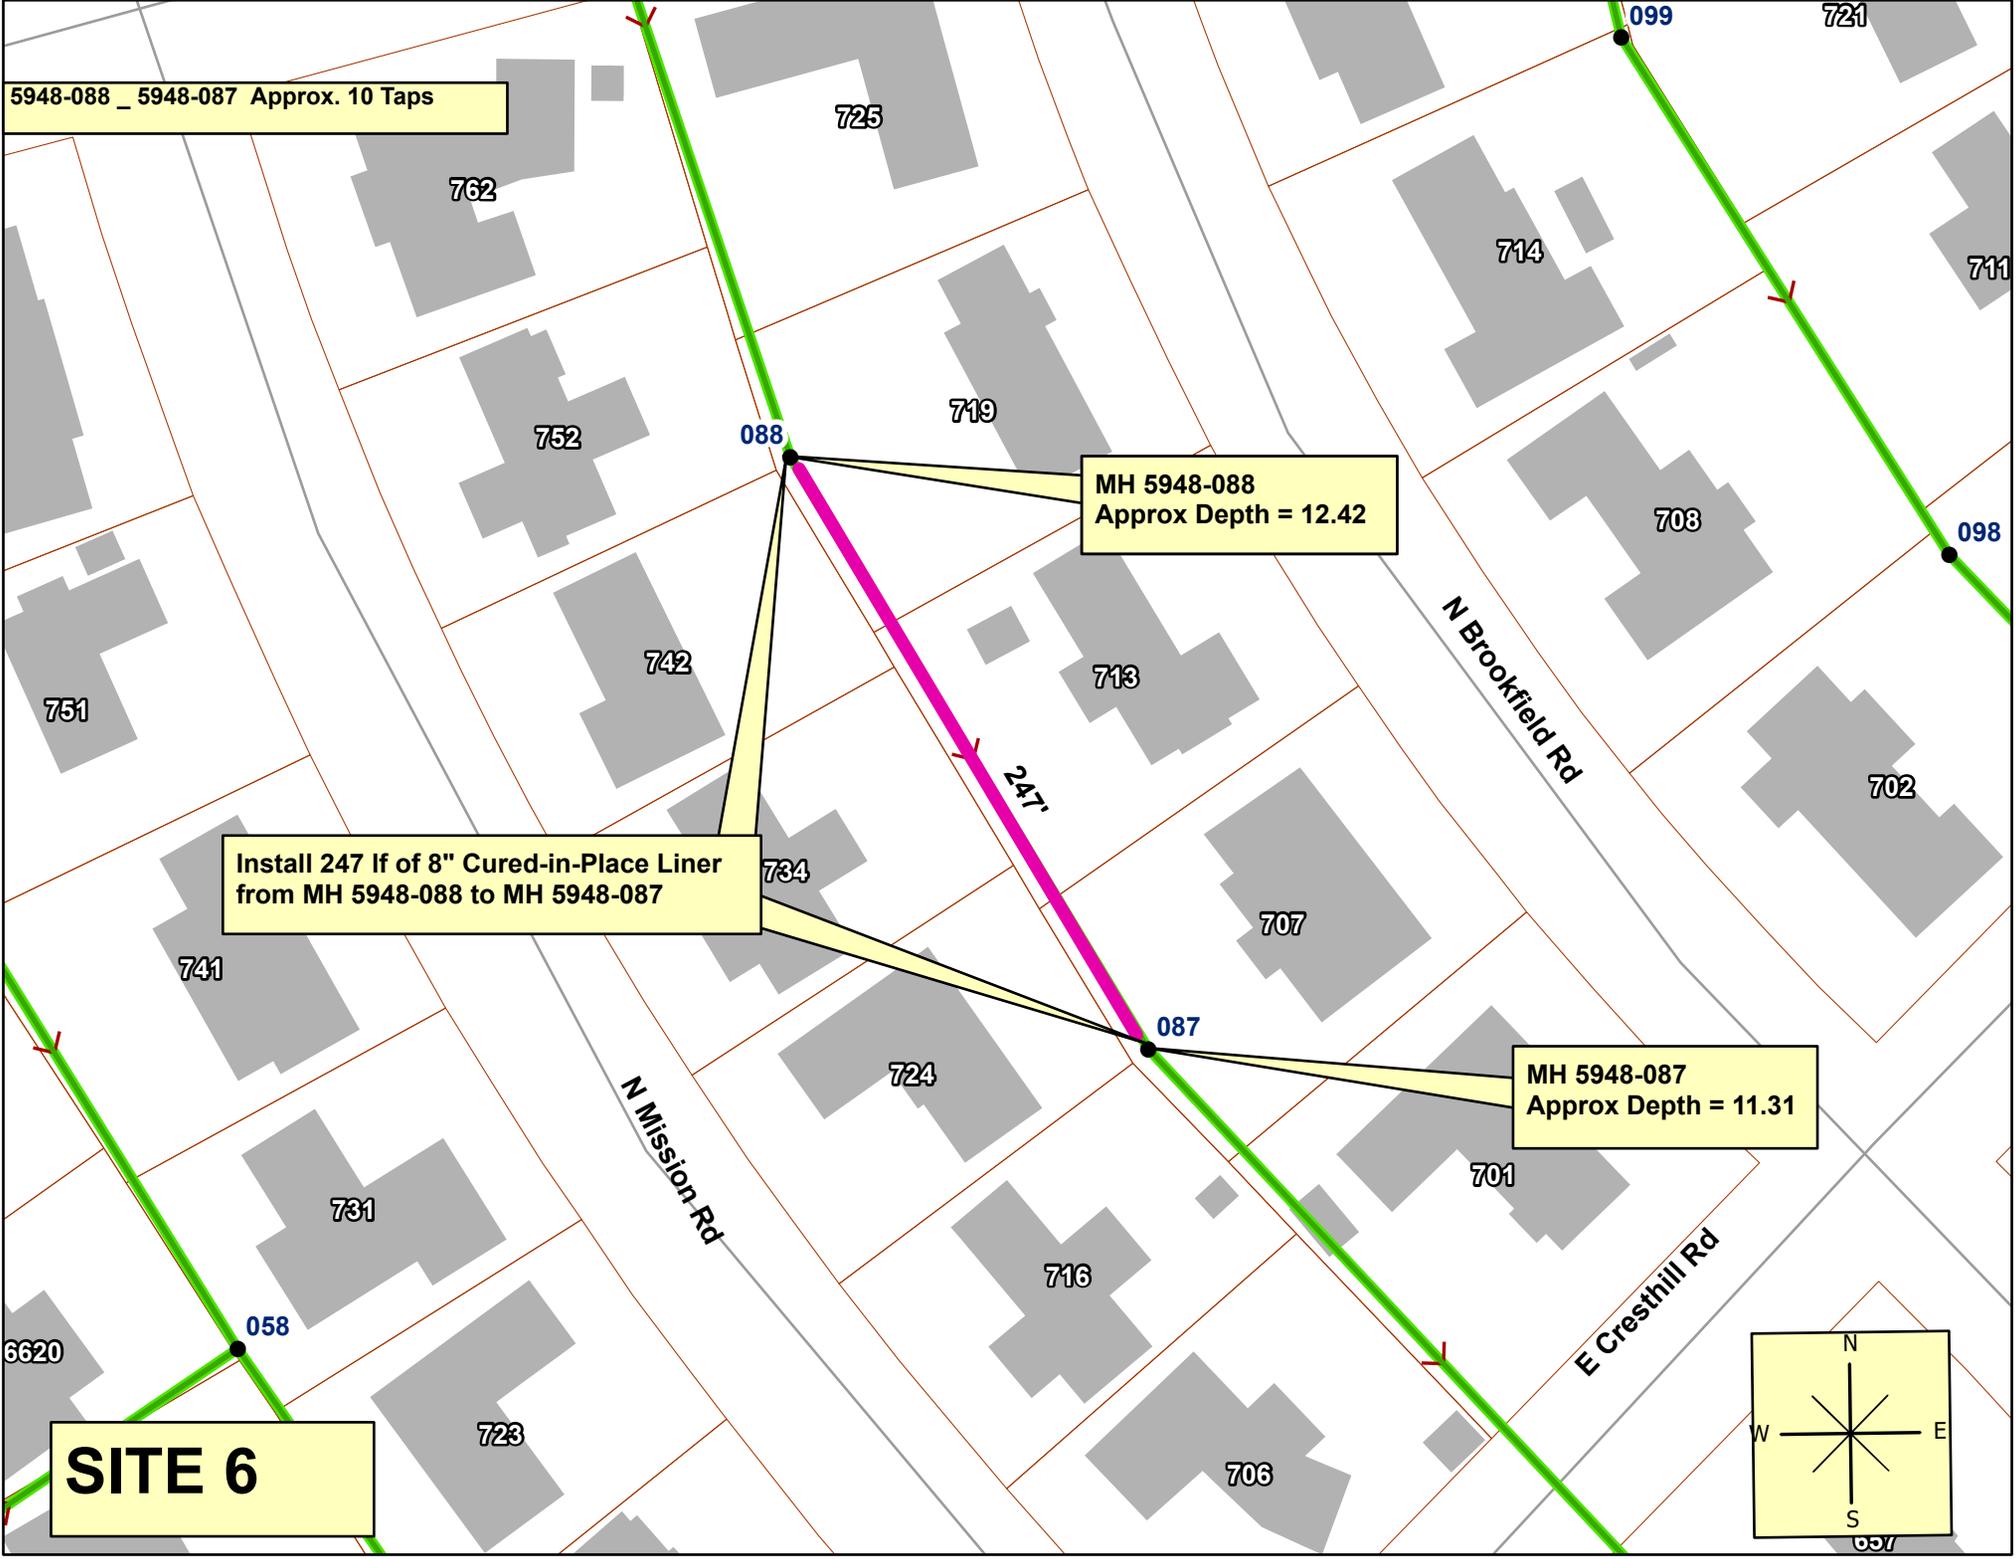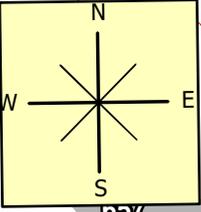

Sewer CCTV Observations

5/1/2024

10:16 AM

Alt Pipe ID: 35613			Inspected Date: 9/17/2021				Survey Direction: Upstream			
Distance:	CCTV Defect :		Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH	Manhole					False	0	0	5948-087
0.00	MWL	Miscellaneous Water Level			5		False	0	0	
1.90	CM	Crack Multiple	8	10			False	3	0	
15.90	TFA	Tap Factory Activity	10				False	0	0	724 N.MISSION RD.
46.60	TFC	Tap Factory Capped	2				False	0	0	
94.50	TFA	Tap Factory Activity	11				False	0	0	734 N.MISSION RD.
97.90	TFC	Tap Factory Capped	11				False	0	0	
101.40	BSV	Broken Soil Visible	7	5			False	5	0	
101.40	MSA	Miscellaneous Survey Abandon					False	0	0	BROKEN PIPE,CAMERA CAN

Alt Pipe ID: 35613			Inspected Date: 9/17/2021				Survey Direction: Downstream			
Distance:	CCTV Defect :		Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH	Manhole					False	0	0	5948-088
0.00	MWL	Miscellaneous Water Level			5		False	0	0	
18.70	TFC	Tap Factory Capped	11				False	0	0	
41.30	TBA	Tap Break-in Activity	10				False	0	0	719 N.BROOKFIELD RD.
67.80	TFC	Tap Factory Capped	2				False	0	0	
74.80	HSV	Hole Soil Visible	1	2			False	5	0	
75.40	TFA	Tap Factory Activity	2				False	0	0	742 N.MISSION RD.
110.50	TFC	Tap Factory Capped	11				False	0	0	
143.30	BSV	Broken Soil Visible	7	5			False	5	0	
144.40	TFA	Tap Factory Activity	10				False	0	0	713 N.BROOKFIELD RD.
144.40	BSV	Broken Soil Visible	7	5			False	5	0	
144.40	MSA	Miscellaneous Survey Abandon					False	0	0	BRIKEN PIPE,CAMERA CAN N