

5948-068 - 5948-062 Approx. 6 Taps
 5948-064 - 5948-063 Approx. 4 Taps
 5948-063 - 5948-062 Approx. 11 Taps
 5948-067 - 5948-066 Approx. 8 Taps

MH 5948-067
 Approx Depth = 7.7

MH 5948-066
 Approx Depth = 6.93

MH 5948-063
 Approx Depth = 6.7

MH 5948-064
 Approx Depth = 5.48

Install 232 lf of 8" Cured-in-Place Liner
 from MH 5948-067 to MH 5948-066


MH 5948-068
 Approx Depth = 6.34

Install 446 lf of 8" Cured-in-Place Liner
 from MH 5948-064 to MH 5948-062

Install 235 lf of 8" Cured-in-Place Liner
 from MH 5948-068 to MH 5948-062

MH 5948-062
 Approx Depth = 9.88

SITE 7

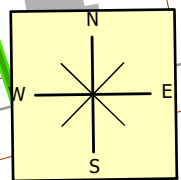

Sewer CCTV Observations

5/1/2024

10:23 AM

Alt Pipe ID: 35588			Inspected Date: 8/4/2021				Survey Direction: Upstream			
Distance:	CCTV Defect :		Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH	Manhole					False	0	0	5948-062
0.00	MWL	Miscellaneous Water Level			5		False	0	0	
0.00	RFB	Roots Fine Barrel	7	8			False	0	2	
0.00	CM	Crack Multiple	9	3			False	3	0	
20.50	TBD	Tap Break-in Defective	11				False	0	3	920 N SAINT JAMES PL.
23.20	TFA	Tap Factory Activity	2				False	0	0	905 N MISSION RD.
44.00	RFJ	Roots Fine Joint	9				False	0	1	
49.30	RFJ	Roots Fine Joint	4				False	0	1	
52.90	RFJ	Roots Fine Joint	7				False	0	1	
58.30	RMJ	Roots Medium Joint	7		40		False	0	3	
58.30	MSA	Miscellaneous Survey Abandon					False	0	0	ROOTBALL IN THE SEWER LI
Alt Pipe ID: 35588			Inspected Date: 8/4/2021				Survey Direction: Downstream			
Distance:	CCTV Defect :		Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH	Manhole					False	0	0	5948-063
0.00	MWL	Miscellaneous Water Level			5		False	0	0	
0.00	BSV	Broken Soil Visible	7	5			False	5	0	
8.60	TFA	Tap Factory Activity	9				False	0	0	933 N MISSION RD.
9.80	CM	Crack Multiple	7	5			False	3	0	
16.90	CM	Crack Multiple	7	5			False	3	0	
17.60	HSV	Hole Soil Visible	8	10			False	5	0	
17.60	CM	Crack Multiple	7	5			False	3	0	
19.80	TFC	Tap Factory Capped	10				False	0	0	
22.50	TFC	Tap Factory Capped	2				False	0	0	
26.10	CM	Crack Multiple	9	3			False	3	0	
34.00	CC	Crack Circumferential	10	11			False	1	0	
36.80	CM	Crack Multiple	8	4			False	3	0	
60.70	CM	Crack Multiple	8	4			False	3	0	
61.50	HSV	Hole Soil Visible	1	2			False	5	0	
61.60	TFA	Tap Factory Activity	2				False	0	0	944 N SAINT JAMES PL.
66.30	CM	Crack Multiple	8	4			False	3	0	
75.90	BVV	Broken Void Visible	4				False	5	0	
108.20	CM	Crack Multiple	7	5			False	3	0	
116.70	TFA	Tap Factory Activity	10				False	0	0	923 N MISSION RD.
119.80	TFC	Tap Factory Capped	2				False	0	0	
123.50	CM	Crack Multiple	7	5			False	3	0	
139.30	BSV	Broken Soil Visible	1	2			False	5	0	
140.70	TFA	Tap Factory Activity	2				False	0	0	936 N SAINT JAMES PL.
142.70	HSV	Hole Soil Visible	11				False	5	0	
155.10	CM	Crack Multiple	8	4			False	3	0	
204.80	TFA	Tap Factory Activity	10				False	0	0	915 N MISSION RD.
207.50	TFA	Tap Factory Activity	2				False	0	0	928 N SAINT JAMES PL.
240.10	RFJ	Roots Fine Joint	8	10			False	0	1	
254.30	RBJ	Roots Ball Joint	8	4	75		False	0	4	
256.60	MSA	Miscellaneous Survey Abandon					False	0	0	ROOTBALL IN THE SEWER LI

Sewer CCTV Observations

5/1/2024

10:25 AM

Alt Pipe ID:	35593	Inspected Date:	5/25/2023	11:42 am	Survey Direction:	Upstream			
Distance:	CCTV Defect :	Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH Manhole				False	0	0		5948-062
0.00	MWL Miscellaneous Water Level			5	False	0	0		
41.10	TS Tap Saddle	9			False	0	0		905 N.SAINT JAMES PL.
78.10	TS Tap Saddle	11			False	0	0		6506 E.8TH ST.N
81.50	TS Tap Saddle	2			False	0	0		6511 E.JACQUELINE ST.
162.70	TS Tap Saddle	2			False	0	0		6503 E.JACQUELINE ST.
164.50	TSA Tap Saddle Activity	10			False	0	0		6502 E.8TH ST.N
223.40	TS Tap Saddle	2			False	0	0		6427 E.JACQUELINE ST.
233.10	AMH Manhole				False	0	0		5948-068

Sewer CCTV Observations

5/1/2024

10:21 AM

Alt Pipe ID:	35589		Inspected Date: 7/18/2023 10:29 am			Survey Direction: Downstream				
Distance:	CCTV Defect :		Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH	Manhole					False	0	0	5948-064
0.00	MWL	Miscellaneous Water Level			5		False	0	0	
5.00	CM	Crack Multiple	7	5			False	3	0	
8.00	RMJ	Roots Medium Joint	3	9	20	S01	False	0	3	
10.80	JOM	Joint Offset Medium				S02	False	3	0	
25.70	RMJ	Roots Medium Joint	3	9	20	F01	False	0	3	
32.40	CL	Crack Longitudinal	6			S03	False	2	0	
32.40	CL	Crack Longitudinal	9			S04	False	2	0	
32.40	CL	Crack Longitudinal	3			S05	False	2	0	
35.50	FC	Fracture Circumferential	6	8			False	2	0	
37.40	CL	Crack Longitudinal	6			F03	False	2	0	
37.40	CL	Crack Longitudinal	9			F04	False	2	0	
37.40	CL	Crack Longitudinal	3			F05	False	2	0	
41.90	RFJ	Roots Fine Joint	8	10			False	0	1	
42.60	TF	Tap Factory	2				False	0	0	958 N SAINT JAMES PL
42.60	RML	Roots Medium Lateral	2	7	15		False	0	3	958 N SAINT JAMES PL
45.80	TFC	Tap Factory Capped	10				False	0	0	
50.60	CH4	Crack Longitudinal Hinge, 4	12	12		S07	False	4	0	
50.60	CM	Crack Multiple	12	12		S06	False	3	0	
53.80	FC	Fracture Circumferential	5	8			False	2	0	
56.90	FL	Fracture Longitudinal	6			S08	False	3	0	
63.50	CH4	Crack Longitudinal Hinge, 4	12	12		F07	False	4	0	
63.50	CM	Crack Multiple	12	12		F06	False	3	0	
63.50	FL	Fracture Longitudinal	6			F08	False	3	0	
66.20	CM	Crack Multiple	12	12		S09	False	3	0	
67.30	TBA	Tap Break-in Activity	10				False	0	0	943 N MISSON RD
67.30	RFC	Roots Fine Connection	4	5			False	0	1	
70.50	CM	Crack Multiple	12	12		F09	False	3	0	
90.20	CH3	Crack Longitudinal Hinge, 3	9	3		S10	False	3	0	
93.60	CH3	Crack Longitudinal Hinge, 3	9	3		F10	False	3	0	
93.60	CH4	Crack Longitudinal Hinge, 4	12	12		S11	False	4	0	
96.30	FC	Fracture Circumferential	5	7			False	2	0	
96.50	FC	Fracture Circumferential	6	9			False	2	0	
115.10	TF	Tap Factory	2				False	0	0	950 N SAINT JAMES PL
115.10	CH4	Crack Longitudinal Hinge, 4	12	12		F11	False	4	0	
117.10	MWLS	Miscellaneous Water Level Sac			50	S12	False	3	0	
117.80	RPL	Point Repair Liner				S13	False	0	0	RPR
122.20	MWLS	Miscellaneous Water Level Sac			50	F12	False	3	0	
125.70	RPL	Point Repair Liner				F13	False	0	0	RPR
125.90	JOM	Joint Offset Medium				F02	False	3	0	
125.90	AMH	Manhole					False	0	0	5948-063

Sewer CCTV Observations

5/1/2024

10:27 AM

Alt Pipe ID:		35592		Inspected Date:			4/18/2022			Survey Direction:		Upstream	
Distance:	CCTV Defect :		Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:			
0.00	AMH	Manhole					False	0	0	5948-066			
0.00	MWL	Miscellaneous Water Level			5		False	0	0				
0.00	FM	Fracture Multiple	7	5			False	4	0				
66.40	BSV	Broken Soil Visible	1	5			False	5	0				
66.40	FM	Fracture Multiple	7	5			False	4	0				
29.50	FM	Fracture Multiple	7	5			False	4	0				
53.80	CM	Crack Multiple	7	5			False	3	0				
66.90	CC	Crack Circumferential	11	10			False	1	0				
66.90	FL	Fracture Longitudinal	6				False	3	0				
69.30	TFA	Tap Factory Activity	10				False	0	0	6420 E. JACQUELINE ST.			
71.70	TFC	Tap Factory Capped	11				False	0	0				
74.50	RMC	Roots Medium Connection	2		50		False	0	3				
74.50	TFA	Tap Factory Activity	2				False	0	0	6419 E.9TH ST.N			
75.90	CM	Crack Multiple	7	5			False	3	0				
93.10	CM	Crack Multiple	7	3			False	3	0				
121.00	FC	Fracture Circumferential	10	1			False	2	0				
141.50	TFD	Tap Factory Defective	11				False	0	3	6412 E.JACQUELINE ST.			
145.50	TFC	Tap Factory Capped	2				False	0	0				
145.60	CM	Crack Multiple	8	4			False	3	0				
151.30	TFA	Tap Factory Activity	3				False	0	0	6411 E.9TH ST.N			
152.80	FM	Fracture Multiple	8	4			False	4	0				
175.00	FM	Fracture Multiple	8	6			False	4	0				
186.70	CM	Crack Multiple	8	6			False	3	0				
189.50	BSV	Broken Soil Visible	4	7			False	5	0				
193.60	CM	Crack Multiple	8	4			False	3	0				
200.40	CM	Crack Multiple	9	6			False	3	0				
210.10	CM	Crack Multiple	7	5			False	3	0				
217.30	TFA	Tap Factory Activity	11				False	0	0	6404 E.JACQUELINE ST.			
220.10	TFA	Tap Factory Activity	2				False	0	0	940 N.WOODLAWN BLVD.			
223.10	CM	Crack Multiple	7	5			False	3	0				
227.20	BVV	Broken Void Visible	11	1			False	5	0				
234.00	AMH	Manhole					False	0	0	5948-067			