

5948-372 _ 5948-371 Approx. 8 Taps
5948-368 _ 5948-367 Approx. 11 Taps

SITE 9

Install 338 lf of 8" Cured-in-Place Liner
from MH 5948-368 to MH 5948-367

SITE 8

Install 238 lf of 8" Cured-in-Place Liner
from MH 5948-372 to MH 5948-371


MH 5948-367
Approx Depth = 6.01

MH 5948-368
Approx Depth = 9.76

MH 5948-372
Approx Depth = 10.3

MH 5948-371
Approx Depth = 10.2

SITE 8 & 9

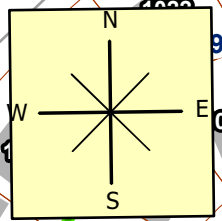

Sewer CCTV Observations

5/1/2024

10:32 AM

Alt Pipe ID:	35897	Inspected Date:	8/30/2021	Survey Direction:	Upstream				
Distance:	CCTV Defect :	Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH	Manhole				False	0	0	5948-371
0.00	MWL	Miscellaneous Water Level		5		False	0	0	
3.70	JOM	Joint Offset Medium				False	3	0	
5.70	TFA	Tap Factory Activity	10			False	0	0	6414 E.MAGILL LN.
44.80	RBL	Roots Ball Lateral	3	95		False	0	4	
44.80	TFA	Tap Factory Activity	3			False	0	0	6409 E.10TH ST.N
49.20	CM	Crack Multiple	7	5		False	3	0	
53.20	HVV	Hole Void Visible	9			False	5	0	
53.20	TFA	Tap Factory Activity	9			False	0	0	6410 E.MAGILL LN.
56.50	CM	Crack Multiple	9	4		False	3	0	
63.00	TFC	Tap Factory Capped	10			False	0	0	
64.50	CM	Crack Multiple	8	4		False	3	0	
73.60	CM	Crack Multiple	8	4		False	3	0	
101.70	RFJ	Roots Fine Joint	8	10		False	0	1	
134.60	RML	Roots Medium Lateral	3	35		False	0	3	
134.60	TFA	Tap Factory Activity	3			False	0	0	6405 E.10TH ST.N
141.30	RBL	Roots Ball Lateral	10	90		False	0	4	
141.30	TFA	Tap Factory Activity	10			False	0	0	6406 E.MAGILL LN.
195.00	RFL	Roots Fine Lateral	10			False	0	1	
195.00	TFA	Tap Factory Activity	10			False	0	0	6402 E.MAGILL LN.
208.20	JOM	Joint Offset Medium				False	3	0	
213.30	HSV	Hole Soil Visible	3			False	5	0	
213.20	TFA	Tap Factory Activity	3			False	0	0	6401 E.10TH ST.N
238.70	AMH	Manhole				False	0	0	5948-372/ LINE SEGMENT LO

Sewer CCTV Observations

5/1/2024

10:34 AM

Alt Pipe ID: 35893			Inspected Date: 8/30/2021			Survey Direction: Upstream				
Distance:	CCTV Defect :		Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH	Manhole				False	0	0		5948-367
0.00	MWL	Miscellaneous Water Level			5	False	0	0		
13.90	TFA	Tap Factory Activity	3			False	0	0		6713 E.10TH ST.N
15.80	TFC	Tap Factory Capped	10			False	0	0		
36.30	CM	Crack Multiple	8	4		False	3	0		
42.00	CM	Crack Multiple	8	4		False	3	0		
100.10	CM	Crack Multiple	7	5		False	3	0		
102.10	TBA	Tap Break-in Activity	2			False	0	0		6709 E.10TH ST.N
104.00	TFC	Tap Factory Capped	10			False	0	0		
109.00	RFJ	Roots Fine Joint	2	4		False	0	1		
117.10	RFJ	Roots Fine Joint	2	4		False	0	1		
121.70	CM	Crack Multiple	8	5		False	3	0		
124.70	RMJ	Roots Medium Joint	9	3	45	False	0	3		
131.30	RBJ	Roots Ball Joint	8	4	80	False	0	4		
132.70	RBJ	Roots Ball Joint	12	6	60	False	0	4		
135.90	RBJ	Roots Ball Joint	7	5	90	False	0	4		
137.20	MSA	Miscellaneous Survey Abandon				False	0	0		ROOTBALLS IN THE SEWER

Alt Pipe ID: 35893			Inspected Date: 8/26/2021			Survey Direction: Downstream				
Distance:	CCTV Defect :		Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH	Manhole				False	0	0		5948-368
0.00	MWL	Miscellaneous Water Level			5	False	0	0		
51.10	TSA	Tap Saddle Activity	2			False	0	0		6702 E.MAGILL LN.
53.10	TFC	Tap Factory Capped	10			False	0	0		
63.50	TFA	Tap Factory Activity	11			False	0	0		6701 E.10TH ST.N
63.50	CM	Crack Multiple	8	4		False	3	0		
135.00	TF	Tap Factory	2			False	0	0		6706 E.MAGILL LN.
135.00	CL	Crack Longitudinal	12			False	2	0		
136.80	RFJ	Roots Fine Joint	7	10		False	0	1		
137.10	TFC	Tap Factory Capped	10			False	0	0		
142.30	BSV	Broken Soil Visible	8	11		False	5	0		
145.40	CM	Crack Multiple	11	1		False	3	0		
160.70	RMJ	Roots Medium Joint	8	4	35	False	0	3		
165.20	RBJ	Roots Ball Joint	8	4	70	False	0	4		
165.20	TFA	Tap Factory Activity	10			False	0	0		6705 E.10TH ST.N
171.10	RBJ	Roots Ball Joint	8	4	80	False	0	4		
182.70	RMJ	Roots Medium Joint	3	5	25	False	0	3		
190.70	RMJ	Roots Medium Joint	8	4	35	False	0	3		
196.00	RBC	Roots Ball Connection	1		100	False	0	4		
196.00	TF	Tap Factory	1			False	0	0		6710 E.MAGILL LN.
196.00	MSA	Miscellaneous Survey Abandon				False	0	0		ROOTBALL IN THE SEWER LI