



MH # 6047-242
Approx depth = 7.8 ft

MH # 6047-241
Replace Manhole Frame & Cover
Approx depth = 8.9 ft

Remove and replace
310 lf of 8" pipe

MH # 6047-240
Replace Manhole Frame & Cover
Remove & Replace Manhole Bench & Invert
Approx depth = 9.8 ft

SITE 1

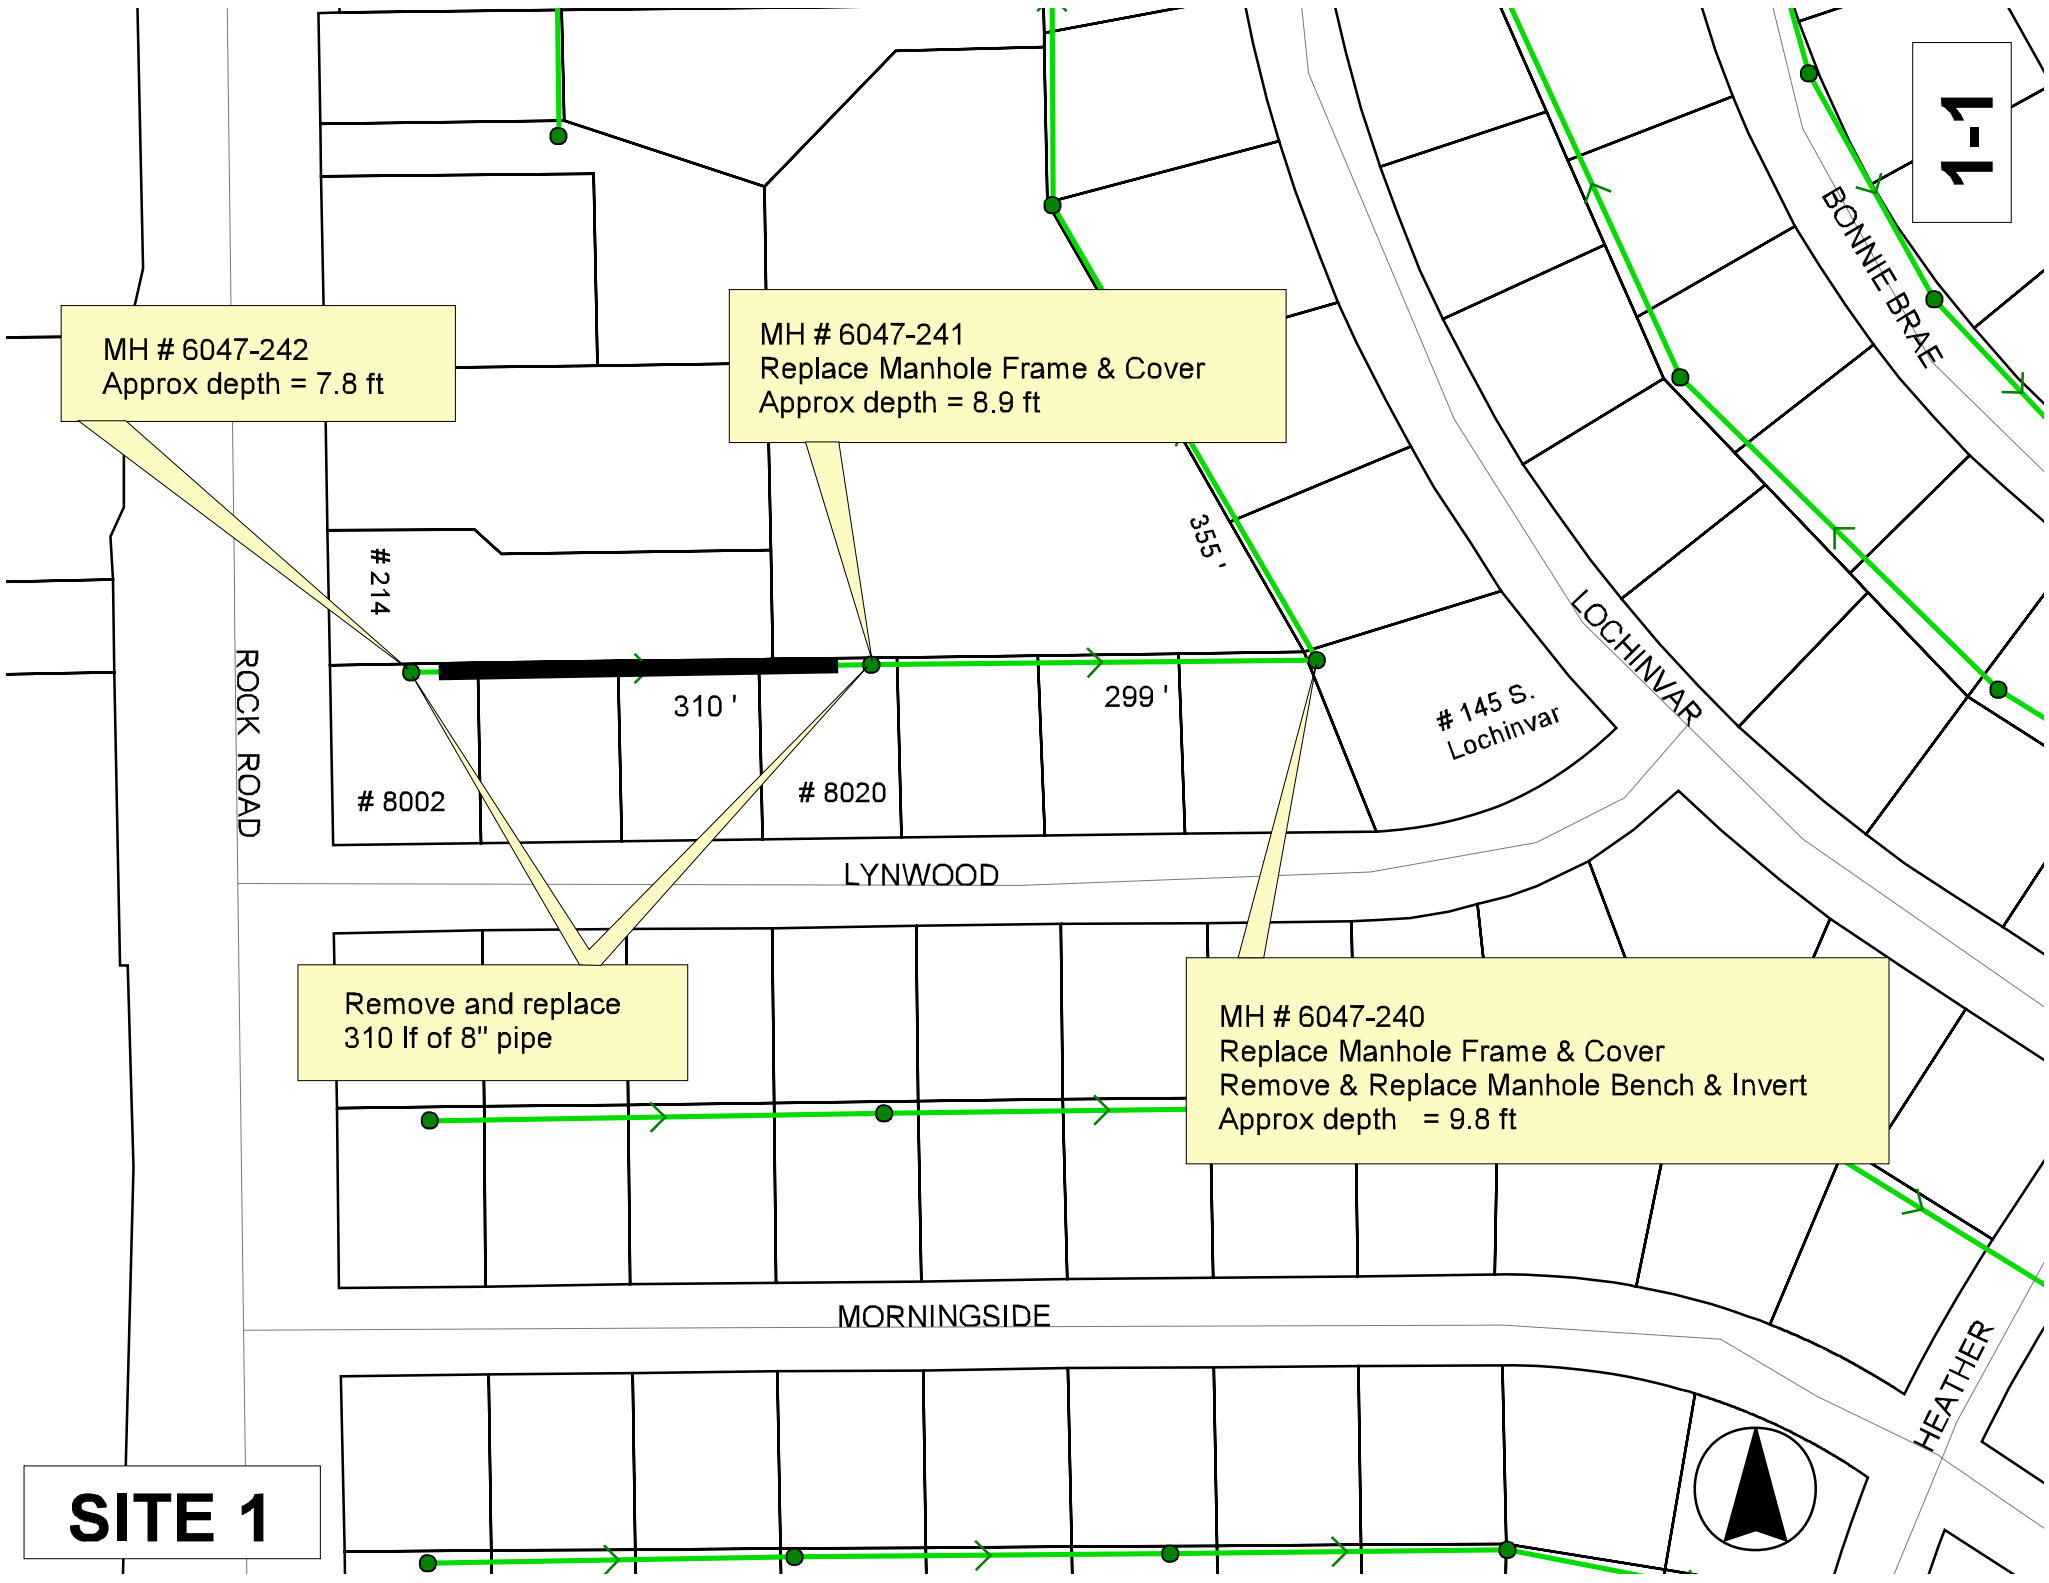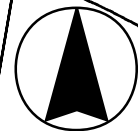

1-2

ROCK

LOCHINVAR

214 S. Rock

145

8002

8020

LYNWOOD

Aerial View



Television Inspection Master Report

4/9/2007
4:22 PM

US Structure: 6047-242
DS Structure: 6047-241

8002 E LYNWOOD ST
8020 E LYNWOOD ST

Date Insp: 8/2/2006
Dir Televised: Downstream to Upstream

Basin: E01G2

Reverse Setup:

Obs. #	VTR Counter	Distance	Location	Description	Rating	Obsrvd (gpm)	Est. (gpm)	Ratings		
								Struct	Clean	Remain (gpm)
1		0.0	DS Manhole 6047-241		1	0.000	0	0	0.000	
WE HAVE REVERSED SET-UP AND WILL TELEVISION APPROX 301' AGAINST THE FLOW TO FINISH LINE										
2		1.0	Lower Left	Broken Pipe	5	0.000	0	0	0.000	
Offset joint is broken down / Must Repair										
3		21.9	Joint	Offset	3	0.000	0	0	0.000	
4		35.7	South	Wye Service	4	0.000	0	0	0.000	
ROOTS / 8020 EAST LYNWOOD										
5		36.0	Joint	Roots (Heavy)	4	0.010	10	25	0.010	
6		48.5	Joint	Roots	3	0.008	5	8	0.008	
7		52.3	Joint	Offset / Roots	3	0.000	0	0	0.000	
8		56.5	Joint	Roots	5	0.030	18	100	0.030	
9		56.5	Joint	Offset	4	0.000	0	0	0.000	
10		64.4	Joint	Offset / Roots	4	0.000	0	0	0.000	
11		64.4	Upper Right	Broken Pipe	4	0.000	0	0	0.000	
12		97.4	Joint	Roots	1	0.002	1	1	0.002	
13		106.7	North	Wye Service	4	0.000	0	0	0.000	
ROOTS / 200 SOUTH ROCK RD / DYE TESTED AT THE PRIVATE CLEANOUT										
14		112.6	Joint	Offset	3	0.000	0	0	0.000	
15		116.9	Joint	PVC begins	1	0.000	0	0	0.000	
16		119.1	Joint	PVC ends	1	0.000	0	0	0.000	
17		124.6	Joint	Offset	3	0.000	0	0	0.000	
18		130.9	South	Extended Tap	3	0.000	0	0	0.000	
ROOTS AROUND OUTSIDE OF CONNECTION										
19		131.6	Lower Right	Broken Pipe	4	0.000	0	0	0.000	
20		138.6	Joint	Roots	4	0.010	10	25	0.010	
21		191.0	Joint	Offset Joint						
21		211.9	North	Break-In Conn	1	0.000	0	0	0.000	
DYE TESTED / 214 S. Rock Road										
22		222.7	South	Break-In Conn	2	0.000	0	0	0.000	
8008 EAST LYNWOOD										
23		230.7	Joint	Offset	3	0.000	0	0	0.000	
24		255.2	Joint	Offset	3	0.000	0	0	0.000	
25		283.7	Joint	Offset	3	0.000	0	0	0.000	
26		295.8	Joint	Offset	3	0.000	0	0	0.000	
27		297.5	South	Wye Service	1	0.000	0	0	0.000	
8002 EAST LYNWOOD										
29		300.4	Joint	Offset / Fairly Severe	5	0.000	0	0	0.000	
28		301.3		Stopped Inspection	1	0.000	0	0	0.000	
THIS IS AS FAR AS WE NEED TO TELEVISION FOR THIS LINE SEGMENT.										