

6045-233\_6045-232 Approx. 4 Tap  
6045-232\_6045-231 Approx. 6 Taps  
6045-012\_6045-011 Approx. 1 Tap  
6045-013\_6045-012 Approx. 1 Tap

Install 608 lf of 8" Cured-in-Place Liner  
from MH 6045-233 to MH 6045-230



MH 6045-230  
Approx Depth = 10.5

MH 6045-231  
Approx Depth = 10.22

MH 6045-232  
Approx Depth = 9.00

MH 6045-233  
Approx Depth = 10.35

**SITE 3**

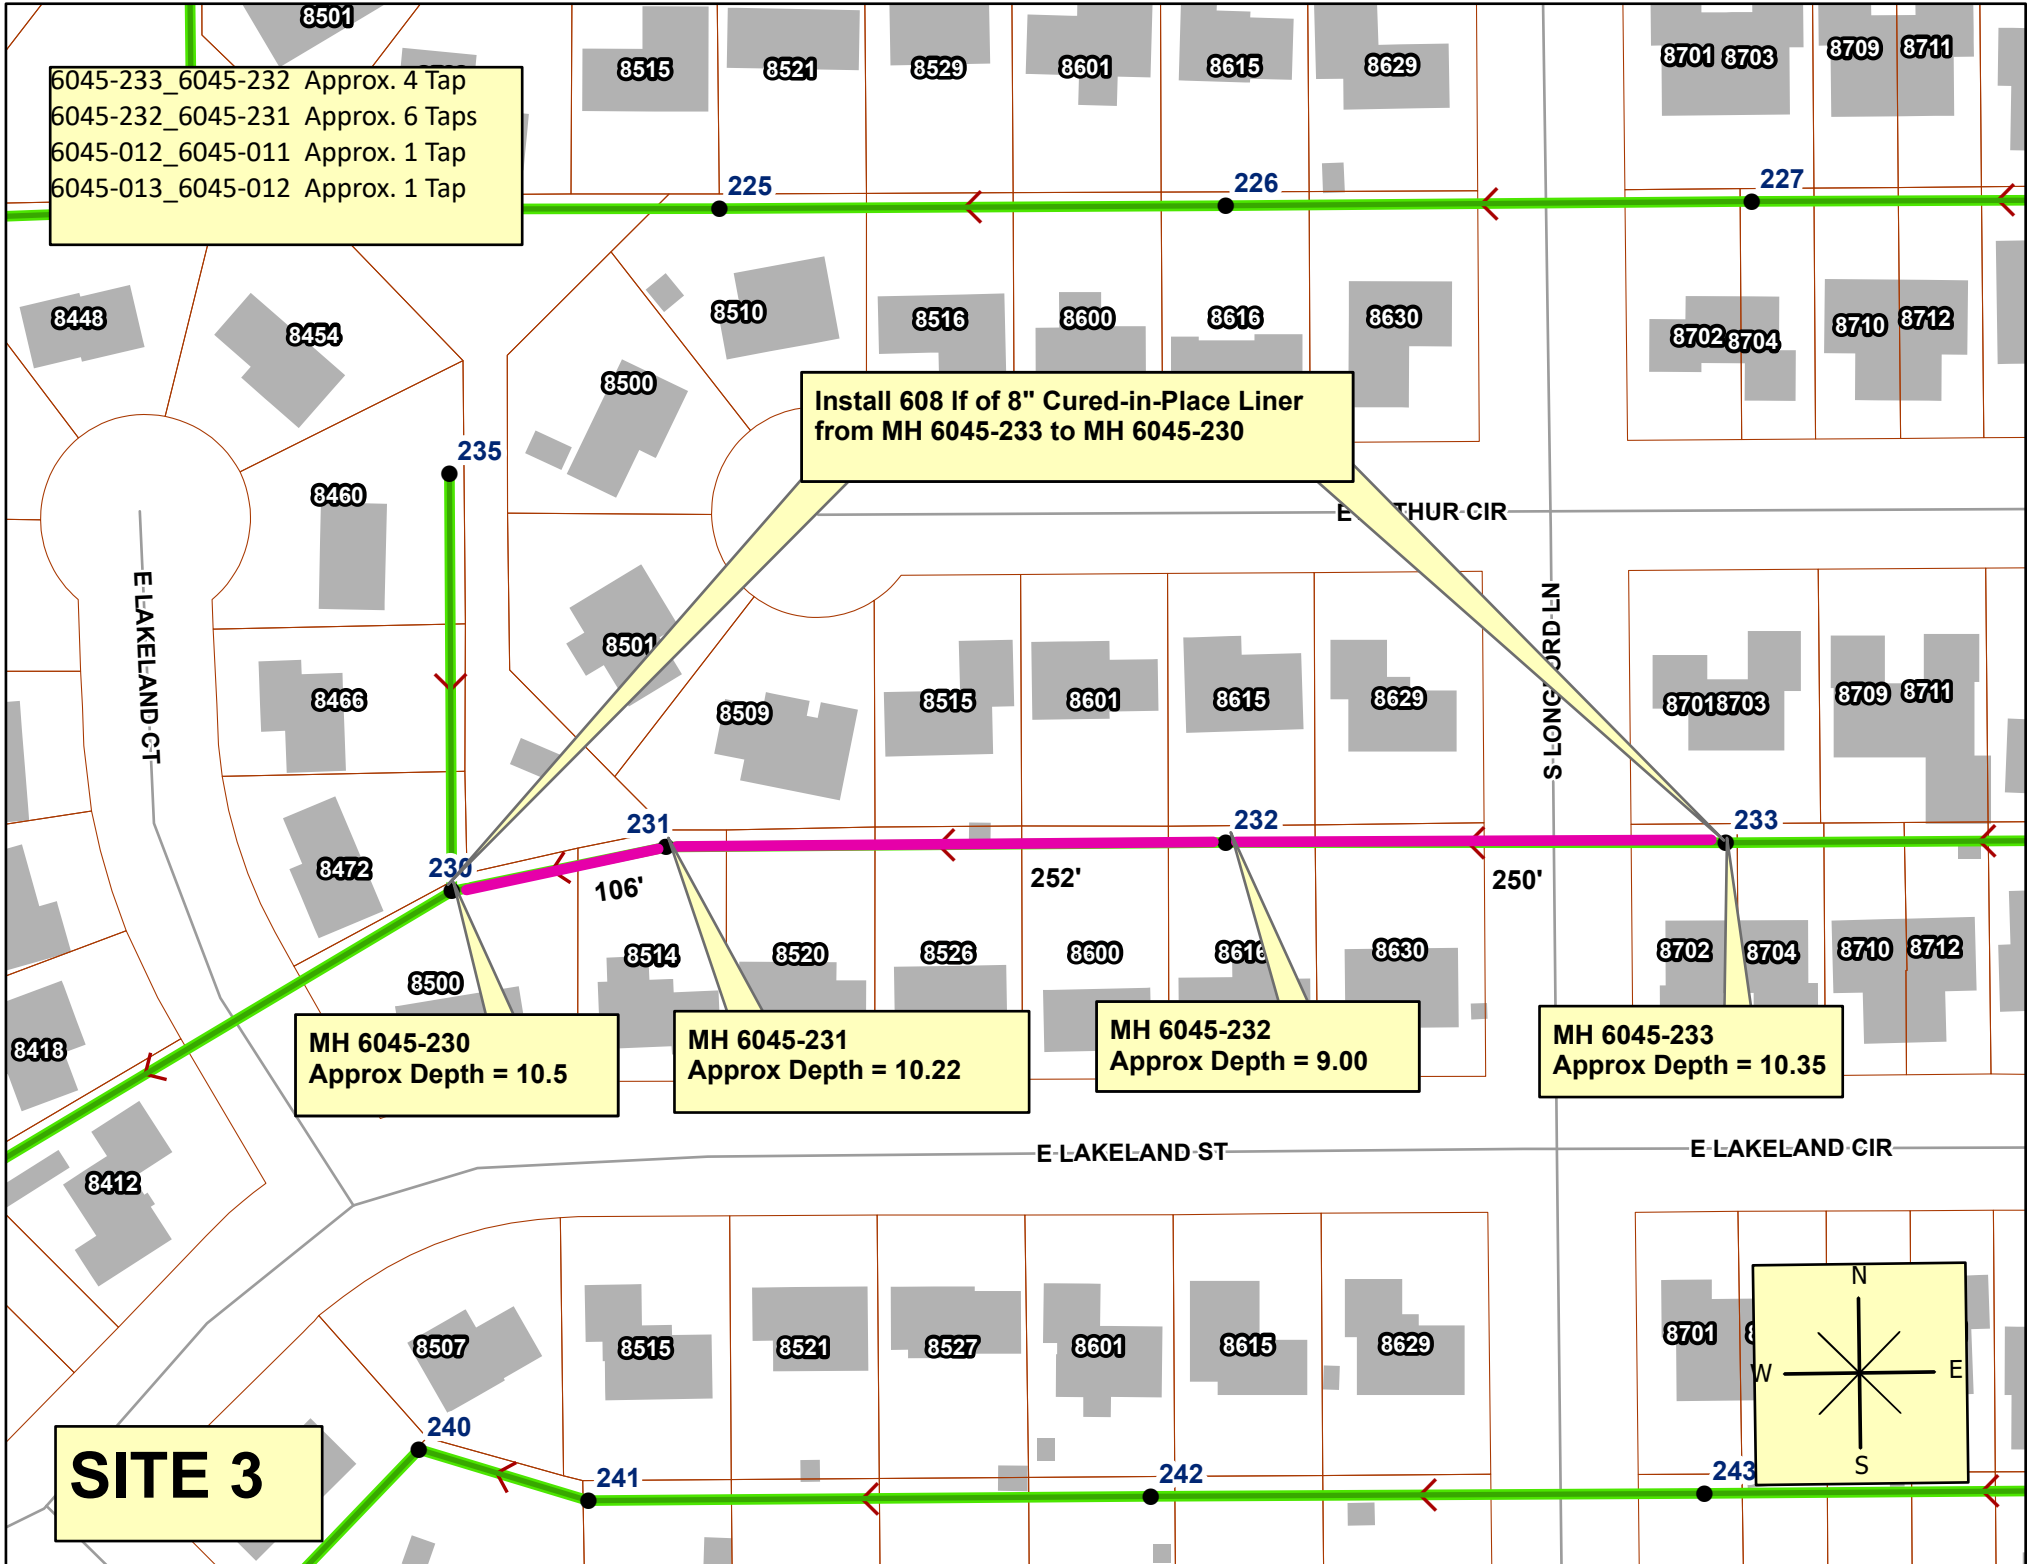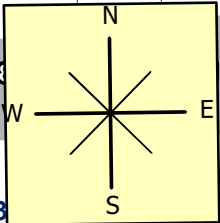

---

# Sewer CCTV Observations

5/1/2024

9:46 AM

---

<b>Alt Pipe ID:</b>	37979	<b>Inspected Date:</b>	11/6/2020		<b>Survey Direction:</b>	Downstream			
<b>Distance:</b>	<b>CCTV Defect :</b>	<b>Clock 1:</b>	<b>Clock 2:</b>	<b>%</b>	<b>Contin:</b>	<b>Doc:</b>	<b>Struct:</b>	<b>O&amp;M:</b>	<b>Remarks:</b>
0.00	AMH Manhole				False	0	0		USMH-6045-231
0.50	MWL Miscellaneous Water Level			5	False	0	0		
45.00	DAE Deposits Attached Encrustation	9	3		False	0	0		
55.00	DAE Deposits Attached Encrustation	9	6		False	0	0		
80.00	DAE Deposits Attached Encrustation	9	6		False	0	0		
101.00	DAE Deposits Attached Encrustation	9	6		False	0	0		
106.00	AMH Manhole				False	0	0		DSMH-6045-230

---

# Sewer CCTV Observations

5/1/2024

9:48 AM

---

<b>Alt Pipe ID:</b>	37980	<b>Inspected Date:</b>	11/6/2020			<b>Survey Direction:</b>	Downstream		
<b>Distance:</b>	<b>CCTV Defect :</b>	<b>Clock 1:</b>	<b>Clock 2:</b>	<b>%</b>	<b>Contin:</b>	<b>Doc:</b>	<b>Struct:</b>	<b>O&amp;M:</b>	<b>Remarks:</b>
0.00	AMH Manhole					False	0	0	USMH-6045-232
0.50	MWL Miscellaneous Water Level			5		False	0	0	
55.00	TF Tap Factory	9				False	0	0	8600 E LAKELAND CIR
66.70	TF Tap Factory	3				False	0	0	8601 E ARTHUR CIR
110.90	TF Tap Factory	9				False	0	0	8526 E LAKELAND CIR
118.20	TF Tap Factory	3				False	0	0	8515 E ARTHUR CIR
197.70	TF Tap Factory	9				False	0	0	8520 E LAKELAND CIR
208.50	TF Tap Factory	3				False	0	0	8509 E ARTHUR CIR
250.10	AMH Manhole					False	0	0	DSMH-6045-231

---

# Sewer CCTV Observations

5/1/2024

9:51 AM

---

<b>Alt Pipe ID:</b>	37981	<b>Inspected Date:</b>	11/6/2020			<b>Survey Direction:</b>	Downstream		
<b>Distance:</b>	<b>CCTV Defect :</b>	<b>Clock 1:</b>	<b>Clock 2:</b>	<b>%</b>	<b>Contin:</b>	<b>Doc:</b>	<b>Struct:</b>	<b>O&amp;M:</b>	<b>Remarks:</b>
0.00	AMH Manhole				False	0	0		USMH-6045-233
0.50	MWL Miscellaneous Water Level			5	False	0	0		
19.80	FM Fracture Multiple	2	7		False	4	0		
22.30	BVV Broken Void Visible	10	2		False	5	0		
143.70	TS Tap Saddle	3			False	0	0		8629 E ARTHUR CIR
150.50	TF Tap Factory	9			False	0	0		8630 E LAKELAND CIR
222.10	TF Tap Factory	3			False	0	0		8615 E ARTHUR CIR
241.70	TF Tap Factory				False	0	0		8616 E LAKELAND CIR
250.30	AMH Manhole				False	0	0		DSMH-6045-232