

5744-313CO (Cleanout)
 Construct Standard Manhole
 (depth unknown / cleanout not found)
 (Removal of an existing cleanout shall be incidental)

Install 4" PVC service line(s) as necessary to reconnect 3651 & 3641 E. Cessna. Location of existing services unknown, but both units have existing PVC cleanouts. Est. 40 lf of 4" pipe.

5744-312
 Construct Standard Manhole
 (cannot verify with a camera, but this is possibly just a bend in the pipe)
 (depth unknown / est. 6.5' deep)

MH 5744-311
 Remove and Replace
 ' MH Frame & Cover
 Remove and Replace
 ' MH Bench & Invert
 Approx MH depth = 7.9 ft

MH 5744-310
 Remove and Replace
 ' MH Frame & Cover
 Remove and Replace
 ' MH Bench & Invert
 Approx MH depth = 4.5 ft
 (located north of sidewalk and west of a fence)

MH 5744-309
 Remove and Replace
 ' MH Frame & Cover
 Remove and Replace
 ' MH Bench & Invert
 Approx MH depth = 8.7 ft

Remove 80 lf of 6" Pipe
 Install 80 lf of 8" Pipe
 (record length)

Remove 50 lf of 6" Pipe
 Install 50 lf of 8" Pipe
 (record length)

Cleanout
 (not found)


Remove 125 lf of 6" Pipe
 Install 125 lf of 8" Pipe

Remove 180 lf of 6" Pipe
 Install 180 lf of 8" Pipe

See GENERAL NOTES for more information concerning this Site.

Restoration of the private unpaved roadway shall be incidental to the Site.

Estimated 8 Service Reconnections (4")
 Estimated 20 lf Silt Fence
 Estimated 16 sy Erosion Control Mat

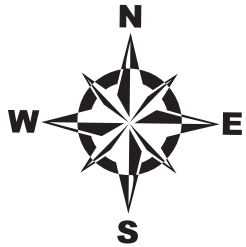

SITE 1

