

MH # 5846-257
Approx depth = 11.4 ft


MH # 5846-256
1030 S. Edgemoor
Approx depth = 10.9 ft

MH # 5846-230
(outside drop on pipe from north)
(pipe depth not measured)
Approx MH depth = 15.3 ft

Install 585 lf of 8" Cured-in-Place Limer
from MH 5846-257 to MH 5846-230



SITE 11

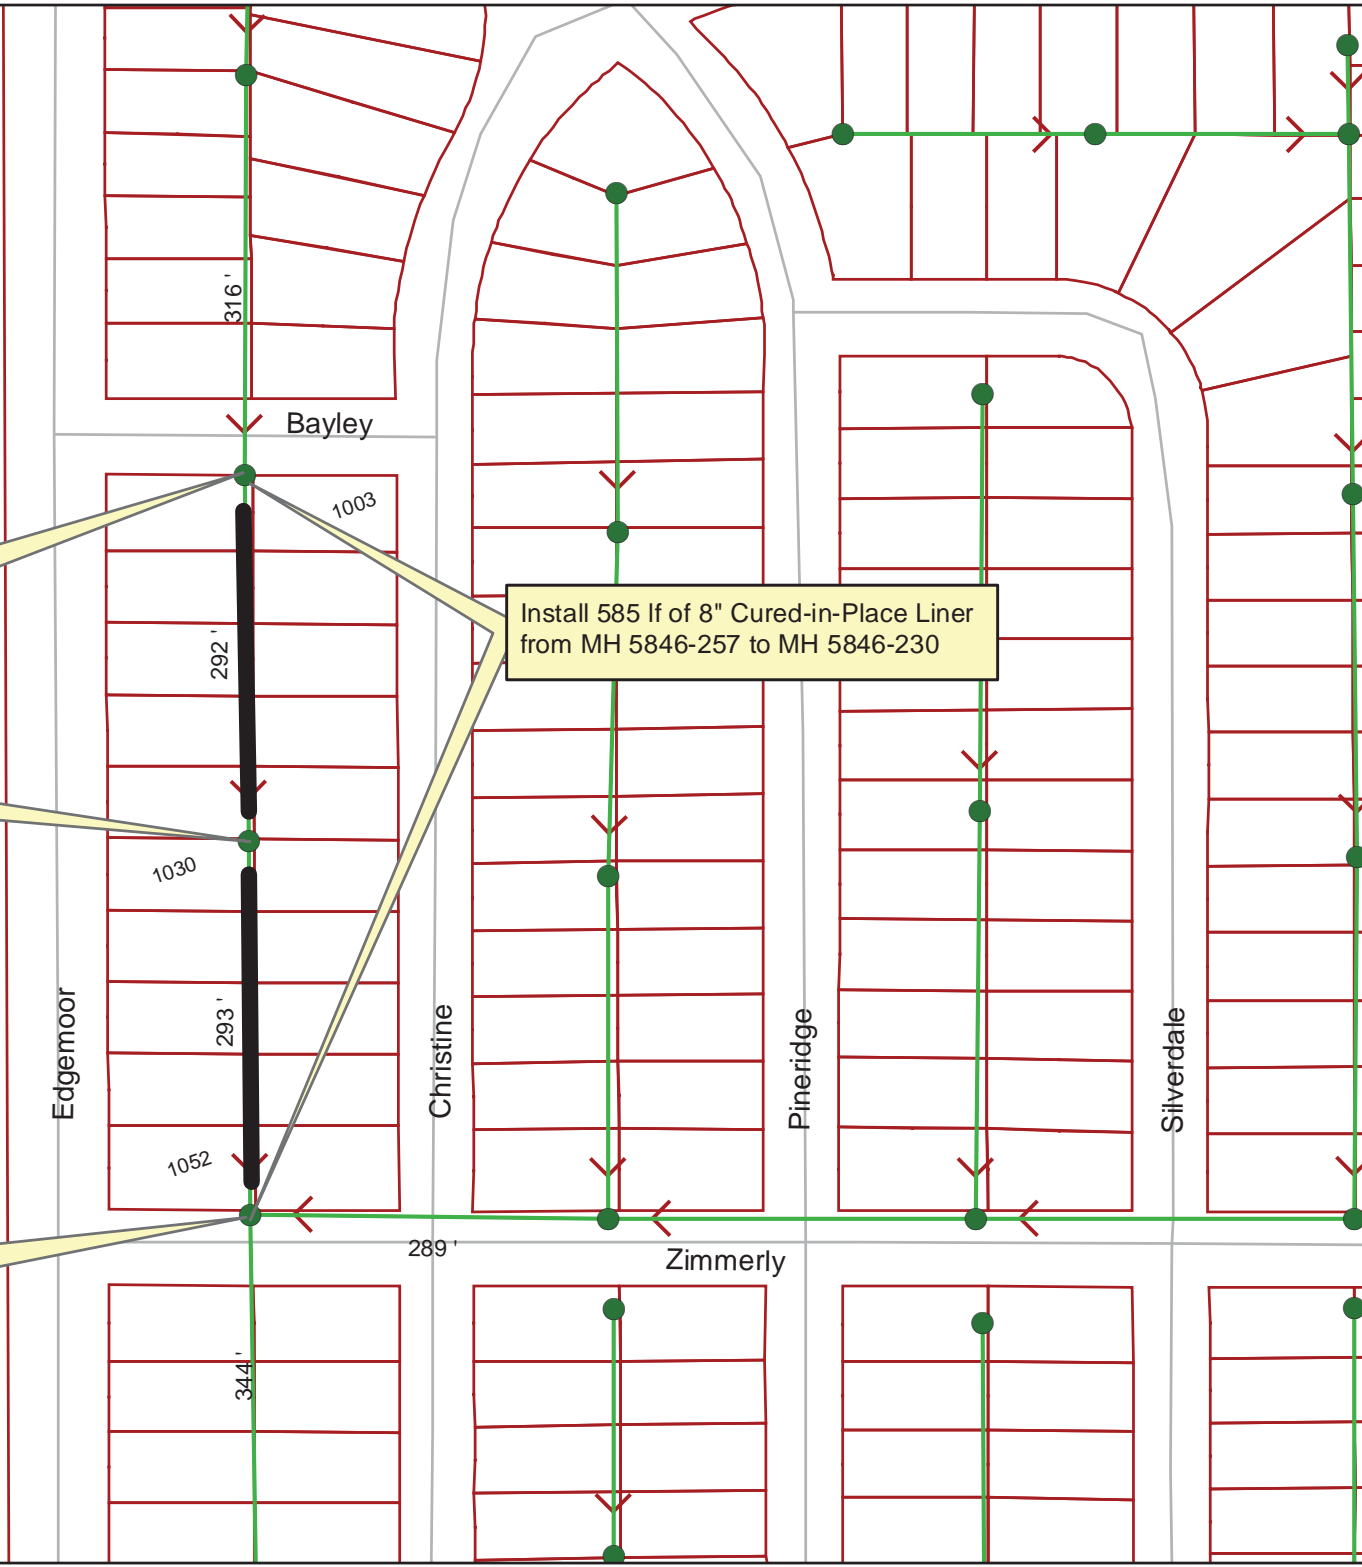



Bayley

Edgemoor

Christine

Zimmerly



Video Inspection Master Report

8/6/2012
10:47 AM

US Structure: 5846-257 1003 S CHRISTINE ST Date Insp: 1/13/2012 Basin: E04A
 DS Structure: 5846-256 1030 S EDGEMOOR AVE Dir Televised: Upstream To Downstream

Pipe Information

Dia: 8 Material: VCP Length: 290.0 Slope: 0.400

Obs. #	VTR Counter	Distance	Location	Description	Rating	Ratings				
						Obsrvd (gpm)	Est. (gpm)	Struct Clean	Remain (gpm)	
1		0.0		5846-257 US Manhole	1	0.000	0.000	0	0	0.000
2		35.9	1002 S EDGEMOOR	Break-In Conn	1	0.001	0.000	0	0	0.001
3		38.9	1003 S CHRISTINE	Wye Service	5	0.000	0.000	400	0	0.000
4		41.4		Crack-Horizontal	2	0.002	0.002	2	0	0.002
5		56.6		Crack-Horizontal	4	0.008	0.008	10	0	0.008
6		59.6		Broken Pipe	2	0.008	0.008	44	0	0.008
7		62.9		Broken Pipe	2	0.008	0.008	44	0	0.008
8		66.3		Broken Pipe	2	0.008	0.008	44	0	0.008
9		69.3		Broken Pipe	3	0.010	0.010	60	0	0.010
10		72.4		Crack-Horizontal	4	0.008	0.008	10	0	0.008
11		99.1	1008 S EDGEMOOR	Wye Service	5	0.000	0.000	400	0	0.000
12		101.1	1009 S CHRISTINE	Wye Service	5	0.000	0.000	400	0	0.000
13		103.9		Crack-Horizontal	2	0.002	0.002	2	0	0.002
14		106.1		Broken Pipe	2	0.008	0.008	44	0	0.008
15		109.8		Crack-Horizontal	3	0.004	0.004	5	0	0.004
16		131.8		Crack-Horizontal	2	0.002	0.002	2	0	0.002
17		155.0	1014 S EDGEMOOR	Wye Service	1	0.000	0.000	0	0	0.000
18		157.2	1015 S CHRISTINE	Break-In Conn	5	0.010	0.010	400	0	0.010
19		159.9		Crack-Horizontal	1	0.001	0.001	1	0	0.001
20		166.3		Crack-Horizontal	1	0.001	0.001	1	0	0.001
21		214.5	1018 S EDGEMOOR	Wye Service	2	0.000	0.000	0	0	0.000
22		217.4	1019 S CHRISTINE	Wye Service	1	0.000	0.000	0	0	0.000
23		231.2		Roots	1	0.002	0.002	1	1	0.002
24		237.4		Roots	1	0.002	0.002	1	1	0.002
25		253.3		Crack-Horizontal	4	0.008	0.008	10	0	0.008
26		270.5	1024 S EDGEMOOR	Wye Service	5	0.000	0.000	400	0	0.000
27		273.2	1025 S CHRISTINE	Break-In Conn	1	0.001	0.001	0	0	0.001
28		275.9		Crack-Horizontal	1	0.001	0.001	1	0	0.001
29		285.1		Broken Pipe	5	0.060	0.060	100	0	0.060
30		290.6		Roots	3	0.008	0.008	5	8	0.008
31		292.2		5846-256 DS Manhole	1					

Video Inspection Master Report

8/6/2012
10:47 AM

US Structure: 5846-256 1030 S EDGEMOOR AVE Date Insp.: 1/13/2012 Basin: E04A
 DS Structure: 5846-230 1052 EDGEMOOR ST Dir. Televised: Upstream To Downstream

Pipe Information

Shape: Round Length Status: VCP
 Dia/Ht: 8 Material: VCP
 Length: 292.7 Slope: 0.051

Project No. : F-131
 Index:
 Surface:

Obs. #	VTR	Counter	Distance	Location	Description	Rating	Ratings			
							Obsrvd (gpm)	Est. (gpm)	Struct Clean	Remain (gpm)
1			0.0		5846-256 US Manhole	1	0.000	0	0	0.000
2			4.5		Roots	1	0.002	1	1	0.002
3			5.0		Broken Pipe	1	0.004	30	0	0.004
4			7.9		Broken Pipe	3	0.010	60	0	0.010
5			10.7		Roots	2	0.004	2	4	0.004
6			13.1		Broken Pipe	5	0.060	100	0	0.060
7			16.7		Roots	2	0.004	2	4	0.004
8			17.4		Crack-Horizontal	4	0.008	10	0	0.008
9			20.2		Roots	3	0.008	5	8	0.008
10			21.4		Broken Pipe	3	0.010	60	0	0.010
11			23.8		Broken Pipe	3	0.010	60	0	0.010
12			26.8		Crack-Horizontal	3	0.004	5	0	0.004
13			29.6		Roots	3	0.008	5	8	0.008
14			31.3	1030 S EDGEMOOR	Wye Service	1	0.000	0	0	0.000
15			33.6	1031 S CHRISTINE	Break-In Conn	4	0.008	60	0	0.008
16			35.5		Crack-Radial	2	0.002	2	0	0.002
17			35.5		Roots	2	0.004	2	4	0.004
18			38.7		Roots	2	0.004	2	4	0.004
19			42.3		Crack-Horizontal	2	0.002	2	0	0.002
20			45.1		Roots	3	0.008	5	8	0.008
21			47.3		Broken Pipe	4	0.030	78	0	0.030
22			48.0		Roots	3	0.008	5	8	0.008
23			49.4		Crack-Horizontal	2	0.002	2	0	0.002
24			51.7		Crack-Horizontal	3	0.004	5	0	0.004
25			60.8		Roots	2	0.004	2	4	0.004
26			63.9		Roots	2	0.004	2	4	0.004
27			67.1		Roots	2	0.004	2	4	0.004
28			76.9		Crack-Horizontal	2	0.002	2	0	0.002
29			85.8		Crack-Radial	3	0.004	5	0	0.004
30			86.3		Crack-Horizontal	1	0.001	1	0	0.001
31			90.6	1036 S EDGEMOOR	Wye Service	2	0.000	0	0	0.000
32			91.8		Crack-Radial	3	0.004	5	0	0.004
33			93.5	1037 S CHRISTINE	Wye Service	4	0.000	60	0	0.000
34			98.4		Crack-Horizontal	3	0.004	5	0	0.004
35			150.1	1040 S EDGEMOOR	Wye Service	5	0.000	400	0	0.000
36			153.2	1041 S CHRISTINE	Wye Service	1	0.000	0	0	0.000
37			179.8		Broken Pipe	2	0.008	44	0	0.008

Video Inspection Master Report

8/6/2012
10:47 AM

US Structure: 5846-256 1030 S EDGEMOOR AVE Date Insp: 1/13/2012 Basin: E04A
 DS Structure: 5846-230 1052 EDGEMOOR ST Dir Televised: Upstream To Downstream

38	182.7		Crack-Horizontal	3	0.004	5	0	0.004
39	186.4		Crack-Horizontal	3	0.004	5	0	0.004
40	189.3		Crack-Horizontal	3	0.004	5	0	0.004
41	192.4		Broken Pipe	3	0.010	60	0	0.010
42	195.2		Broken Pipe	3	0.010	60	0	0.010
43	203.4	1046 S EDGEMOOR	Wye Service	5	0.000	400	0	0.000
44	204.9		Crack-Radial	2	0.002	2	0	0.002
45	206.2	1047 S CHRISTINE	Wye Service	4	0.000	60	0	0.000
46	226.2		Broken Pipe	4	0.030	78	0	0.030
47	232.6		Broken Pipe	3	0.010	60	0	0.010
48	236.3		Crack-Horizontal	2	0.002	2	0	0.002
49	248.6		Broken Pipe	2	0.008	44	0	0.008
50	262.3	1052 S EDGEMOOR	Wye Service	1	0.000	0	0	0.000
51	265.3	1053 S CHRISTINE	Wye Service	3	0.000	2	0	0.000
52	267.4		Broken Pipe	3	0.010	60	0	0.010
53	270.9		Crack-Horizontal	2	0.002	2	0	0.002
54	274.5		Crack-Horizontal	2	0.002	2	0	0.002
	291.0		Outside Drop hole in Invert					
55	294.1	Broken Pipe / at south edge of the outside drop hole		5	0.060	100	0	0.060
56	295.7		5846-230 DS Manhole	1	0.000	0	0	0.000

Lines have horizontal cracks and roots at joints.