

6045-010_6045-009 Approx. 1 Tap
6045-011_6045-010 Approx. 3 Taps
6045-012_6045-011 Approx. 1 Tap
6045-013_6045-012 Approx. 1 Tap

MH 6045-008
Approx Depth = 12.94

MH 6045-506
Approx Depth =

MH 6045-009
Approx Depth = 12.31

MH 6045-010
Approx Depth = 16.9

MH 6045-011
Approx Depth = 13.57



MH 6045-012
Approx Depth = 12.23

MH 6045-013
Approx Depth = 11.16

Install 297 lf of 18" Cured-in-Place Liner
from MH 6045-099 to MH 6045-008

Install 1,099 lf of 12" Cured-in-Place Liner
from MH 6045-013 to MH 6045-009

SITE 2

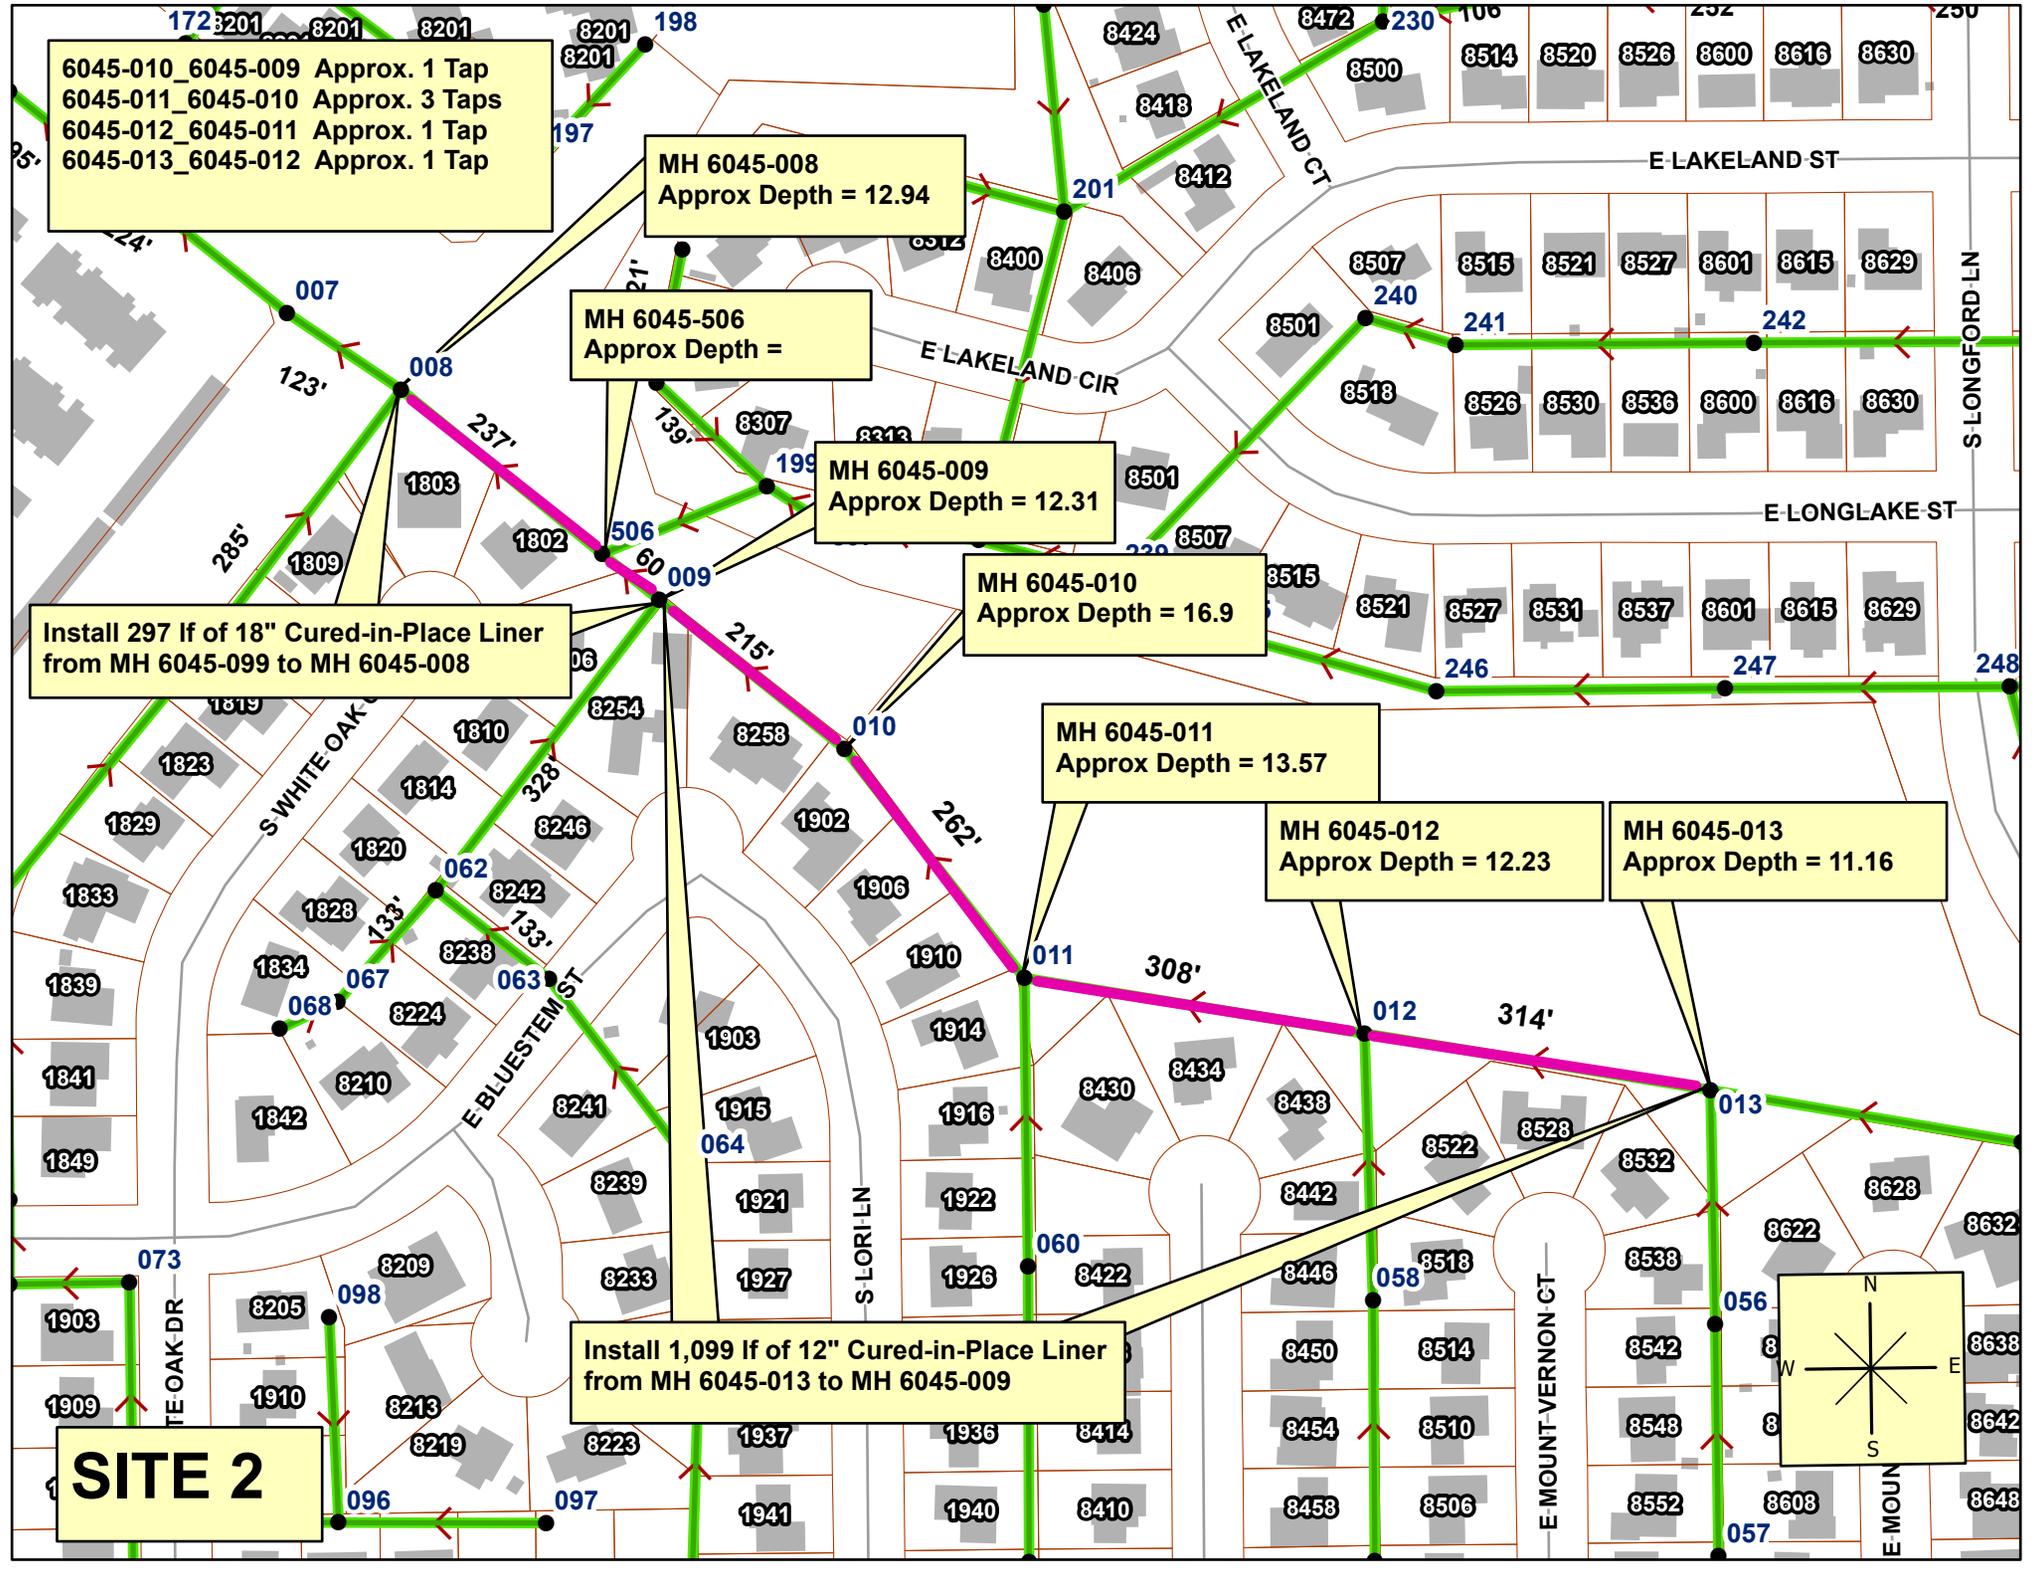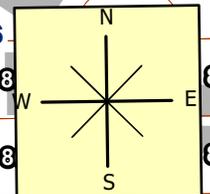

Sewer CCTV Observations

5/1/2024

9:28 AM

Alt Pipe ID:	37758	Inspected Date:	11/23/2020	Survey Direction:	Downstream				
Distance:	CCTV Defect :	Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH Manhole				False	0	0		6045-009
0.00	MWL Miscellaneous Water Level			5	False	0	0		
65.30	AMH Manhole				False	0	0		6045-506/MINERAL DEPOSITI

Sewer CCTV Observations

5/1/2024

9:30 AM

Alt Pipe ID:	37759	Inspected Date:	11/4/2020			Survey Direction:	Downstream		
Distance:	CCTV Defect :	Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH Manhole				False	0	0		6045-010
0.00	MWL Miscellaneous Water Level			5	False	0	0		
14.70	CM Crack Multiple	10	2		False	3	0		
14.70	ID Infiltration Dripper	10	2		False	0	3		
100.10	DAZ Deposits Attached Other	11	1	5	False	0	2		
106.70	DAZ Deposits Attached Other	8	10	5	False	0	2		
5.20	ID Infiltration Dripper	10	2		False	0	3		
191.20	TB Tap Break-in/Hammer	10			False	0	0		8258 E.BLUESTEM ST.
213.10	AMH Manhole				False	0	0		6045-009/LINE SEGMENT LOC

Sewer CCTV Observations

5/1/2024

9:42 AM

Alt Pipe ID:	37760	Inspected Date:	3/5/2021	Survey Direction:	Downstream				
Distance:	CCTV Defect :	Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH	Manhole				False	0	0	6045-011
0.00	MWL	Miscellaneous Water Level		5		False	0	0	
62.30	TBA	Tap Break-in Activity	12			False	0	0	1910 S.LORI LANE
183.00	TBA	Tap Break-in Activity	11			False	0	0	1906 S.LORI LANE
260.20	TBA	Tap Break-in Activity	11			False	0	0	1902 S.LORI LANE
260.20	AMH	Manhole				False	0	0	6045-010/SAG BEGIN AT 58'F

Sewer CCTV Observations

5/1/2024

9:33 AM

Alt Pipe ID:	37761	Inspected Date:	11/3/2020			Survey Direction:	Downstream		
Distance:	CCTV Defect :	Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH Manhole				False	0	0		6045-012
0.00	MWL Miscellaneous Water Level			5	False	0	0		
155.30	TB Tap Break-in/Hammer	10			False	0	0		8434 E.MOUNT VERNON CT.
309.10	AMH Manhole				False	0	0		6045-011/LINE SEGMENT LOC

Sewer CCTV Observations

5/1/2024

9:35 AM

Alt Pipe ID:	37762	Inspected Date:	11/2/2020			Survey Direction:	Downstream		
Distance:	CCTV Defect :	Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH Manhole				False	0	0		6045-013
0.00	MWL Miscellaneous Water Level			5	False	0	0		
175.10	TB Tap Break-in/Hammer	11			False	0	0		8528 E.MOUNT VERNON CT.
313.40	AMH Manhole				False	0	0		6045-012/LINE SEGMENT LOC

Sewer CCTV Observations

5/1/2024

9:27 AM

Alt Pipe ID:	62555	Inspected Date:	12/21/2020	Survey Direction:	Downstream				
Distance:	CCTV Defect :	Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH Manhole				False	0	0		6045-506
0.00	MWL Miscellaneous Water Level			5	False	0	0		
233.20	AMH Manhole				False	0	0		6045-008