

5948-108 \_ 5948-107 Approx. 4 Taps  
5948-107 \_ 5948-106 Approx. 6 Taps


MH 5948-108  
Approx Depth = 11.3

MH 5948-107  
Approx Depth = 11.4

MH 5948-106  
Approx Depth = 10.3

Install 459 lf of 8" Cured-in-Place Liner  
from MH 5948-108 to MH 5948-106

**SITE 5**

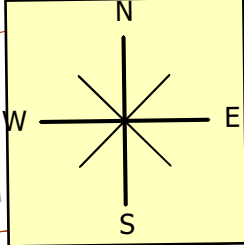

---

**Sewer CCTV Observations**

5/1/2024

10:13 AM

---

Alt Pipe ID:	35632	Inspected Date:	9/9/2021	Survey Direction:	Downstream				
Distance:	CCTV Defect :	Clock 1:	Clock 2:	%	Contin:	Doc:	Struct:	O&M:	Remarks:
0.00	AMH	Manhole				False	0	0	5948-107
0.00	MWL	Miscellaneous Water Level		5		False	0	0	
14.70	CM	Crack Multiple	3	5		False	3	0	
20.10	RFL	Roots Fine Lateral	11			False	0	1	
20.10	TFA	Tap Factory Activity	11			False	0	0	657 N.ARMOUR ST.
58.90	RMC	Roots Medium Connection	2	50		False	0	3	
58.90	TFA	Tap Factory Activity	2			False	0	0	642 N.STRATFORD RD.
71.30	RFJ	Roots Fine Joint	3			False	0	1	
87.70	RFJ	Roots Fine Joint	4			False	0	1	
114.60	CM	Crack Multiple	8	4		False	3	0	
120.10	CM	Crack Multiple	8	4		False	3	0	
125.20	TBA	Tap Break-in Activity	10			False	0	0	643 N.ARMOUR ST.
185.50	TSA	Tap Saddle Activity	1			False	0	0	630 N.STRATFORD RD.
210.40	RFJ	Roots Fine Joint	3	4		False	0	1	
236.30	RMJ	Roots Medium Joint	7	10	35	False	0	3	
236.30	TFC	Tap Factory Capped	10			False	0	0	
238.10	CL	Crack Longitudinal	12			False	2	0	
269.10	RBL	Roots Ball Lateral	10	95		False	0	4	
269.10	TFA	Tap Factory Activity	10			False	0	0	631 N.ARMOUR ST.
297.00	AMH	Manhole				False	0	0	5948-106/ LINE SEGMENT LO

---

**Sewer CCTV Observations**

5/1/2024

10:12 AM

---

<b>Alt Pipe ID:</b>	35633	<b>Inspected Date:</b>	9/9/2021		<b>Survey Direction:</b>	Downstream			
<b>Distance:</b>	<b>CCTV Defect :</b>	<b>Clock 1:</b>	<b>Clock 2:</b>	<b>%</b>	<b>Contin:</b>	<b>Doc:</b>	<b>Struct:</b>	<b>O&amp;M:</b>	<b>Remarks:</b>
0.00	AMH Manhole					False	0	0	5948-108
0.00	MWL Miscellaneous Water Level			5		False	0	0	
3.50	CM Crack Multiple	1	4			False	3	0	
24.00	RMC Roots Medium Connection	2		35		False	0	3	
24.00	TFD Tap Factory Defective	2				False	0	3	664 N.STRAFORD RD.
37.30	CM Crack Multiple	8	4			False	3	0	
52.00	TBB Tap Break-in Abandoned	11				False	0	0	
96.60	TFC Tap Factory Capped	2				False	0	0	
97.70	CM Crack Multiple	11	1			False	3	0	
101.70	TBA Tap Break-in Activity	10				False	0	0	669 N.ARMOUR ST.
135.40	TFD Tap Factory Defective	2				False	0	3	650 N.STRAFORD RD.
135.90	HSV Hole Soil Visible	3	4			False	5	0	
155.30	CL Crack Longitudinal	9				False	2	0	
161.30	AMH Manhole					False	0	0	5948-107/ LINE SEGMENT LO