

2-1

ORME

Church of Christ  
600 S. Poplar

MH # 5646-155  
Replace Manhole Frame & Cover  
Approx depth = 7.7 ft

Point Repair:  
Remove and replace 79 lf of 8" pipe from  
125' north of MH 5646-154 to MH 5646-154  
(see tv log)

The sewer runs along the edge of an asphalt parking lot. Easement also contains fences and trees. All restoration items shall be incidental to the point repair.

MH # 5646-154  
Approx depth = 8.0 ft

GROVE

POPLAR

GREEN

195'

621 S. Green



204'

218'

657 S. Green

GILBERT

SITE 2

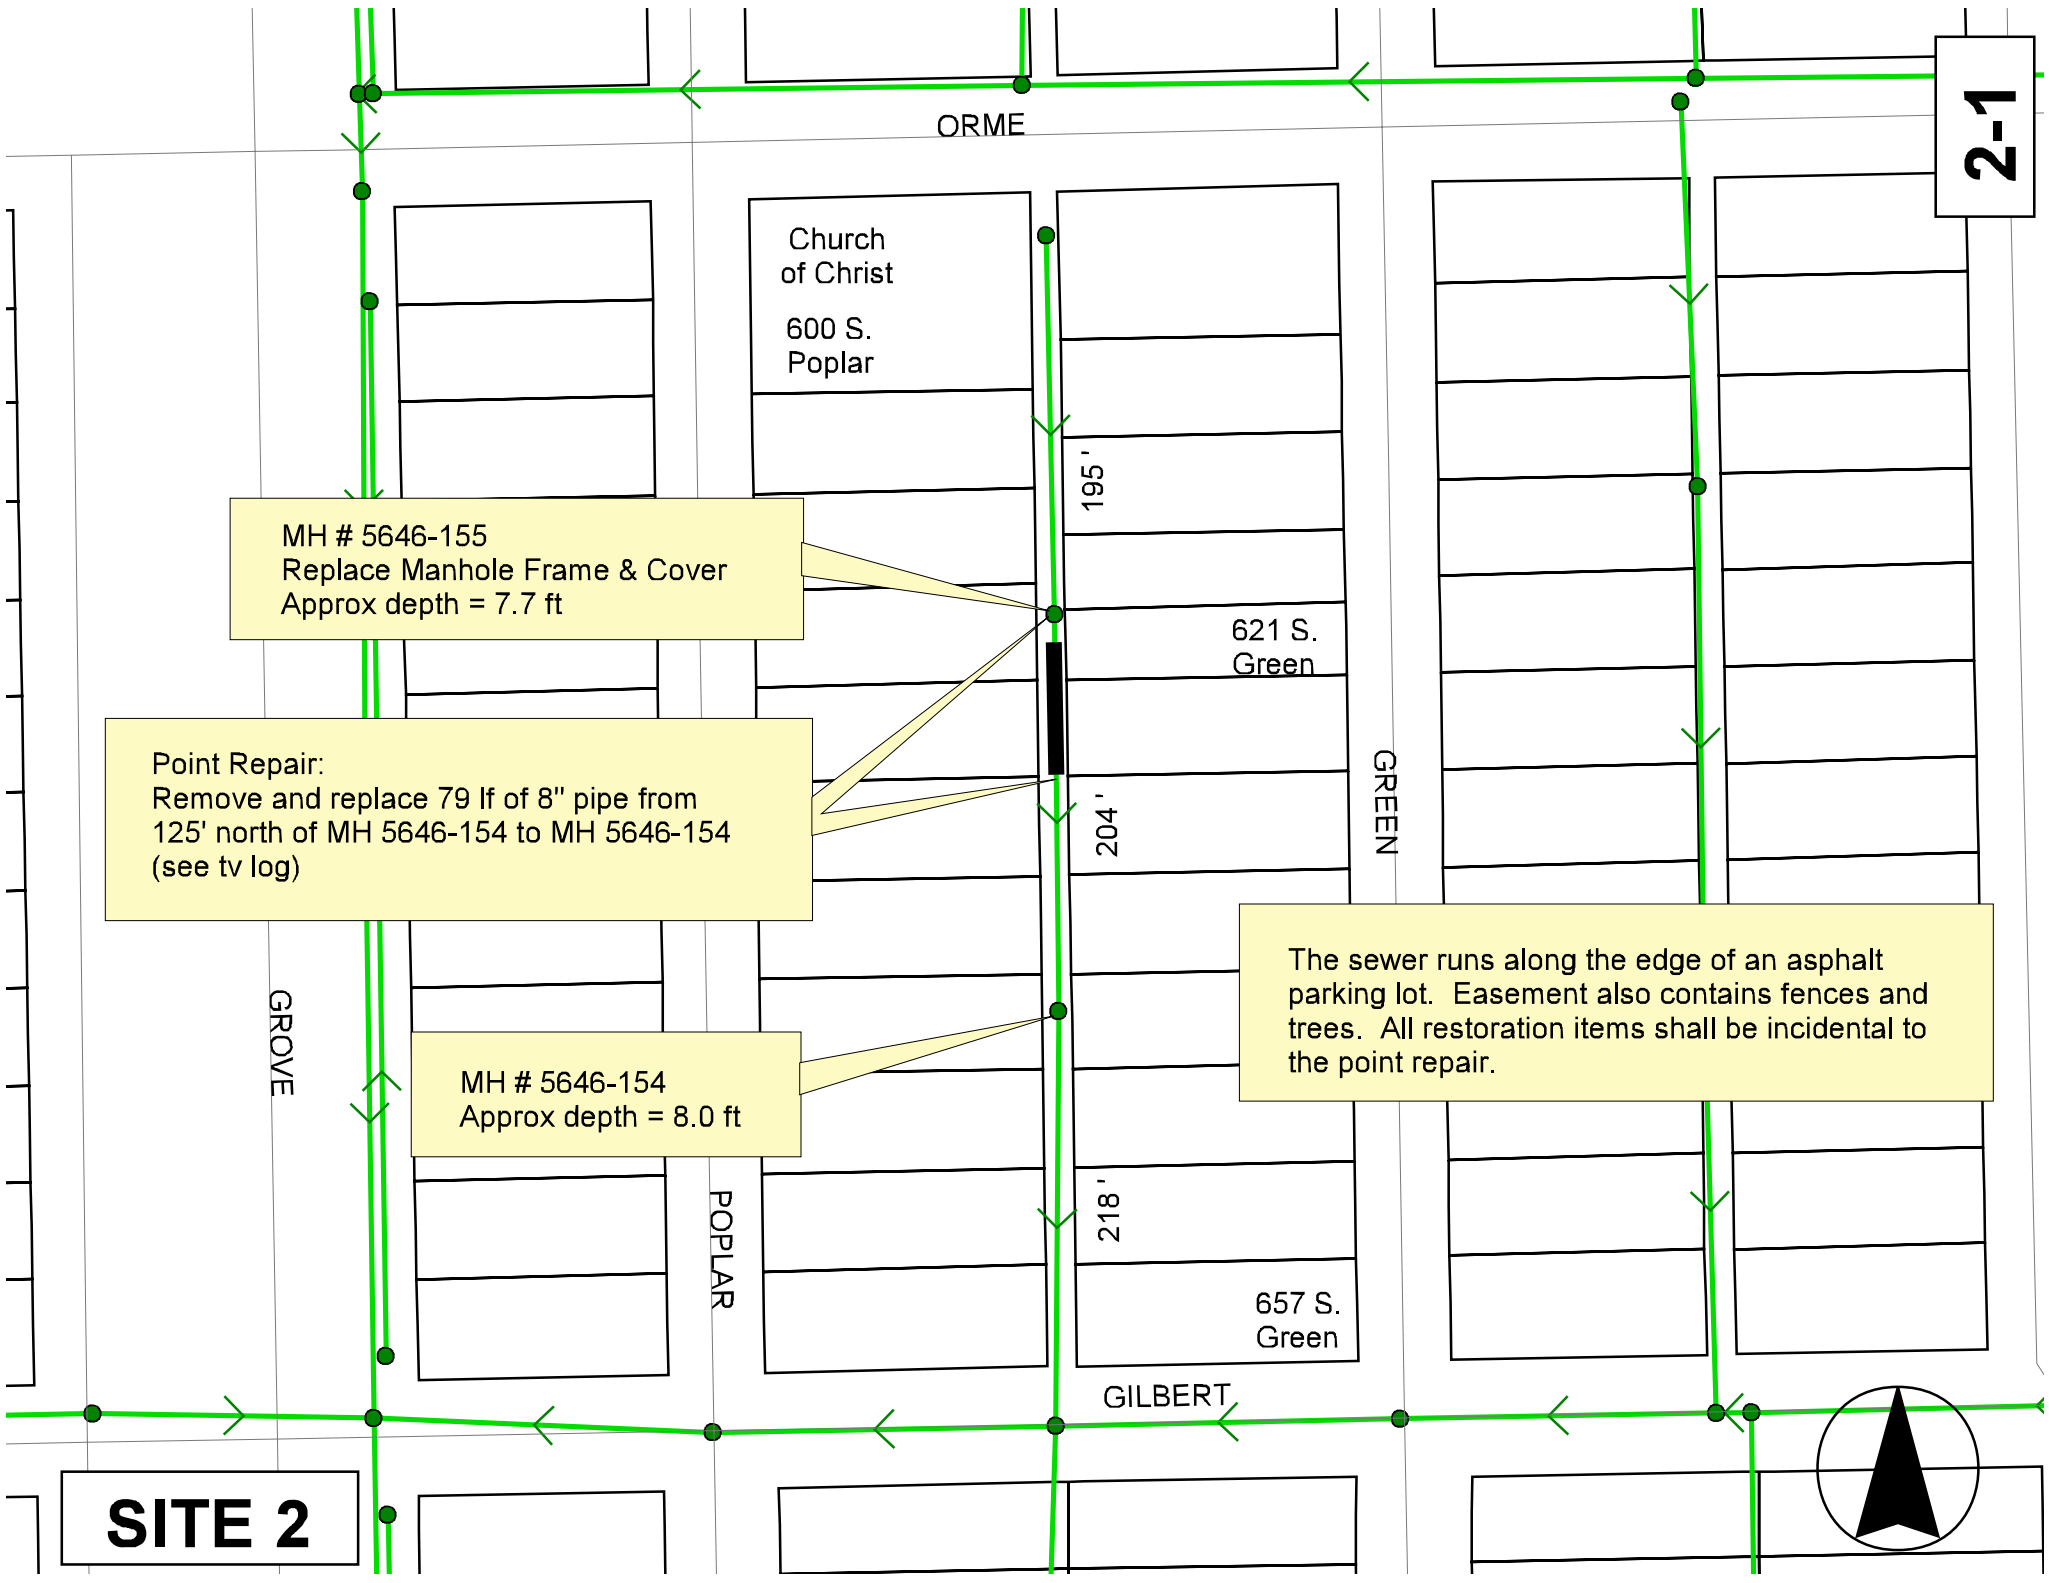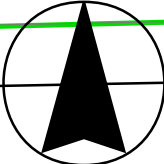

ORME

POPLAR

GREEN

Church of Christ

155

154

Aerial View



# Television Inspection Master Report

3/20/2007  
4:20 PM

US Structure: 5646-155  
DS Structure: 5646-154

621 S GREEN ST  
640 S POPLAR ST

Date Insp: 8/8/2006  
Dir Televised: Downstream To Upstream

Basin: EC01F

## Pipe Information

C-018

Shape: Round Length Status: Project No.:  
Dia/Ht Width: 8 0 Material: VCP Index:  
Length: 204.5 Slope: 0.201 Surface:

## Inspection Information

DVD #0181

Crew: 694 Percent Full: Tape ID:  
Weather: Sunny Purpose: TV Existing Line Counter Start:  
Surface Cond: Flow: Normal Flow Counter Stop:

Obs. #	VTR Counter	Distance	Location	Description	Rating	Obsrvd (gpm)	Est. (gpm)	Ratings Struct	Clean	Remain (gpm)
1		0.0	DS Manhole	<u>5646-154 / TELEVISIONING AGAINST THE FLOW</u>						
2		6.7	Upper Left	Crack-Radial	3		0.000	0	0	0.000
3		12.2	Lower Left	Crack-Radial	3		0.000	0	0	0.000
4		14.1		Sealed Off Wye West	1		0.000	0	0	0.000
5		17.0		Sealed Off Wye East	1		0.000	0	0	0.000
6		22.2	Lower Left	Crack-Radial	3		0.000	0	0	0.000
7		27.0	Lower Left	Crack-Radial	3		0.000	0	0	0.000
8		29.8	Upper Right	Crack-Horizontal	3		0.000	0	0	0.000
9		39.1	West	Wye Service	4		0.000	0	0	0.000
ROOTS / 636 SOUTH POPLAR										
10		42.1		Sealed Off Wye East	1		0.000	0	0	0.000
11		45.0	Upper Right	Crack-Radial	3		0.000	0	0	0.000
12		55.1	Joint	Roots	3		0.008	5	8	0.008
13		55.9	Upper Right	Broken Pipe	4		0.000	0	0	0.000
14		56.4	East	Break-In Conn	1		0.000	0	0	0.000
637 SOUTH GREEN										
15		57.6	Lower Left	Crack-Radial	4		0.000	0	0	0.000
16		62.4	Invert	Crack-Radial	4		0.000	0	0	0.000
17		64.8		Sealed Off Wye West	1		0.000	0	0	0.000
18		67.2	East	Wye Service	4		0.000	0	0	0.000
ROOTS / 633 SOUTH GREEN										
19		75.2	Joint	Roots	3		0.008	5	8	0.008
20		89.4	West	Wye Service	5		0.000	0	0	0.000
632 SOUTH POPLAR / FULL OF ROOTS										
21		90.7	Upper Right	Broken Pipe	4		0.000	0	0	0.000
22		93.0		Sealed Off Wye East	3		0.003	0	0	0.003
DEBRIS AND ROOTS										
23		100.8	Joint	Roots	2		0.004	2	4	0.004
24		106.0	Joint	Roots	3		0.008	5	8	0.008
25		108.5	Joint	Roots	3		0.008	5	8	0.008
26		113.4	Joint	Roots	3		0.008	5	8	0.008
27		115.4		Sealed Off Wye West	1		0.000	0	0	0.000
28		116.3	Joint	Roots	3		0.008	5	8	0.008
29		118.3		Sealed Off Wye East	1		0.000	0	0	0.000
30		118.8	Joint	Roots	3		0.008	5	8	0.008
31		120.9	Joint	Roots	3		0.008	5	8	0.008

# Television Inspection Master Report

3/20/2007  
4:20 PM

US Structure: 5646-155  
DS Structure: 5646-154

621 S GREEN ST  
640 S POPLAR ST

Date Insp: 8/8/2006  
Dir Televised: Downstream To Upstream

Basin: EC01F

**BEGIN POINT REPAIR AT 125' (PIPE AND GRADE ARE GOOD AT THIS POINT) AND REPLACE THE PIPE ALL THE WAY TO THE UPSTREAM MANHOLE:**

32	131.2	Upper Left	Crack-Horizontal	4	0.000	0	0	0.000
33	131.3	Crown	Crack-Horizontal	4	0.000	0	0	0.000
34	134.3	Lower Left	Crack-Horizontal	4	0.000	0	0	0.000
35	136.3	Upper Right	Crack-Horizontal	4	0.000	0	0	0.000
36	141.2	West	Break-In Conn	1	0.000	0	0	0.000
ROOTS 628 SOUTH POPLAR								
37	143.5	East	Break-In Conn	4	0.000	0	0	0.000
ROOTS / 629 SOUTH GREEN								
38	144.2	Joint	Roots	3	0.008	5	8	0.008
39	146.5	Lower Left	Broken Pipe	4	0.000	0	0	0.000
40	148.9	Crown	Broken Pipe	5	0.000	0	0	0.000
41	151.6	Crown	Broken Pipe	5	0.000	0	0	0.000
42	154.2	Crown	Broken Pipe	5	0.000	0	0	0.000
43	156.8	Crown	Broken Pipe	4	0.000	0	0	0.000
44	158.9	Crown	Broken Pipe	4	0.000	0	0	0.000
45	161.9	Lower Left	Broken Pipe	4	0.000	0	0	0.000
46	164.2	Crown	Broken Pipe	4	0.000	0	0	0.000
47	166.2		Sealed Off Wye West	1	0.000	0	0	0.000
48	166.8	Crown	Broken Pipe	4	0.000	0	0	0.000
49	168.8	Crown	Other	5	0.000	0	0	0.000
BAD CAVITY								
50	168.9	East	Break-In Conn	5	0.000	0	0	0.000
BAD CAVITY AROUND OUTSIDE OF CONNECTION / 621 SOUTH GREEN								
51	169.4	Crown	Broken Pipe	4	0.000	0	0	0.000
52	174.3	Upper Left	Crack-Radial	3	0.000	0	0	0.000
53	179.8	Lower Left	Crack-Horizontal	3	0.000	0	0	0.000
54	182.1	Lower Left	Crack-Horizontal	4	0.000	0	0	0.000
55	184.3	Upper Left	Broken Pipe	3	0.000	0	0	0.000
56	191.6		Sealed Off Wye West	1	0.000	0	0	0.000
57	194.3		Sealed Off Wye East	1	0.000	0	0	0.000
58	197.0	Upper Left	Crack-Radial	3	0.000	0	0	0.000
59	202.5	Invert Broken	Collapsed Pipe	4	0.000	0	0	0.000
60	202.7	West	Break-In Conn	4	0.000	0	0	0.000
BROKEN PIPE PIECES MISSING AROUND CONNECTION 600 SOUTH POPLAR								
61	203.5	US Manhole 5646-155		1	0.000	0	0	0.000

MH 5646-154 was not recently inspected due to a dog in that yard.

MH 5646-155 is located inside the fence of 621 S. Green and was not recently inspected.