




PEDESTRIAN PUSHBUTTON/SIGN UNIT DETAIL

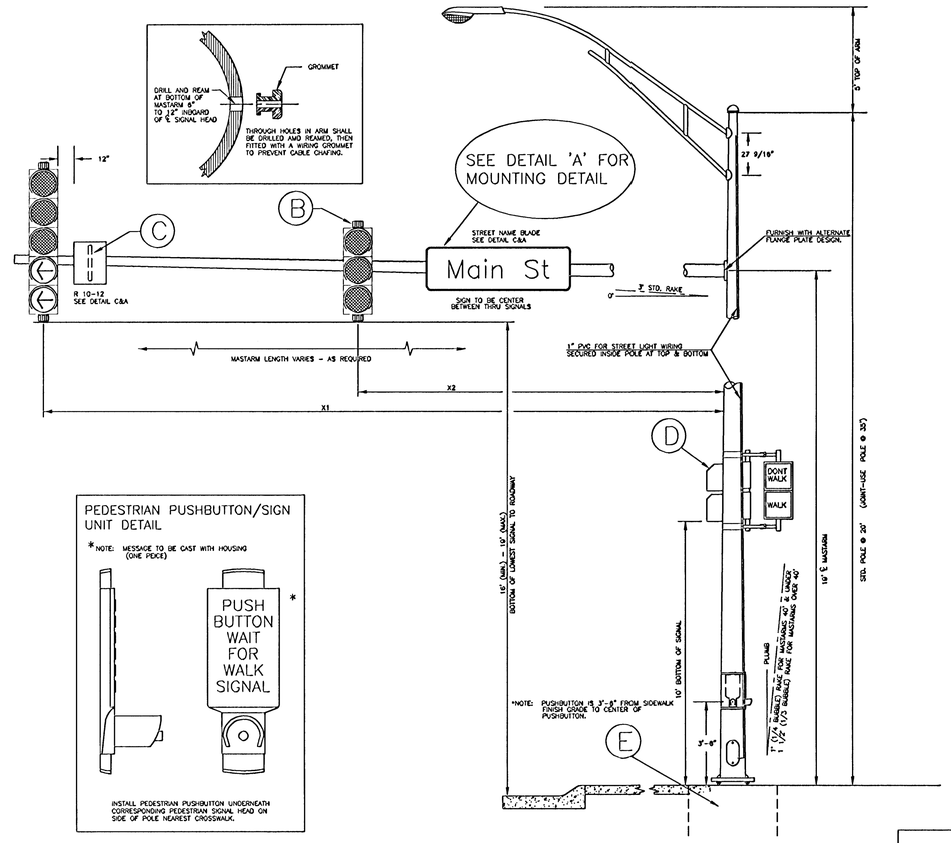



INSTALL PEDESTRIAN PUSHBUTTON UNDERNEATH CORRESPONDING PEDESTRIAN SIGNAL HEAD ON SIDE OF POLE NEAREST CROSSWALK.

**BANDED SIGN MOUNTING BRACKET DETAIL**

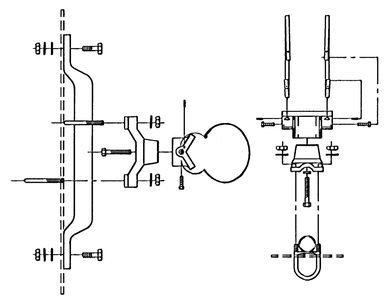


A

**TYPE I SIGNAL MOUNTING BRACKET ASSEMBLY DETAIL**

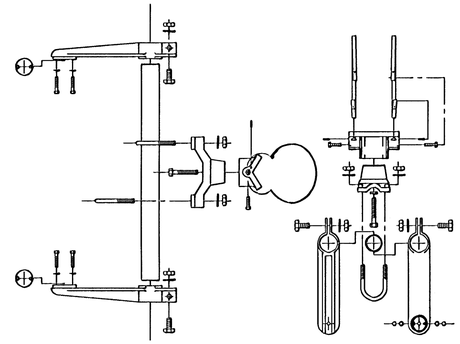


B

**STANDARD SIGNING**

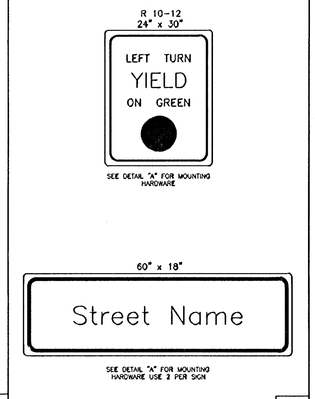



C

**TYPE III SIDE-OF-POLE MOUNTING BRACKET ASSEMBLY**

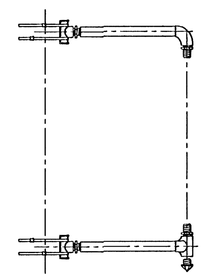


F

**TYPE II SIGNAL MOUNTING BRACKET ASSEMBLY (SIDE-OF-POLE)**

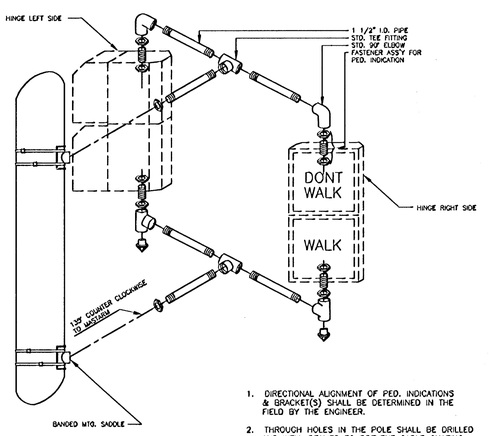


1. DIRECTIONAL ALIGNMENT OF PED. INDICATIONS & BRACKET(S) SHALL BE DETERMINED IN THE FIELD BY THE ENGINEER.
2. THROUGH HOLES IN THE POLE SHALL BE DRILLED AND WELL REAMED TO PREVENT CABLE CHAFING.
3. HINGE PEDESTRIAN SIGNAL DOORS AWAY FROM POLE.

D

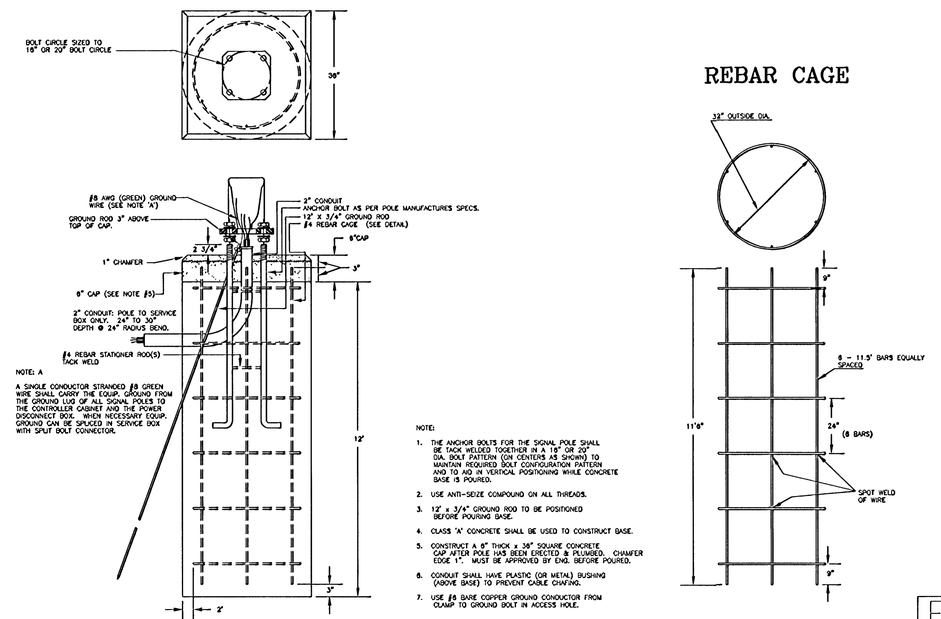


NOTE: A

A SINGLE CONDUCTOR STRANDED #8 GREEN WIRE SHALL CARRY THE EQUIP. GROUND FROM THE GROUND LUG OF ALL SIGNAL POLES TO THE CONTROLLER CABINET AND THE POWER DISCONNECT BOX. WHEN NECESSARY EQUIP. GROUND CAN BE SPLICED IN SERVICE BOX WITH SPLIT BOLT CONNECTOR.

NOTE:

1. THE ANCHOR BOLTS FOR THE SIGNAL POLE SHALL BE TACK WELDED TOGETHER IN A 19" OR 20" DIA. BOLT PATTERN (ON CENTERS AS SHOWN) TO MAINTAIN REQUIRED BOLT CONFIGURATION PATTERN AND TO AID IN VERTICAL POSITIONING WHILE CONCRETE BASE IS POURED.
2. USE ANTI-SEIZE COMPOUND ON ALL THREADS.
3. 12' x 3/4" GROUND ROD TO BE POSITIONED BEFORE POURING BASE.
4. CLASS 'A' CONCRETE SHALL BE USED TO CONSTRUCT BASE.
5. CONSTRUCT A 6" THICK x 36" SQUARE CONCRETE CAP AFTER POLE HAS BEEN ERECTED & PLUMBED. CHAMFER EDGE 1". MUST BE APPROVED BY ENG. BEFORE POURED.
6. CONDUIT SHALL HAVE PLASTIC (OR METAL) BUSHING (ABOVE BASE) TO PREVENT CABLE CHAFING.
7. USE #8 BARE COPPER GROUND CONDUCTOR FROM CLAMP TO GROUND BOLT IN ACCESS HOLE.

## REBAR CAGE




E

WILSON ESTATES PARKWAY AND WEBB ROAD

| PROJECT NUMBER 472-83677 | | |
|---|---|---|
| DRAWN BY: T.M. | SCALE NO SCALE | REVISED BY: L. B. |
| DATE: FEB. 98 | | DATE: 2/26/99 |

CITY OF WICHITA
DEPARTMENT OF PUBLIC WORKS

DIVISION OF TRAFFIC ENGINEERING
WM. G. McKINLEY P.E. TRAFFIC ENGINEER

SHEET 5 OF 7

DSNR: BER OPER: BJS SCALE: 1=1.00
Q:\2002\02620\004\SIGPOL-E 02-11-2003 01:48:48 pm