

CAMPUS CREST ADDITION




Note: Do not disturb channel bottom between Sta 0+00 and Sta 2+25

RE-GRADE 25 L.F. EXISTING DITCH TO NEW PIPES. REUSE EXISTING RIPRAP.

STA. 1+69, 7.5' LT. TO STA. 1+67, 41' LT. INSTALL 35 L.F. 2-24" RCP PLACE 15 S.Y. HEAVY STONE RIPRAP DS FL 1333.50 US FL 1336.00

STA. 2+25 BEGIN TYPICAL SECTION 2 SEE DETAILS SHT. 2

N 1704661.29, E 1664122.12 PT: STA. 2+31.32

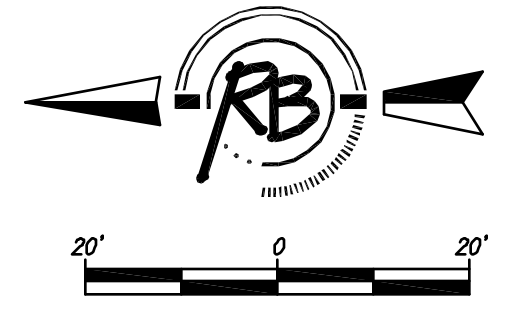

NOTE: FIELD ADJUST GRADING EAST OF MAINTENANCE PATHWAY TO SAVE TREES LARGER THAN 12"

STA. 4+00 BEGIN TYPICAL SECTION 2 SEE DETAILS SHT. 2

N 1704468.22, E 1664120.34 PI: STA. 4+24.40

STA. 4+94, 5' LT. TO STA. 5+13, 52' LT. INSTALL 52 L.F. 2-24" RCP PLACE 15 S.Y. HEAVY STONE RIPRAP DS FL 1335.00 US FL 1340.00

RESERVE 'A' FLOOD PLAIN EASEMENT

RE-GRADE 25 L.F. EXISTING DITCH TO NEW PIPES. PLACE 40 S.Y. CURLEX.

STA. 5+50 BEGIN TYPICAL SECTION 4 SEE DETAILS SHT. 3

DO NOT CUT FLOWLINE IN VICINITY OF GAS MAIN.

STA. 0+05.39 BEGIN TYPICAL SECTION 1 SEE DETAILS SHT. 2

SEE SHT. 9 FOR BOX REPAIR DETAILS

STA. 2+75 BEGIN TYPICAL SECTION 4 SEE DETAILS SHT. 3

STA. 2+75, BEGIN RETAINING WALL. SEE PROFILES, SHEET 8

PROTECT TREES ON WEST SIDE OF CHANNEL AS INDICATED.

STA. 4+00, END RETAINING WALL. SEE PROFILES, SHEET 8

STA. 5+50, BEGIN RETAINING WALL. SEE PROFILES, SHEET 8

2956 N Terrace Drew Tombrello & Leigh A Horsley


2948 N Terrace Deutsche Bank National Tr. Co.

Denell A & Jerry Corner

2932 N Terrace Yvonne J Johnson

GREENBRIAR MANOR

DITCH BOTTOM MAINTENANCE PATHWAY

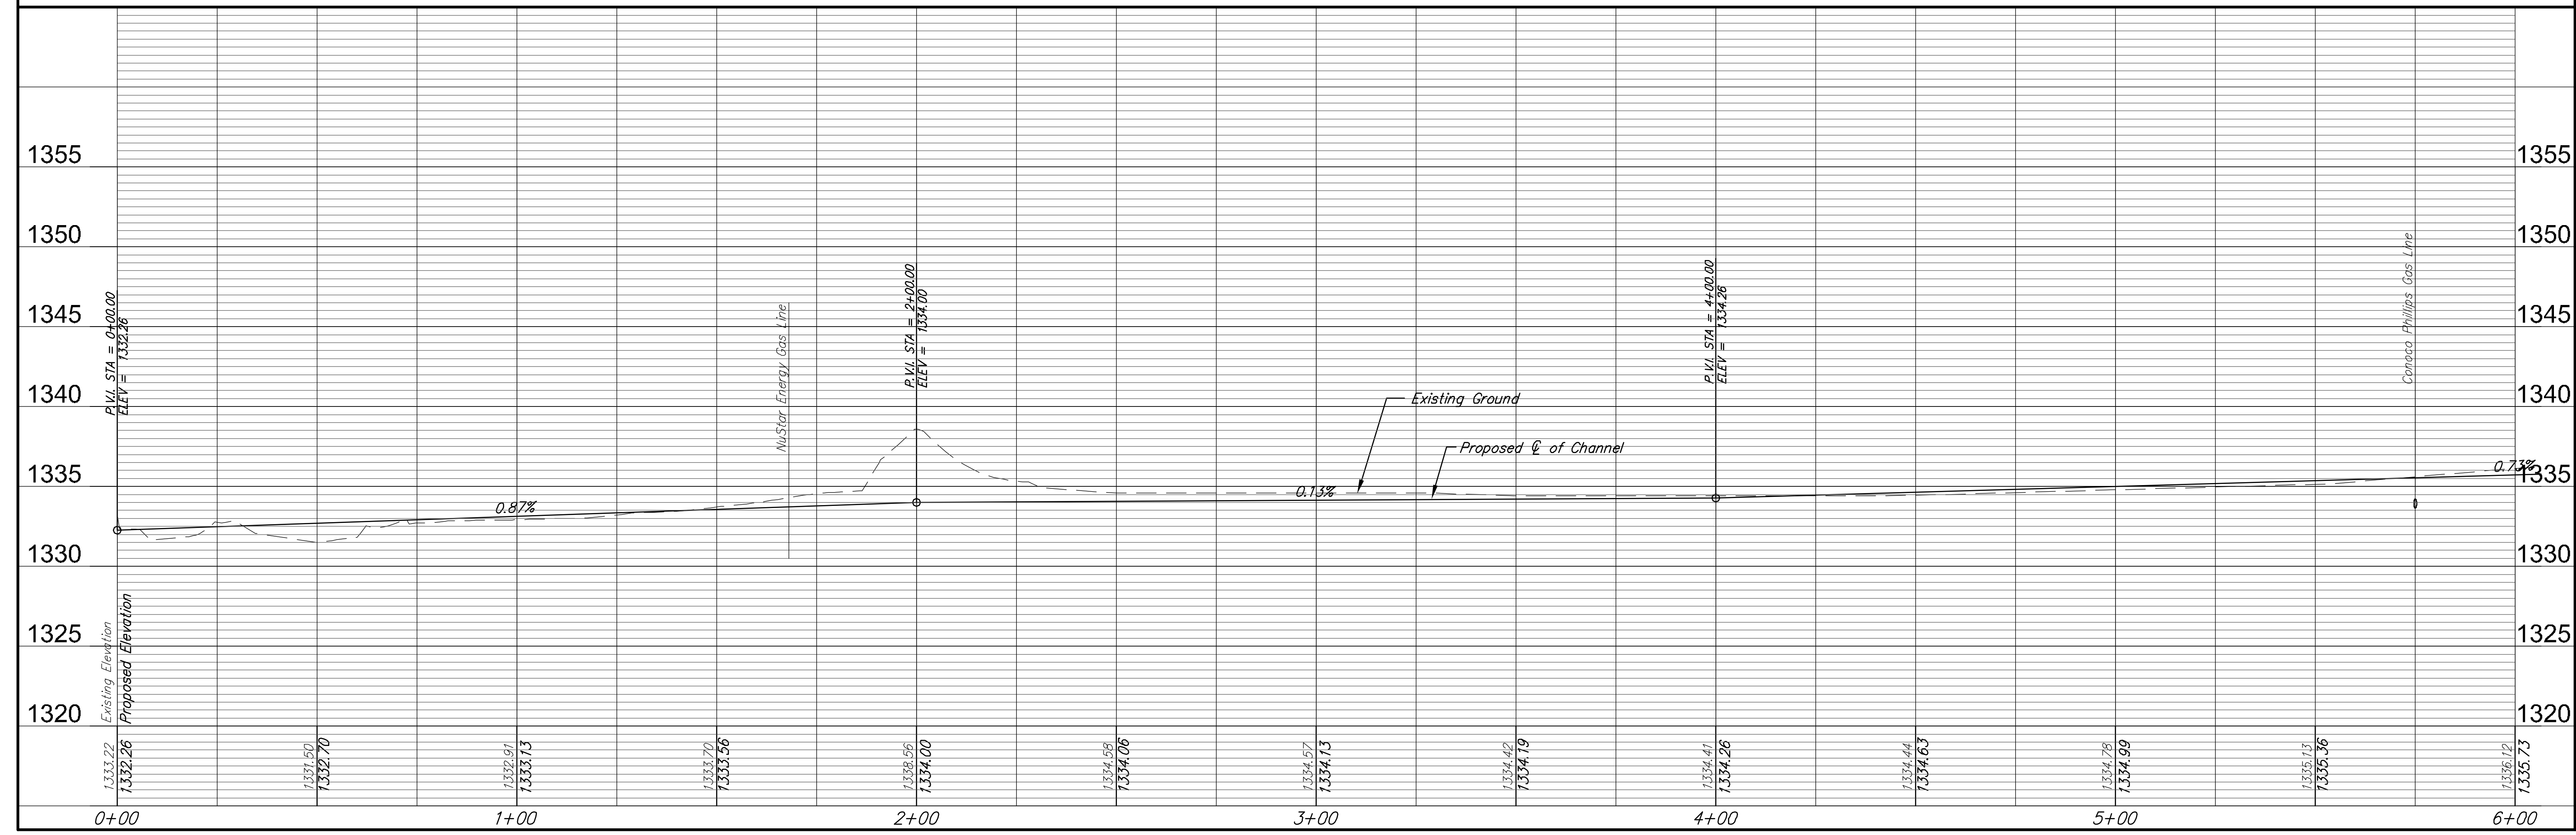

Ruggles & Bohm, P.A.
Engineering, Surveying, Land Planning
1000 W. 10th St., Suite 200
Wichita, Kansas 67203
www.rba.com
E-mail: RUGB@rba.com



REVISION
DRAWN RA
DATE Jan. 11, 2012
DESIGN KWL
UTILITY

PROJECT NUMBER
DRAWING FILE

CHANNEL IMPROVEMENTS GREENBRIAR CHANNEL WICHITA, KANSAS

38300
4
26