


BENCHMARKS

BM #1: Brass Plate on North
Hub Guard of R.C.B.C. 50' East of
NW Corner NE 1/2, Sec. 22, Twp.
26-S, R-1-E.
Elev. = 1371.83 (NGVD29)

BM #2: " " cut on East Hub
Guard of R.C.B.C., 110' S. of the
SE Cor., SE 1/4, Sec. 22, Twp.
26-S, R-1-E.
Elev. = 1359.54 (NGVD29)

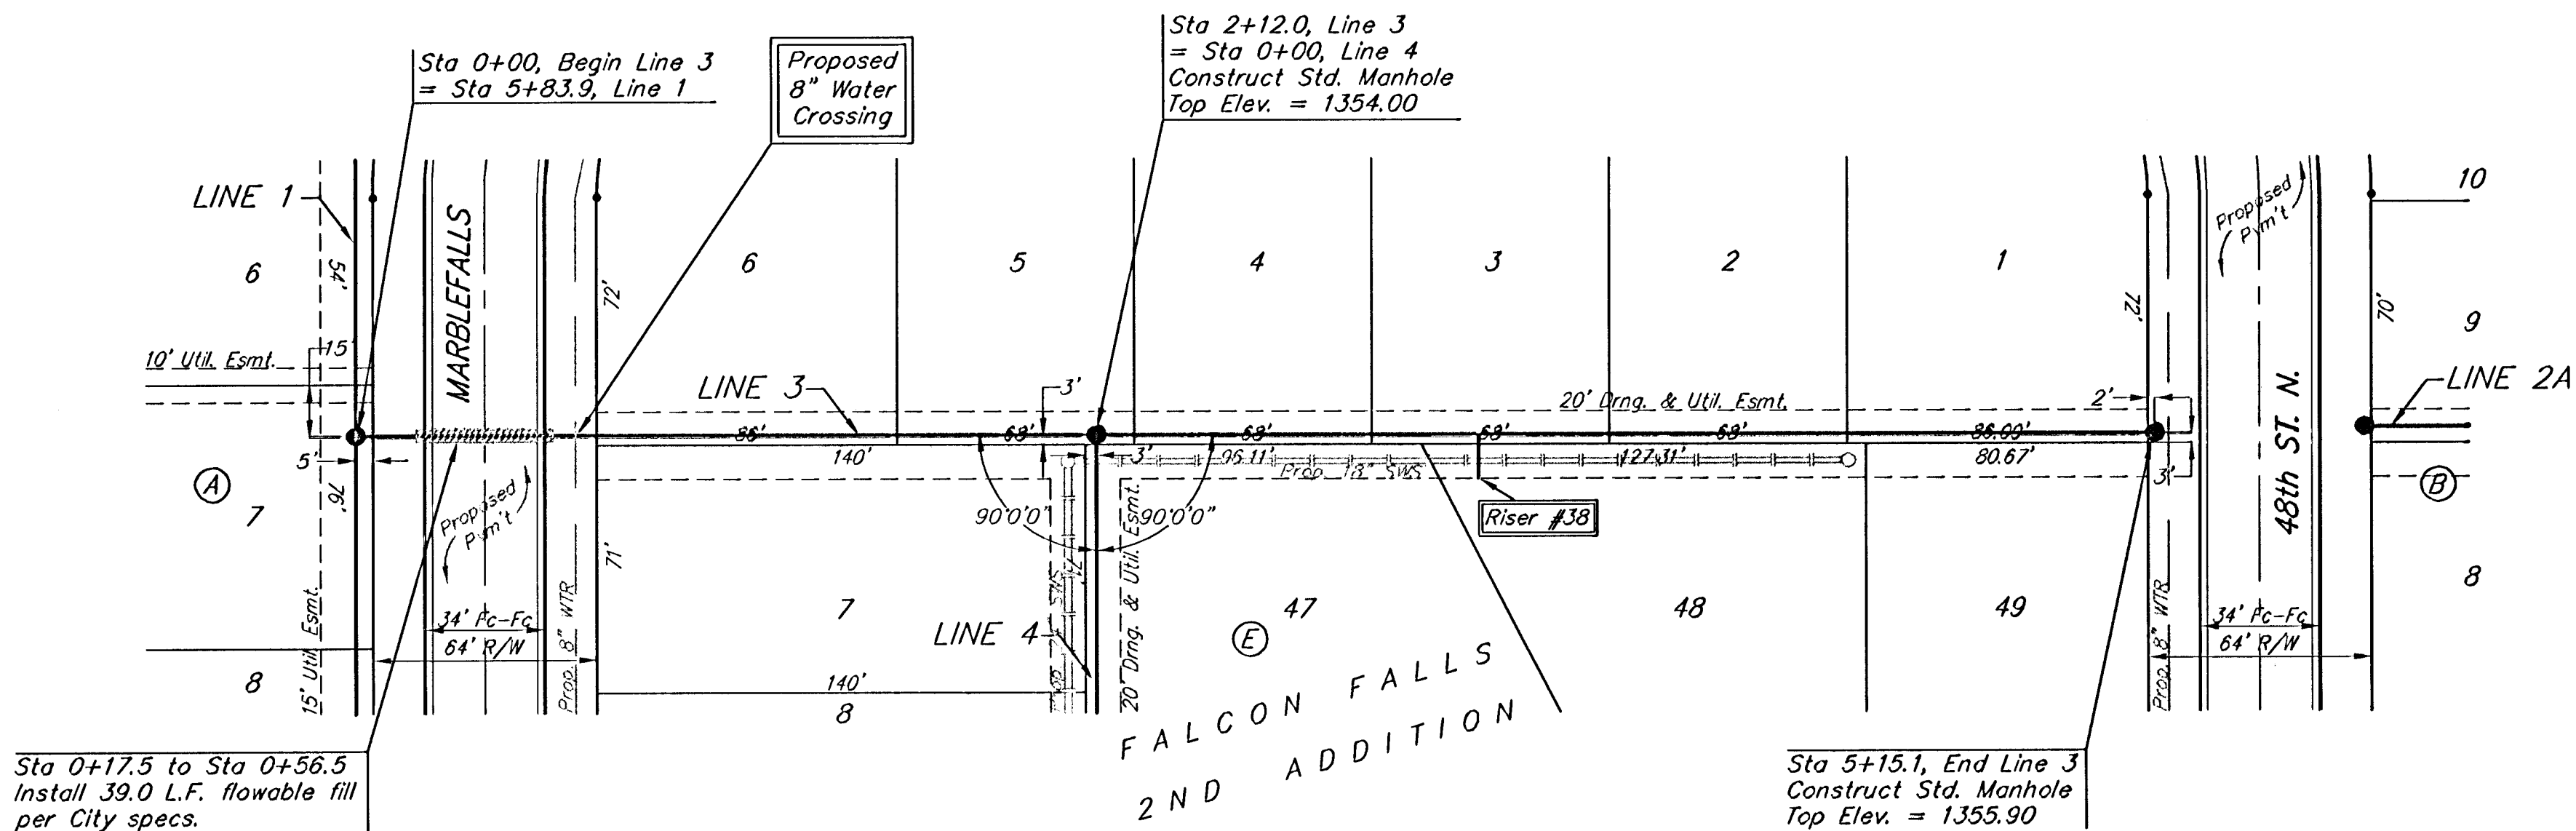


Scale: 1" = 40' Horizontal
1" = 5' Vertical
• = Iron

SEWER SERVICE TABLE

NUMBER	TYPE	LOCATION			FOR INFORMATION ONLY	
		LOT NO.	BLOCK NO.	LINE NO.	STATION DIRECTION	APPROXIMATE LENGTH 4" PIPE VERTICAL HORIZONTAL
38	8" x 4" Tee Saddle	48	E	3	3+22/Rt.	7.5' 15'

NOTE: Vertical Riser Pipe shall be extended to 2' minimum above ground water elevation and 4' maximum below proposed ground elevation.

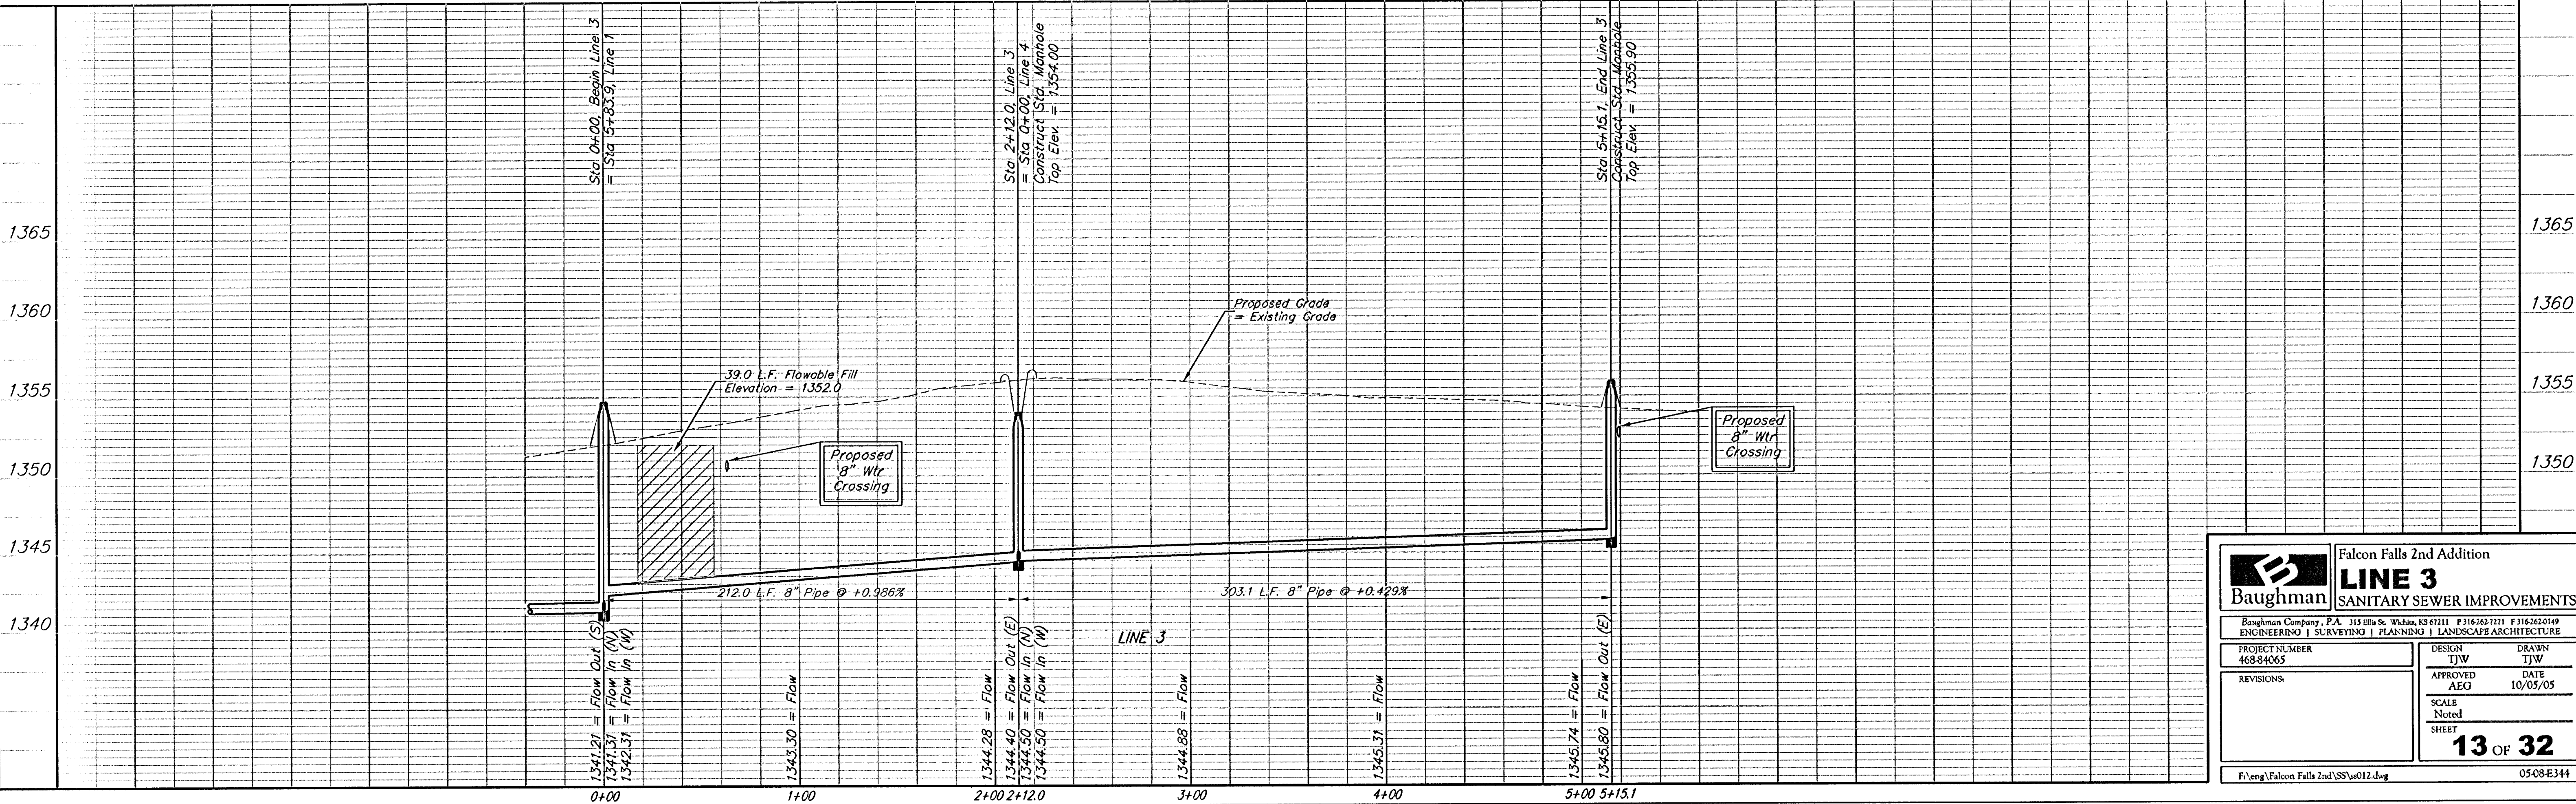

Falcon Falls 2nd Addition
LINE 3
SANITARY SEWER IMPROVEMENTS

Baughman Company, P.A. 315 Ellis St., Wading, KS 67111 P:316-262-7171 F:316-262-0149
ENGINEERING | SURVEYING | PLANNING | LANDSCAPE ARCHITECTURE

PROJECT NUMBER
468-84063

DESIGN
TJW
APPROVED
AEG
SCALE
Noted
SHEET
13 OF 32

REVISIONS

F:\eng\Falcon Falls 2nd\SS\ss012.dwg 05-08-2014