



2nd Street North

Battin

Pinecrest

Old Manor

Parkwood

MH 5847-322  
227 N. Old Manor  
Approx MH depth = 21.8 ft

Sewer main lies on the Old Manor side of the properties.

Estimated 60 lf of Silt Fence

Service Connection Replaced:  
Replace the 4" connection for 227 N. Old Manor,  
located at 48 ft south of MH 5847-322.  
(a point repair on the 8" main should not be  
necessary) (see tv log)

Service Connection Replaced:  
Replace the 4" connection for 224 N. Pinecrest,  
located at 45 ft south of MH 5847-322.  
(a point repair on the 8" main should not be  
necessary) (see tv log)

Point Repair: Remove and replace approx 3 lf of  
8" pipe, from 144 ft to 147 ft south of MH  
5847-322, including the 4" tap reconnection for  
215 N. Old Manor (see tv log)


MH 5847-321  
Approx MH depth = 16.7 ft

Point Repair: Remove and replace approx 3 lf of  
8" pipe, from 272 ft to 275 ft south of MH  
5847-322, including the 4" tap reconnection for  
201 N. Old Manor (see tv log)

**SITE 4**

PAGE 12 OF 22

1st Street North

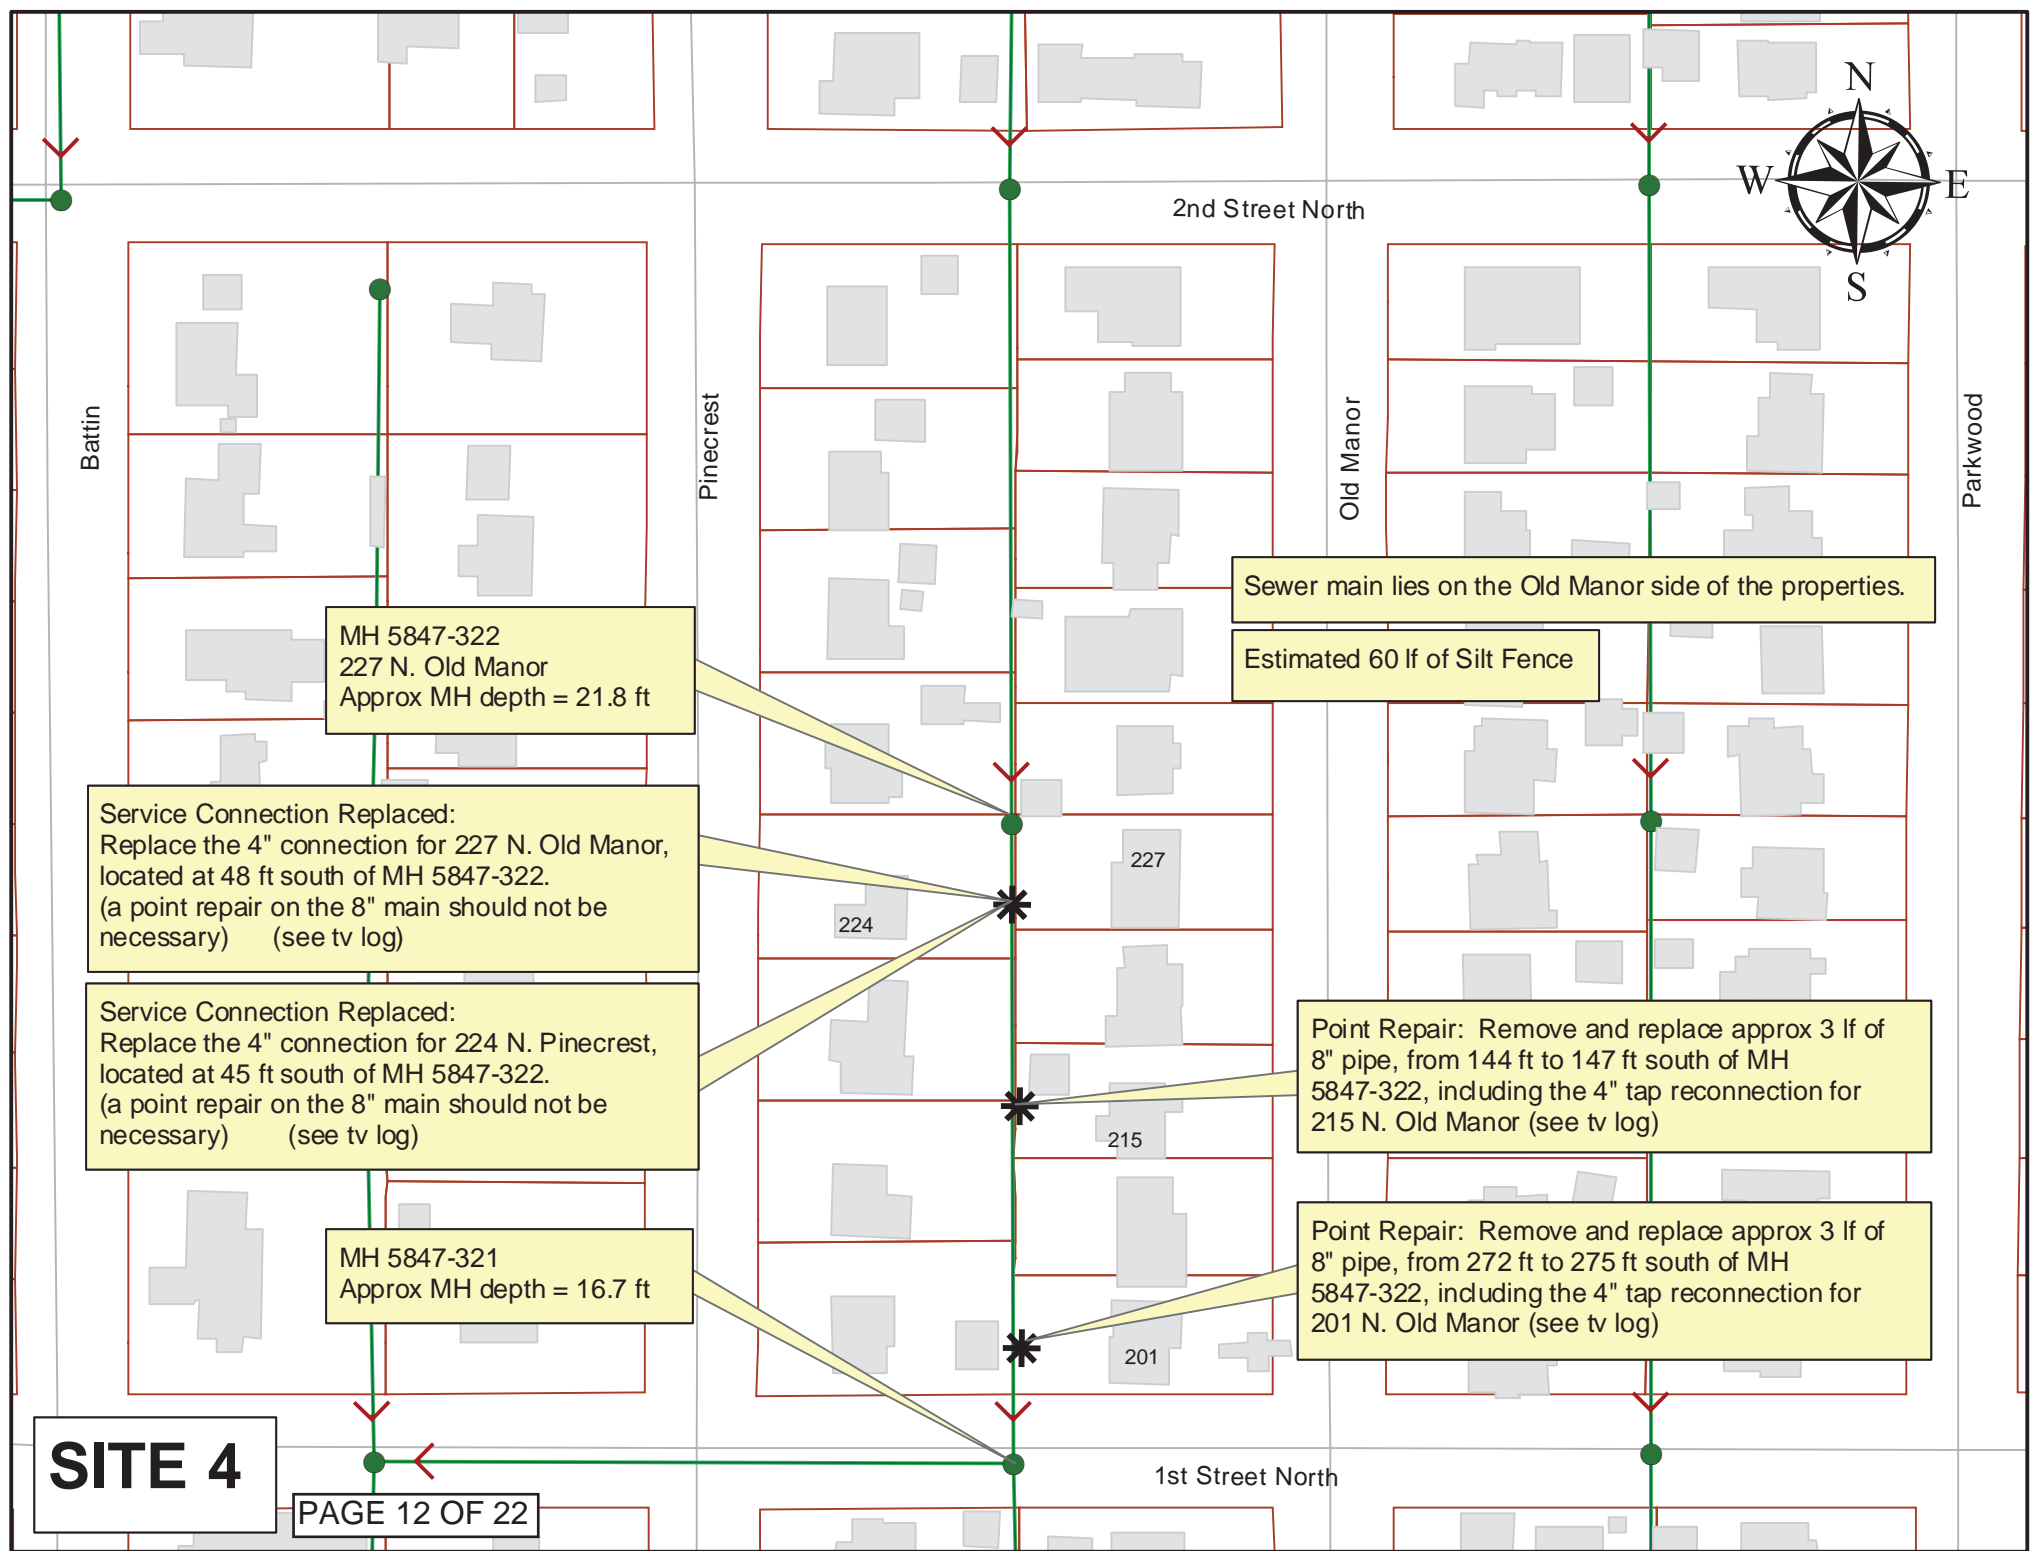

N PINECREST AVE

224

227

215

201

N OLD MANOR RD

N



## Video Inspection Master Report

8/17/2012  
7:53 AM

US Structure: 5847-322      227 N OLD MANOR RD      Date Insp: 5/30/2012      Basin: E04D  
 DS Structure: 5847-321      127 N OLD MANOR ST ST      Dir Televised: Upstream To Downstream

Project No. :E-036      Dia/Ht: 8      Material: VCP      Length: 335.5      Slope: 0.400

Obs. #	VTR Counter	Distance	Location	Description	Rating	Ratings		
						Obsrvd (gpm)	Est. (gpm)	Remain (gpm)
1		0.0		5847-322 US Manhole (21.8 ft deep)	1			
2		20.7		Sealed Off Wye	1			
3		23.9		Sealed Off Wye	1			



4      45.3      224 N PINECREST      4" VCP Wye Service      1  
 (first joint outside of main has broken pipe and some roots)  
 There is a utility pole at this location. Relocating the tap to a different point on the main is an option if it helps with keeping the utility pole stable. Contractor should discuss this with the Public Works Inspector or Engineer on site.

5      48.3      227 N OLD MANOR      4" VCP Wye Service      5      #5 Pool in yard  
 (service line is completely off the main at first joint out and there is a cavity)

If contractors need access to the yard of 227 Old Manor, contact LaDonna Lawrenz at 316-268-4329. The owner there is aware of the upcoming repairs and has spoken to the neighbor to the south about possible access across that property. It is still the contractor's responsibility to make arrangements for access.



15      145.8      215 N OLD MANOR      4" VCP Break-In Conn      3      (pipe is cracked around the tap)

16      170.9           Sealed Off Wye      1

17      173.9           Sealed Off Wye      1

18      195.4           Sealed Off Wye      1

19      198.0      207 N OLD MANOR      Break-In Conn      1

20      219.2      208 N PINECREST      Break-In Conn      1

21      221.8           Sealed Off Wye      1

22      247.5           Sealed Off Wye      1

23      250.3           Sealed Off Wye      1

24      254.8      204 N PINECREST      Break-In Conn      1

25      270.8           Sealed Off Wye      1



26      273.2      201 N OLD MANOR      4" VCP Break-In Conn      3      (pipe is cracked around the tap)

27      296.0           Sealed Off Wye      1

28      299.3           Sealed Off Wye      1

29      336.3           5847-321 DS Manhole      1