


BENCHMARKS

BM #1: Brass Plate on North Hub Guard of R.C.B.C. 50' East of NW Corner NE 1/2, Sec. 22, Twp. 26-S, R-1-E.
Elev. = 1371.83 (NGVD29)

BM #2: " " cut on East Hub Guard of R.C.B.C., 110' S. of the SE Cor., SE 1/4, Sec. 22, Twp. 26-S, R-1-E.
Elev. = 1359.54 (NGVD29)

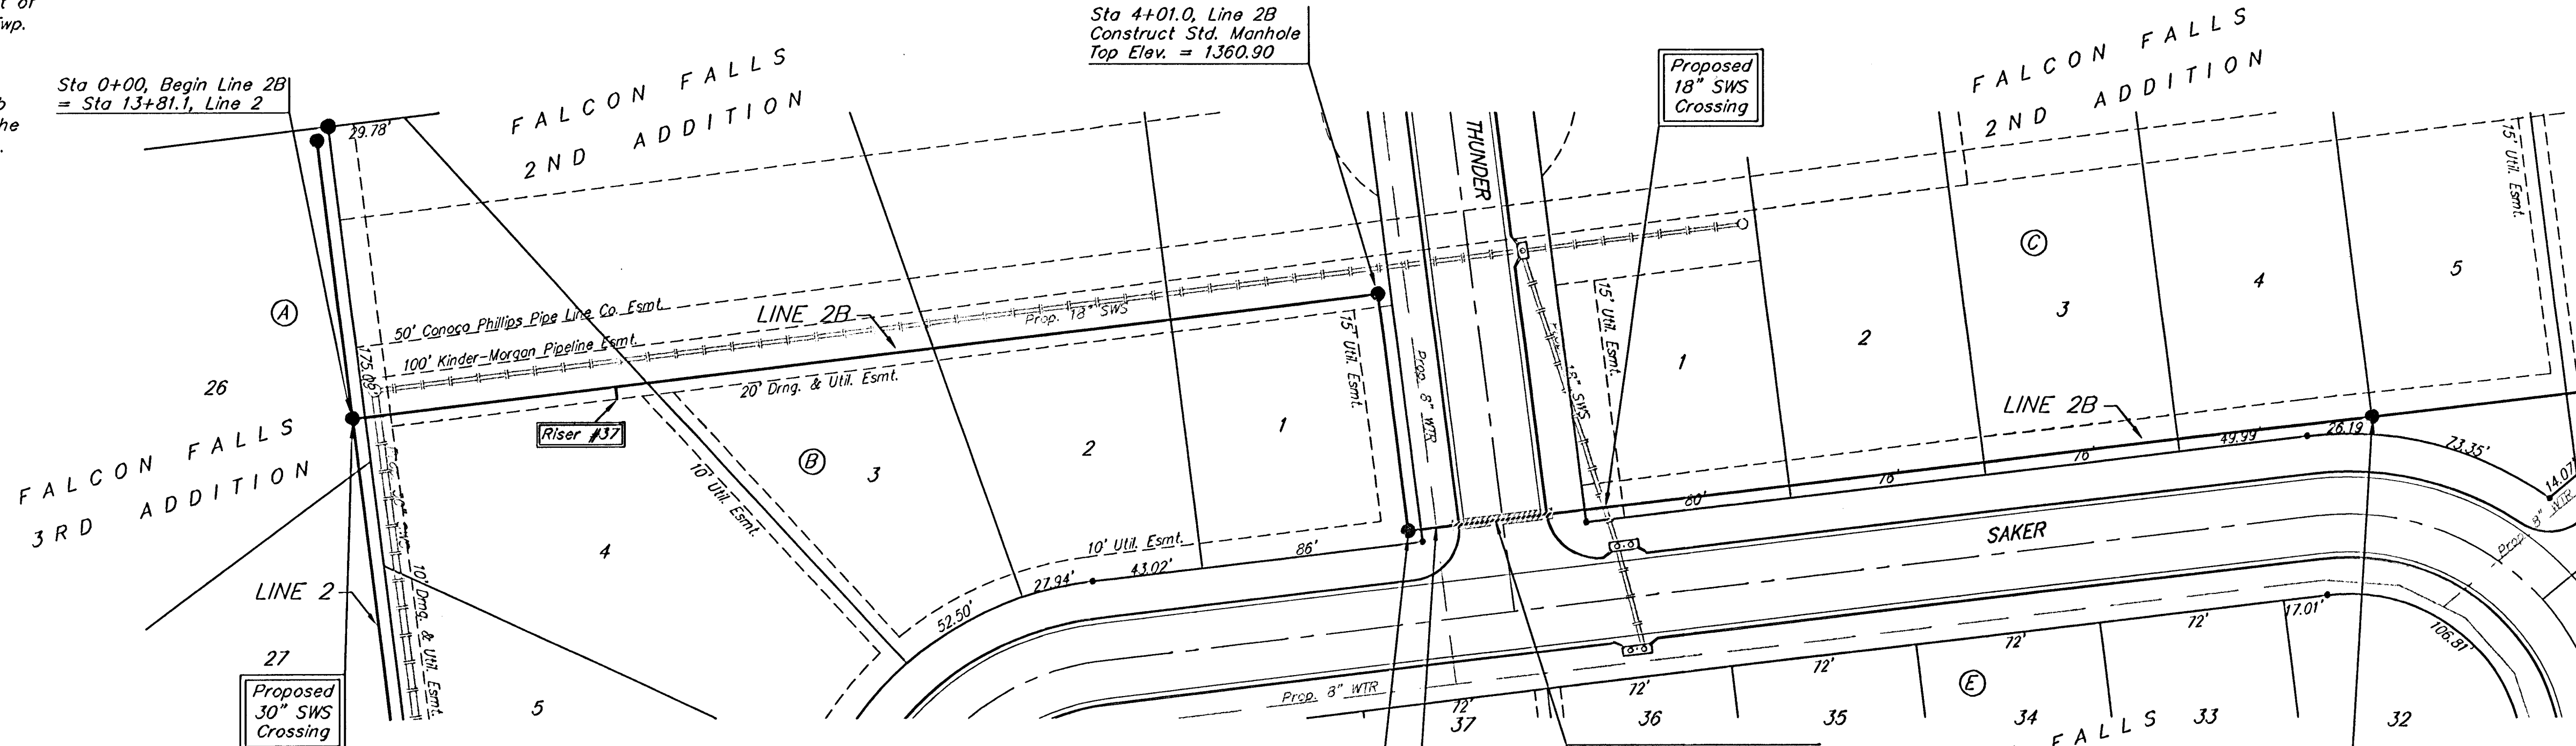

SEWER SERVICE TABLE


NUMBER	TYPE	LOCATION				FOR INFORMATION ONLY		
		LOT NO.	BLOCK NO.	LINE NO.	STATION DIRECTION	APPROXIMATE LENGTH 4" PIPE		
37	8" x 4" Tee Saddle	4	B	2B	1+02/Rt.	VERTICAL	HORIZONTAL	

NOTE: Vertical Riser Pipe shall be extended to 2' minimum above ground water elevation and 4' maximum below proposed ground elevation.



Scale: 1" = 40' Horizontal
1" = 5' Vertical
• = Iron

All excavation for Line 2B, from Station 4+96.0 to Station 8+73.0, shall be sand backfilled to within two feet of existing grade. The sand shall be vibrated and water jetted during backfilling. Cost shall be incidental to pipe cost.

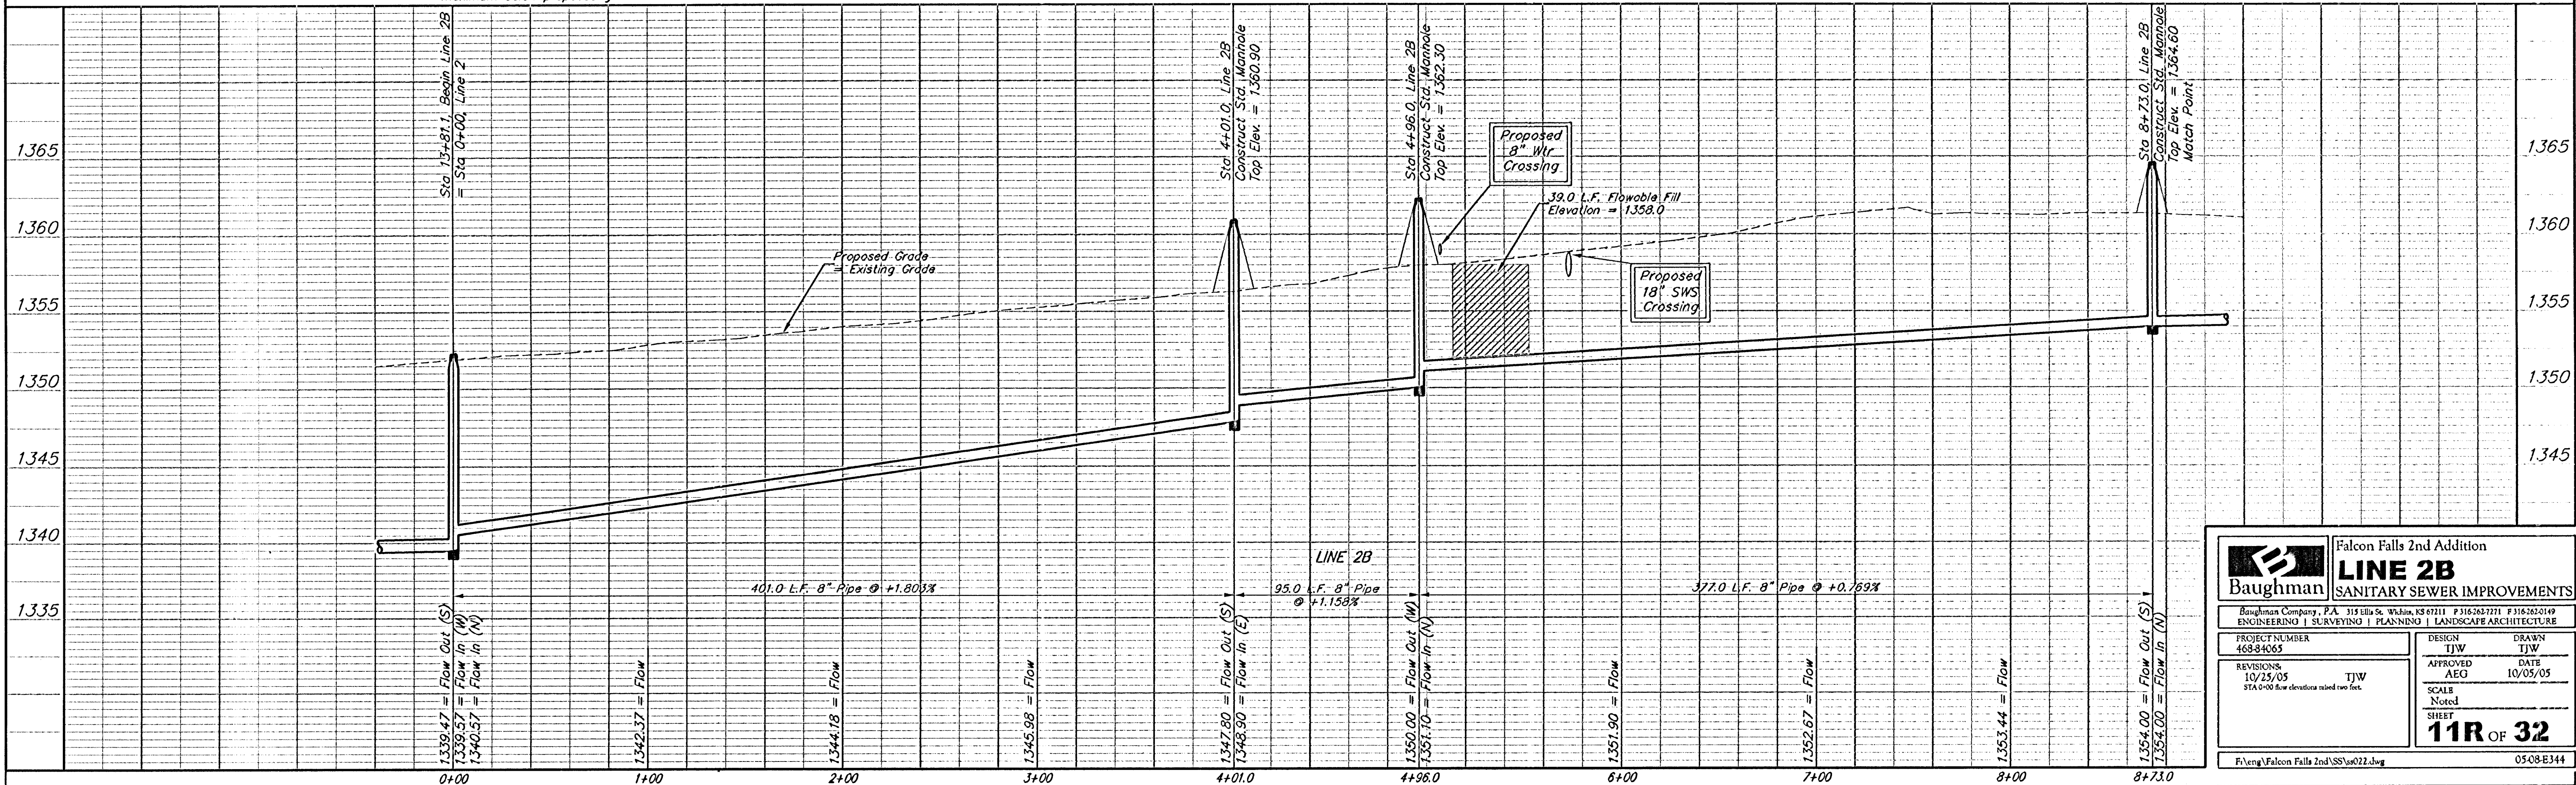

Baughman

Falcon Falls 2nd Addition

LINE 2B

SANITARY SEWER IMPROVEMENTS

PROJECT NUMBER: 4684065

DESIGN: TJW

DRAWN: TJW

REVISIONS: 10/25/05

APPROVED: AEG

DATE: 10/05/05

SCALE: Noted

SHEET: 11R OF 32

F:\eng\Falcon Falls 2nd\SS\022.dwg

0508E344