



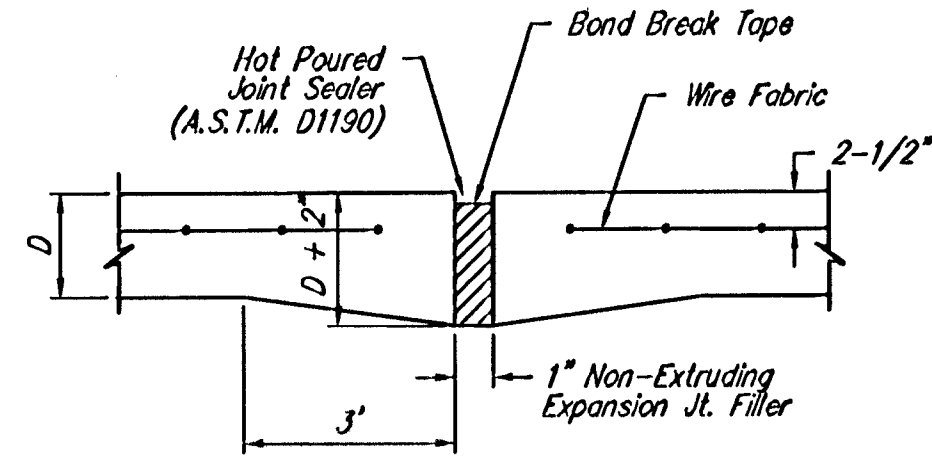


EXPANSION JOINT


NOTE: Extra Thickness to be Subsidiary to Price of Square Yards Pavement

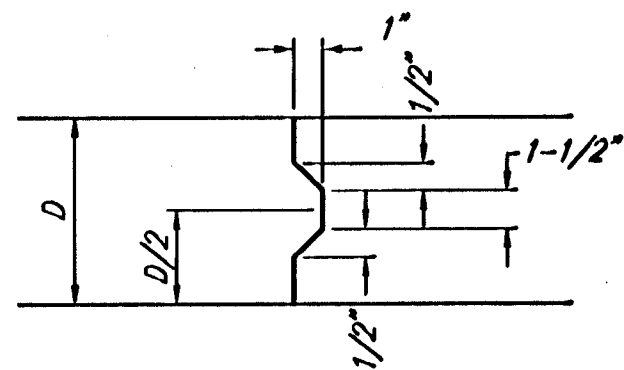


KEYWAY DETAIL

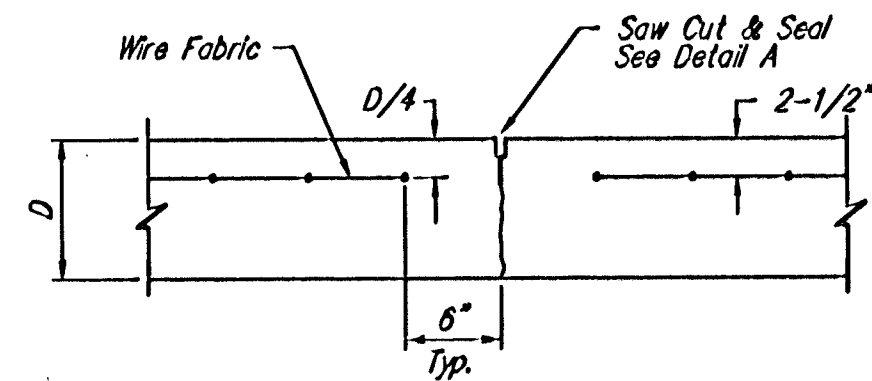


CONTRACTION JOINT DETAIL (C.J.)

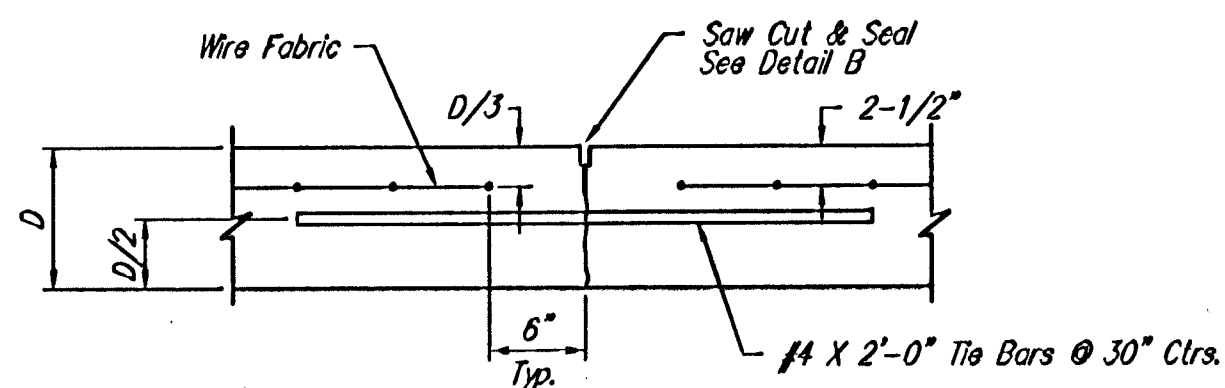


LONGITUDINAL JOINT DETAIL (L.J.)

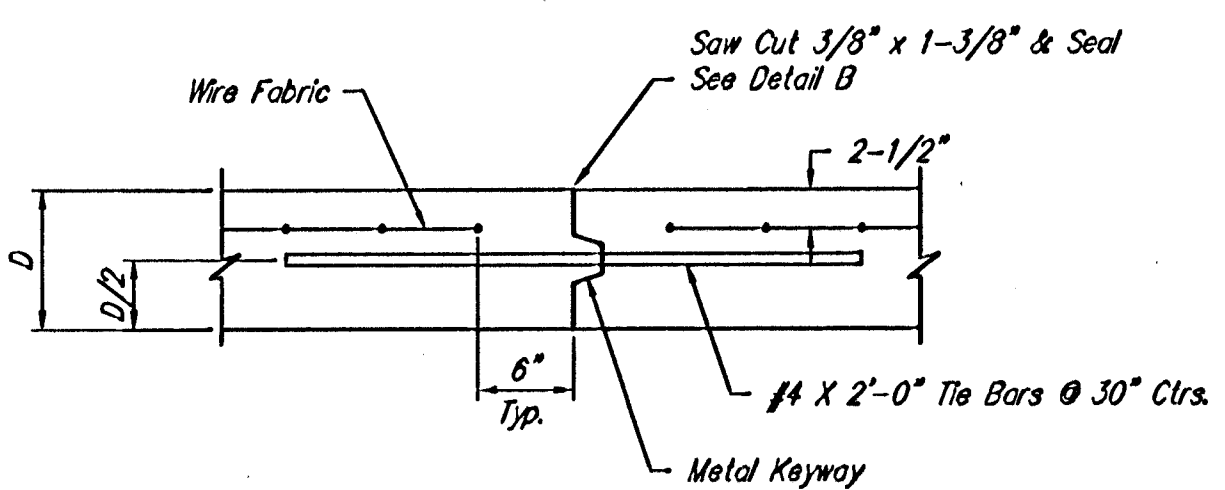


OPTIONAL LONGITUDINAL JOINT DETAIL (L.J.) (CONSTRUCTION JOINT)

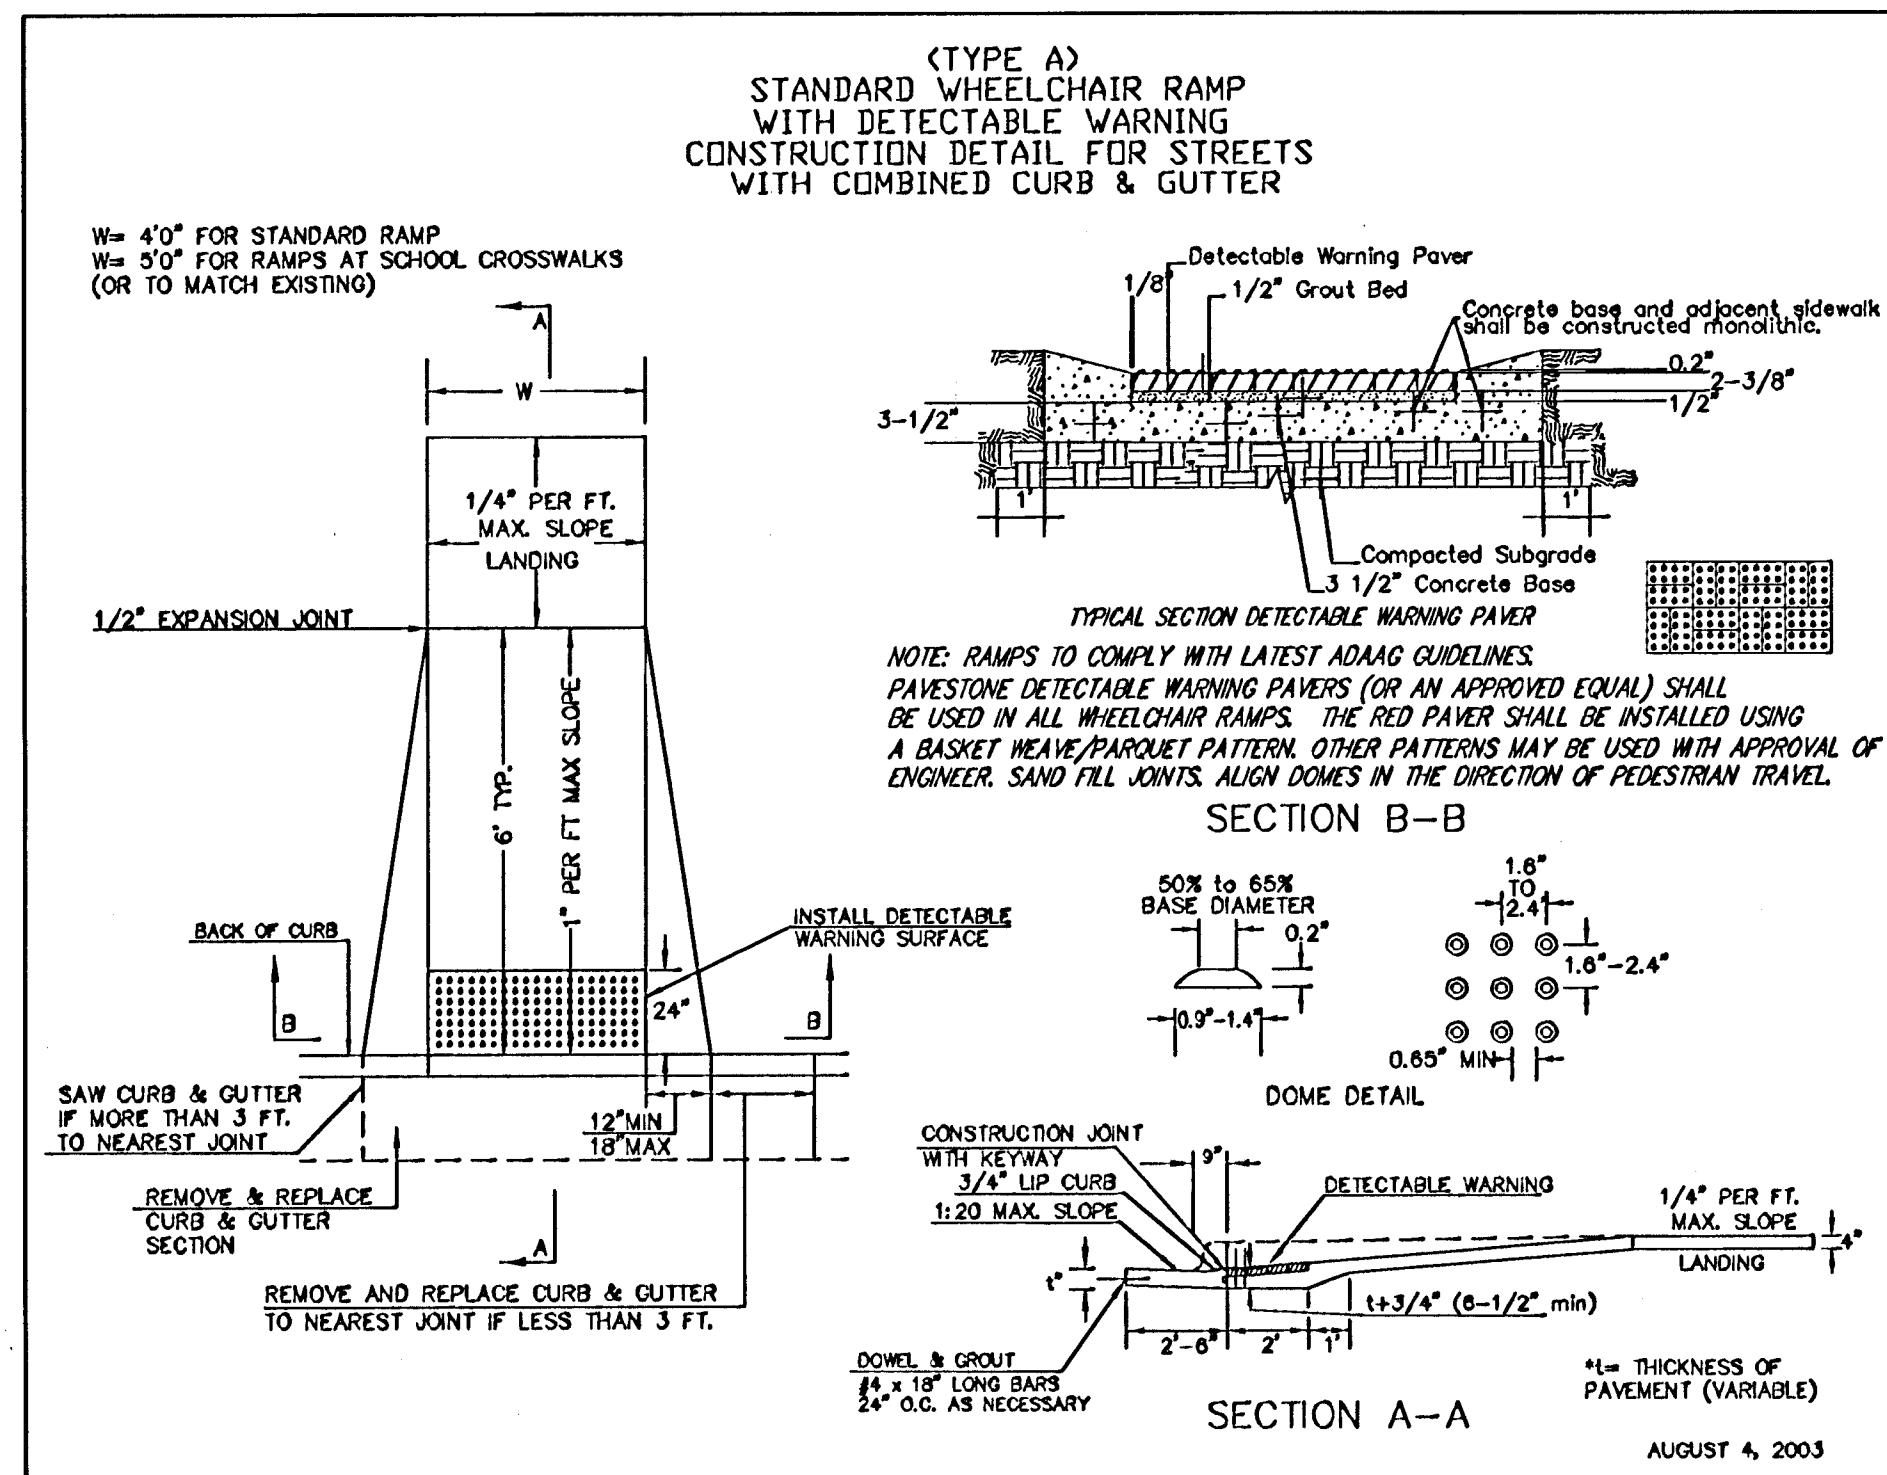


WHEELCHAIR RAMP DETAIL

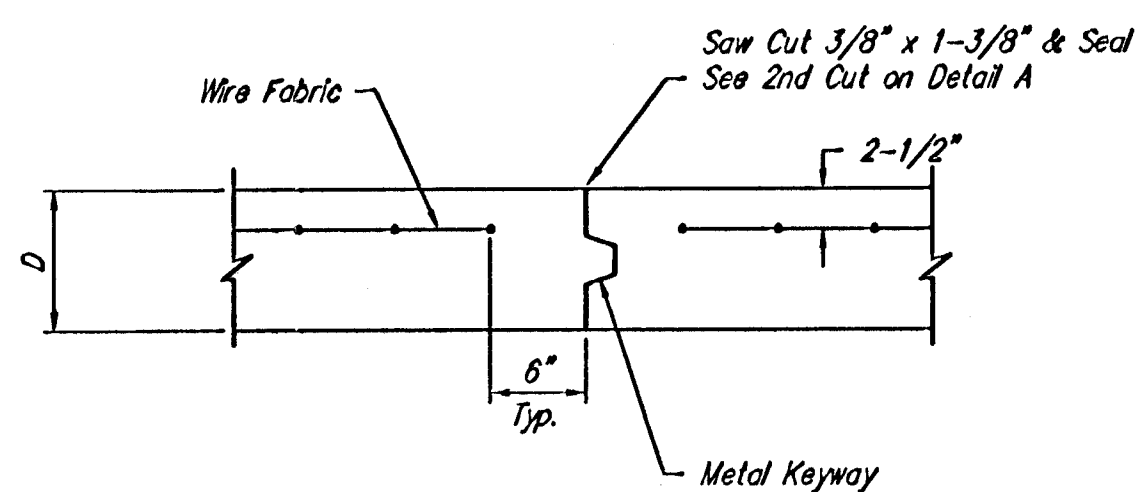


OPTIONAL CONTRACTION JOINT DETAIL (CONSTRUCTION JOINT)

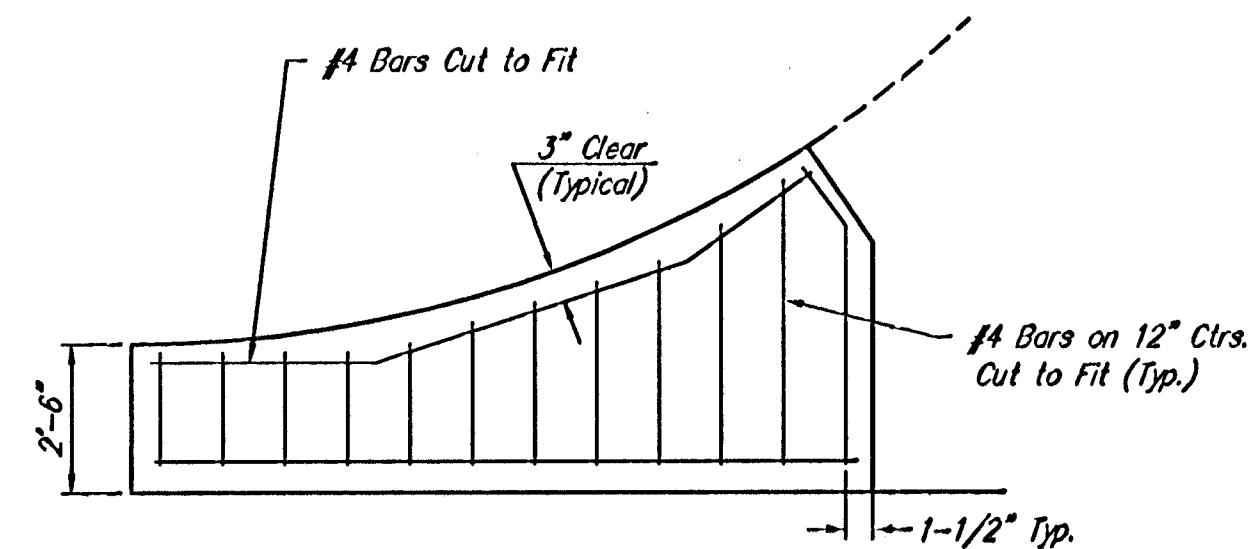





WING REINFORCING DETAIL

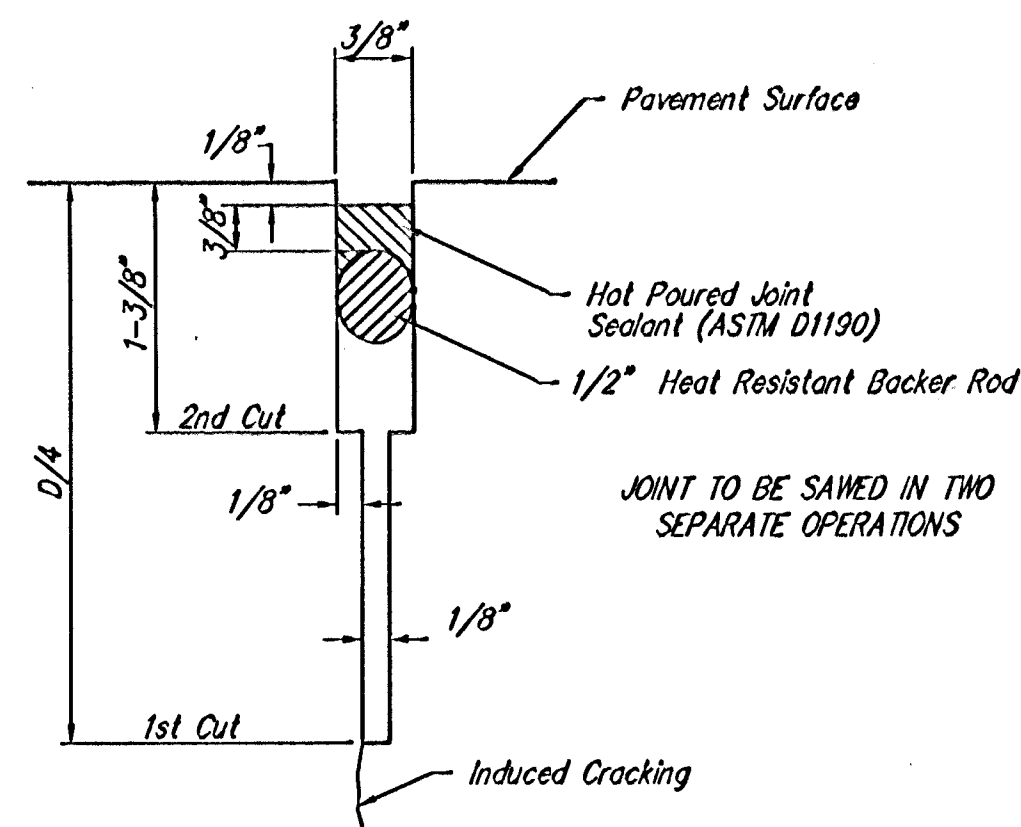

SAW JOINT DETAIL "A"

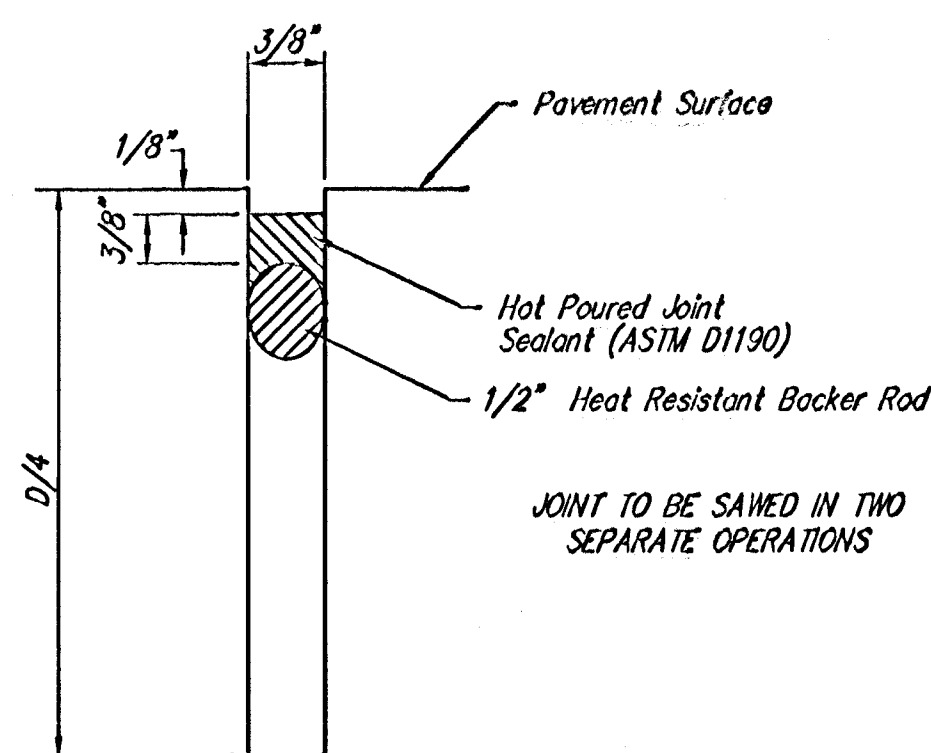

SAW JOINT DETAIL "B"

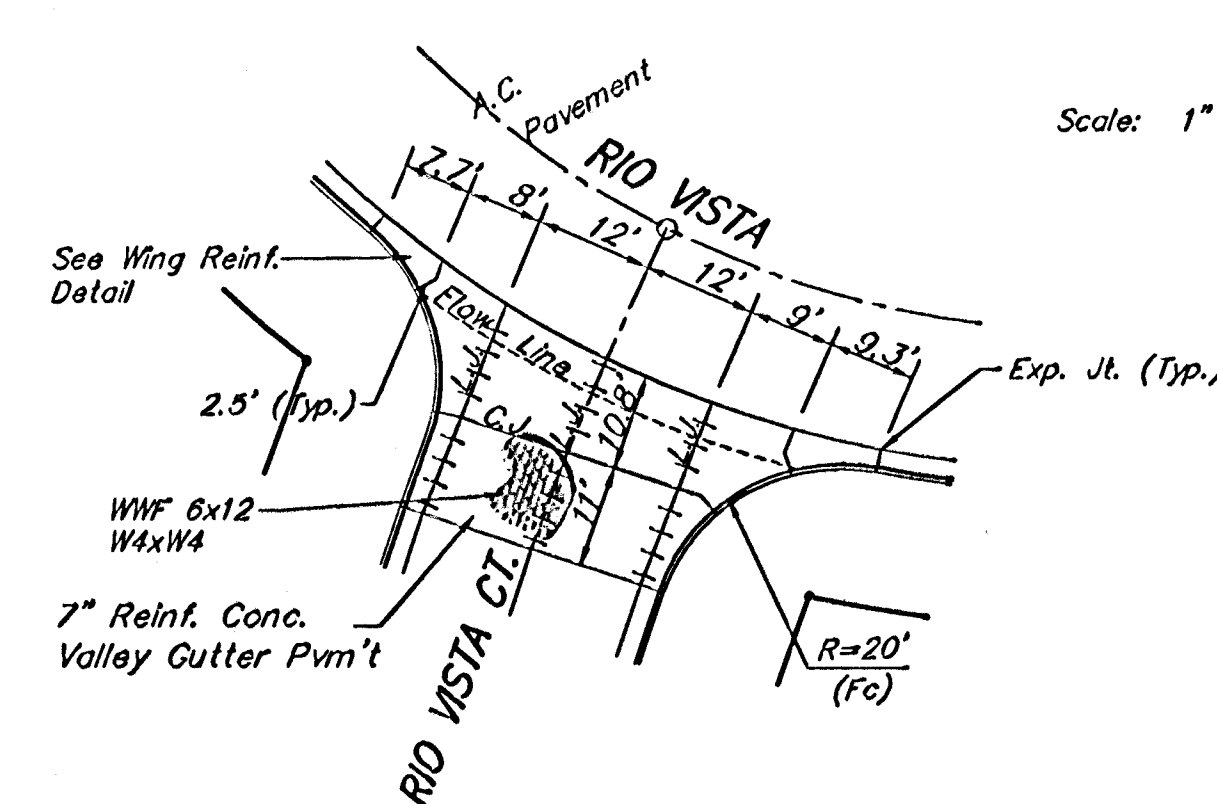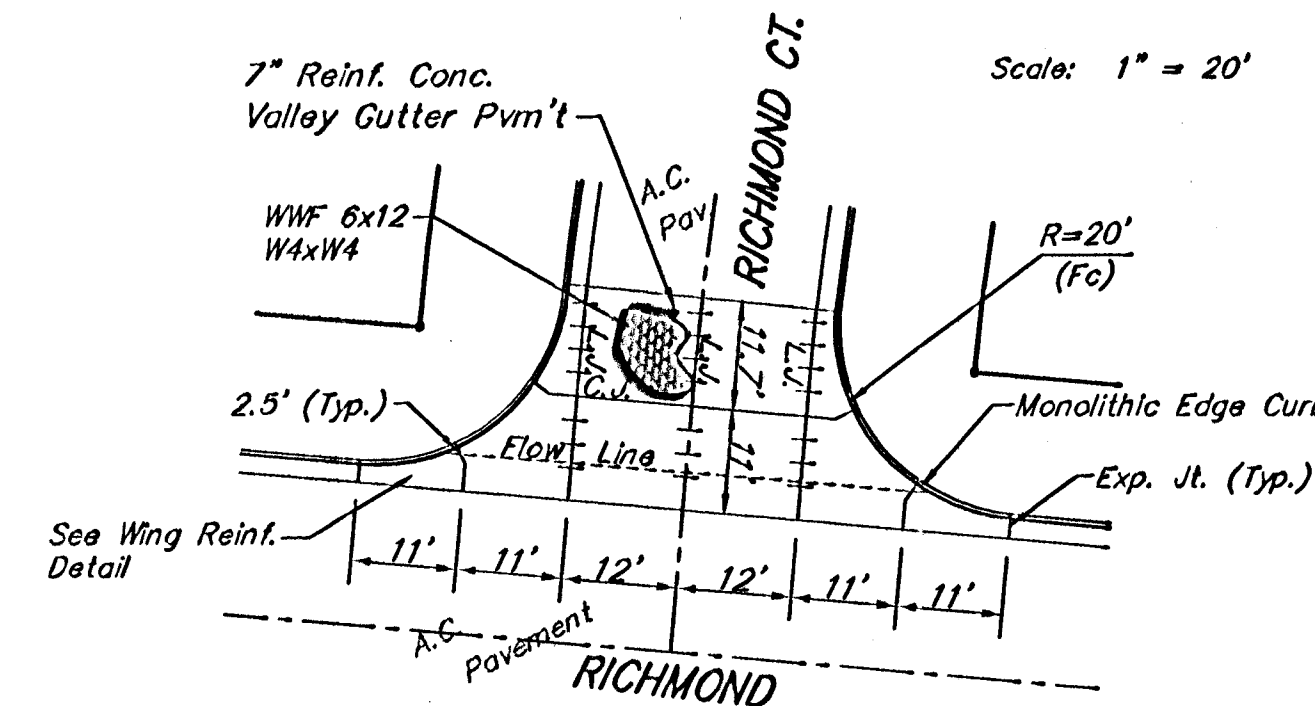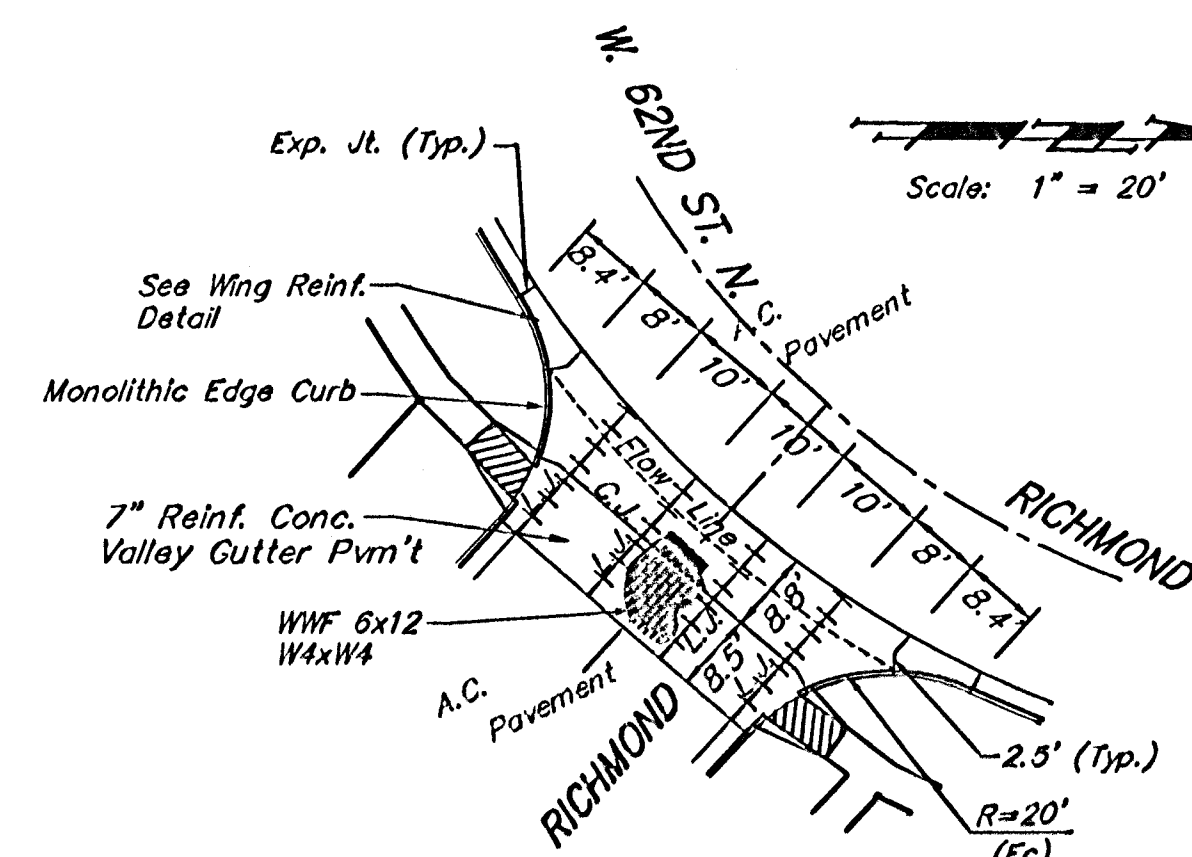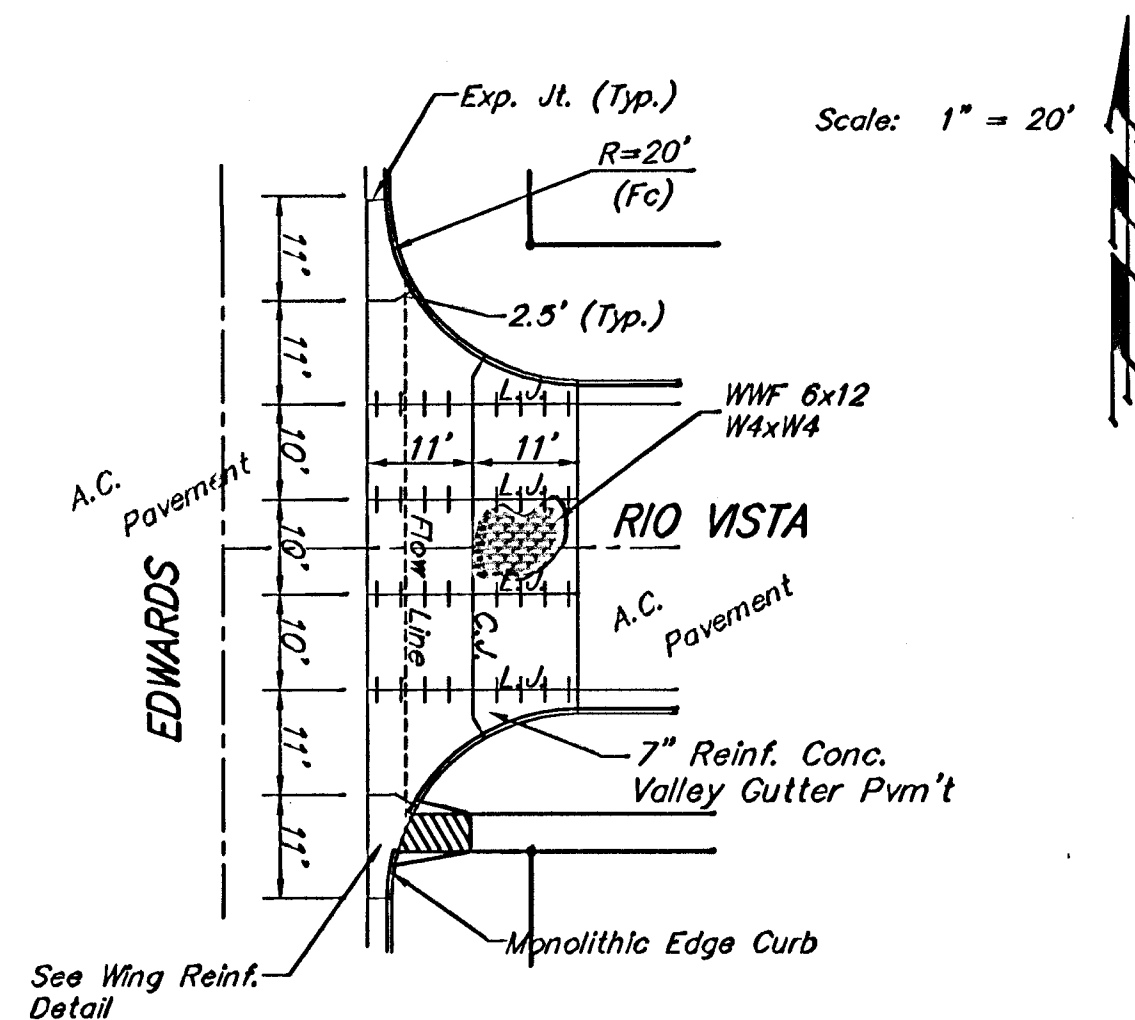

NOTE: 6" X 12" W4XW4 Wire Fabric Reinforcing Shall Be Placed So That The Wires With The 6" Spacing Will Run Parallel With The Longitudinal Joints.

Baughman		Rio Vista Estates 4th	
Baughman Company, P.A. 315 E. 11th St. Wichita, KS 67211 P 316-262-7271 F 316-262-0149		VALLEY GUTTER DETAILS	
PROJECT NUMBER 475-84056	DESIGN STAFF	DRAWN STAFF	
REVISIONS	APPROVED	DATE 08/05	
		SCALE NONE	
		SHEET	
		5 OF 51	
R:\eng\Rio Vista\Wgdetail.dwg		05-03-B204	