



DATE	BY

STATE	PROJECT NO.	YEAR	SHEET NO.	TOTAL SHEETS
KANSAS	472-84071	2005	B8.3	

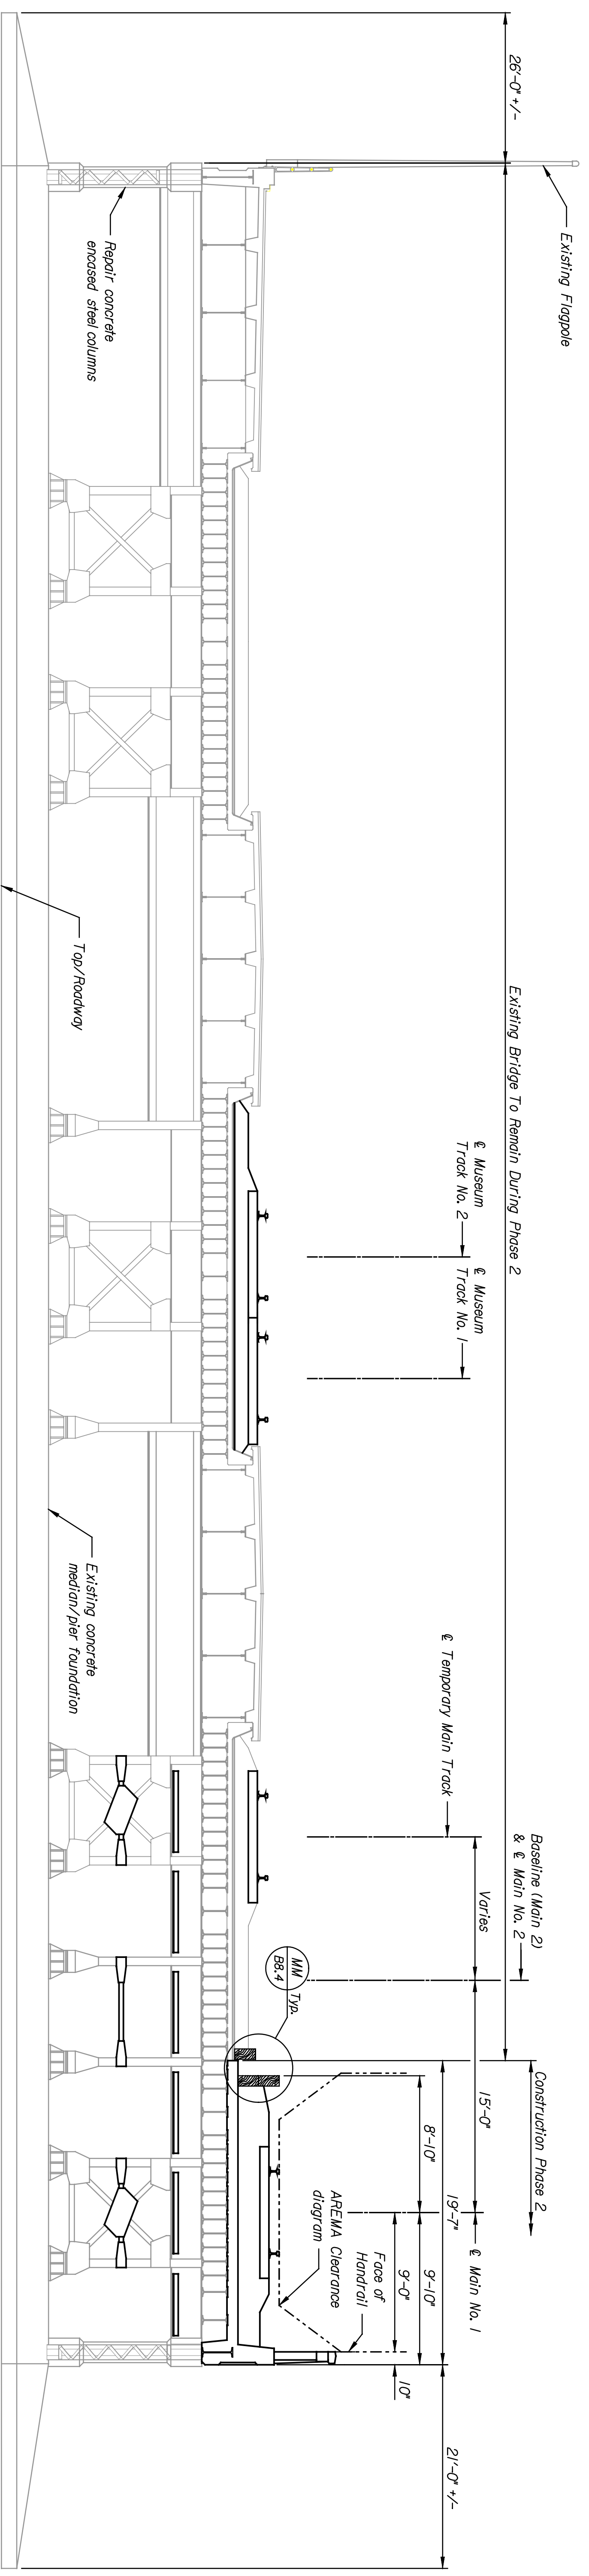

**SECTION A**  
 Not To Scale  
 B8.1  
 Construction Phase 2  
 Note: Pier 4 Shown  
 Pier 3 similar

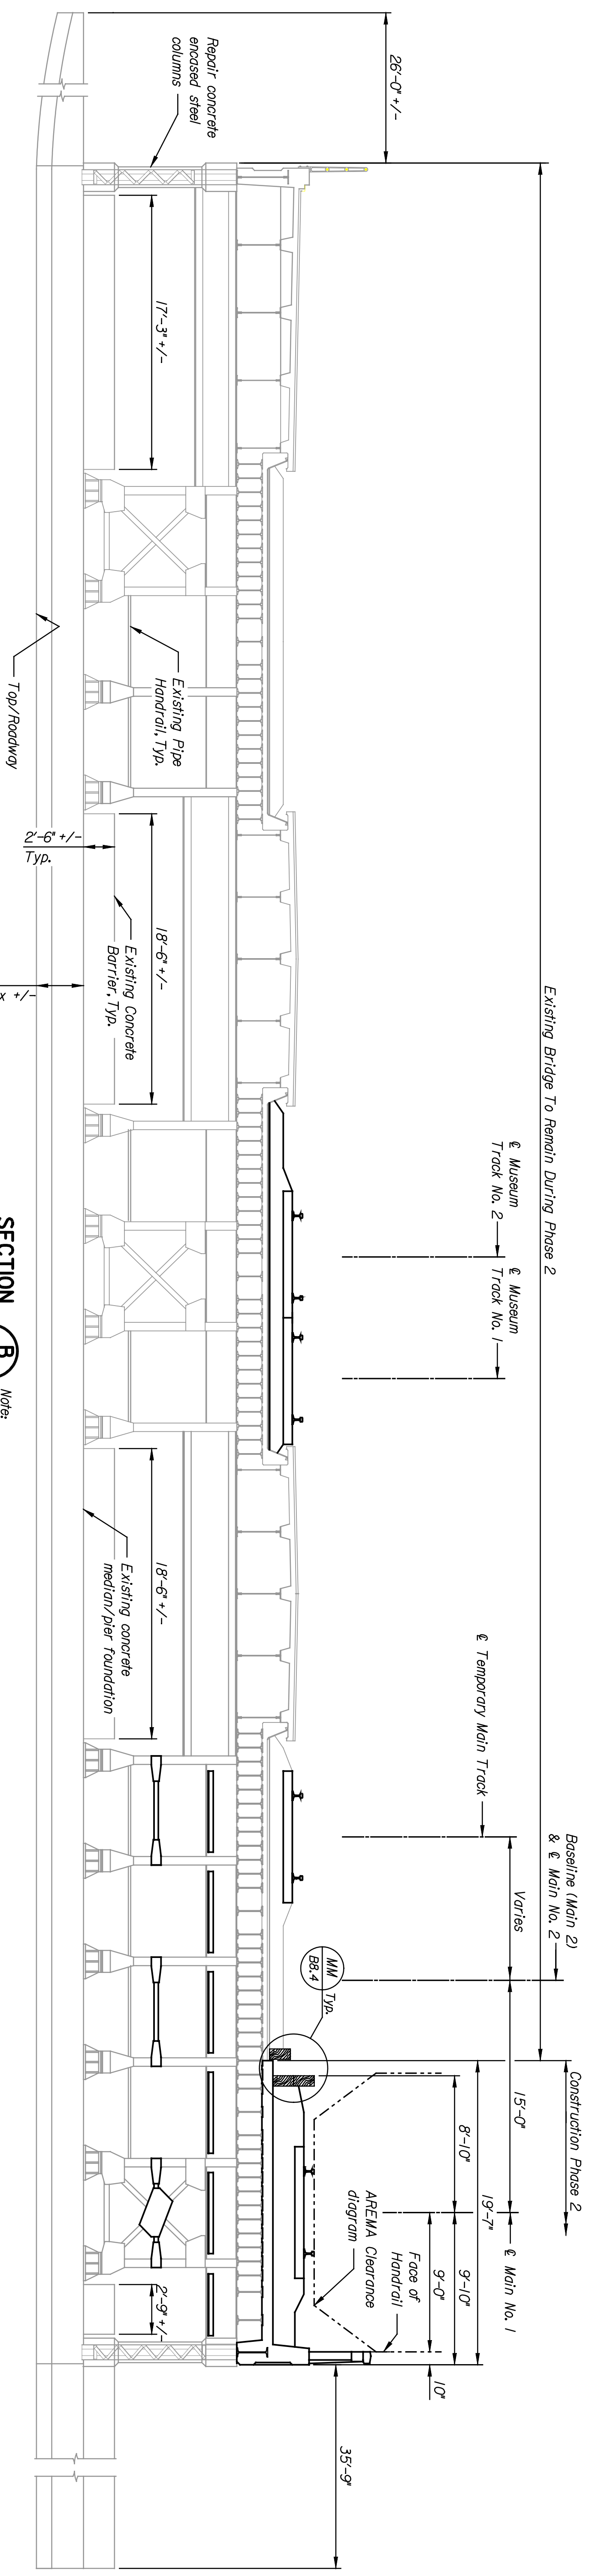

**SECTION B**  
 Not To Scale  
 B8.1  
 Construction Phase 2  
 Note: Pier 5 Shown  
 Pier 2 similar

- NOTES:  
 Field verify all dimensions.  
 Exterior column repairs consist of the following items:  
 1. Remove existing loose and cracked concrete encasement to sound concrete.  
 2. Clean existing structural and reinforcing steel.  
 3. Prepare surrade & apply concrete bonding agent.  
 4. Form & place new encasement around columns to match current dimensions.  
 5. Fasten new encasement to existing concrete with concrete anchors of 12" max. centers with concrete wire mesh attached thereto.

**PNTEB**  
 ARCHITECTS ENGINEERS PLANNERS

This sheet designed by:

SHEET NO. OF		SCALE AS NOTED		APPD.	
DESIGNED	END	DETAILED	DATE	QUANTITIES	DUL
DESIGN	CHK	DATE	BY	TRACED	DUL
CR.	CM	BY	BY	CHK.	DUL

**WICHITA CENTRAL CORRIDOR**  
 DOUGLAS AVENUE  
 TYPICAL SECTIONS - PHASE 2