



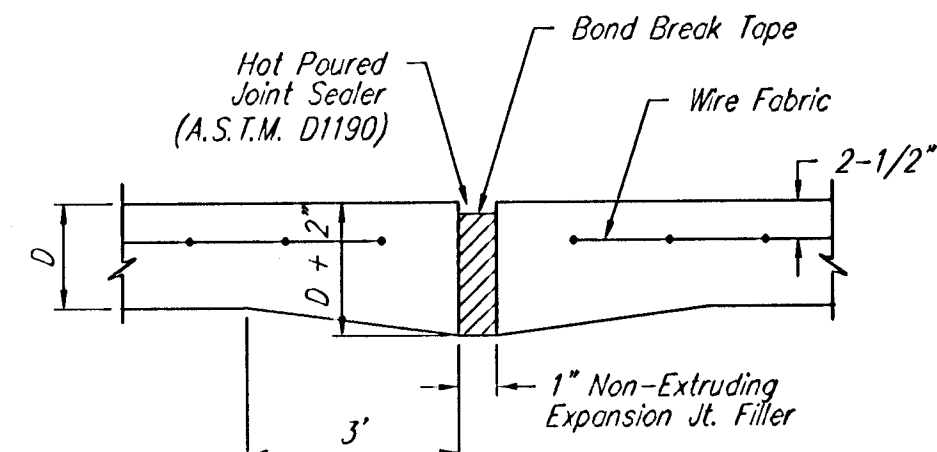


EXPANSION JOINT


NOTE: Extra Thickness to be Subsidiary to Price of Square Yards Pavement

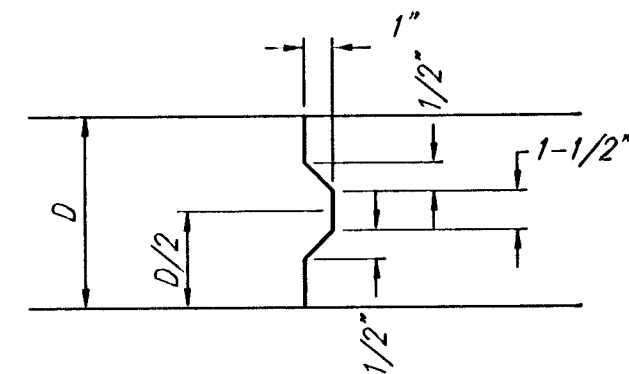


KEYWAY DETAIL

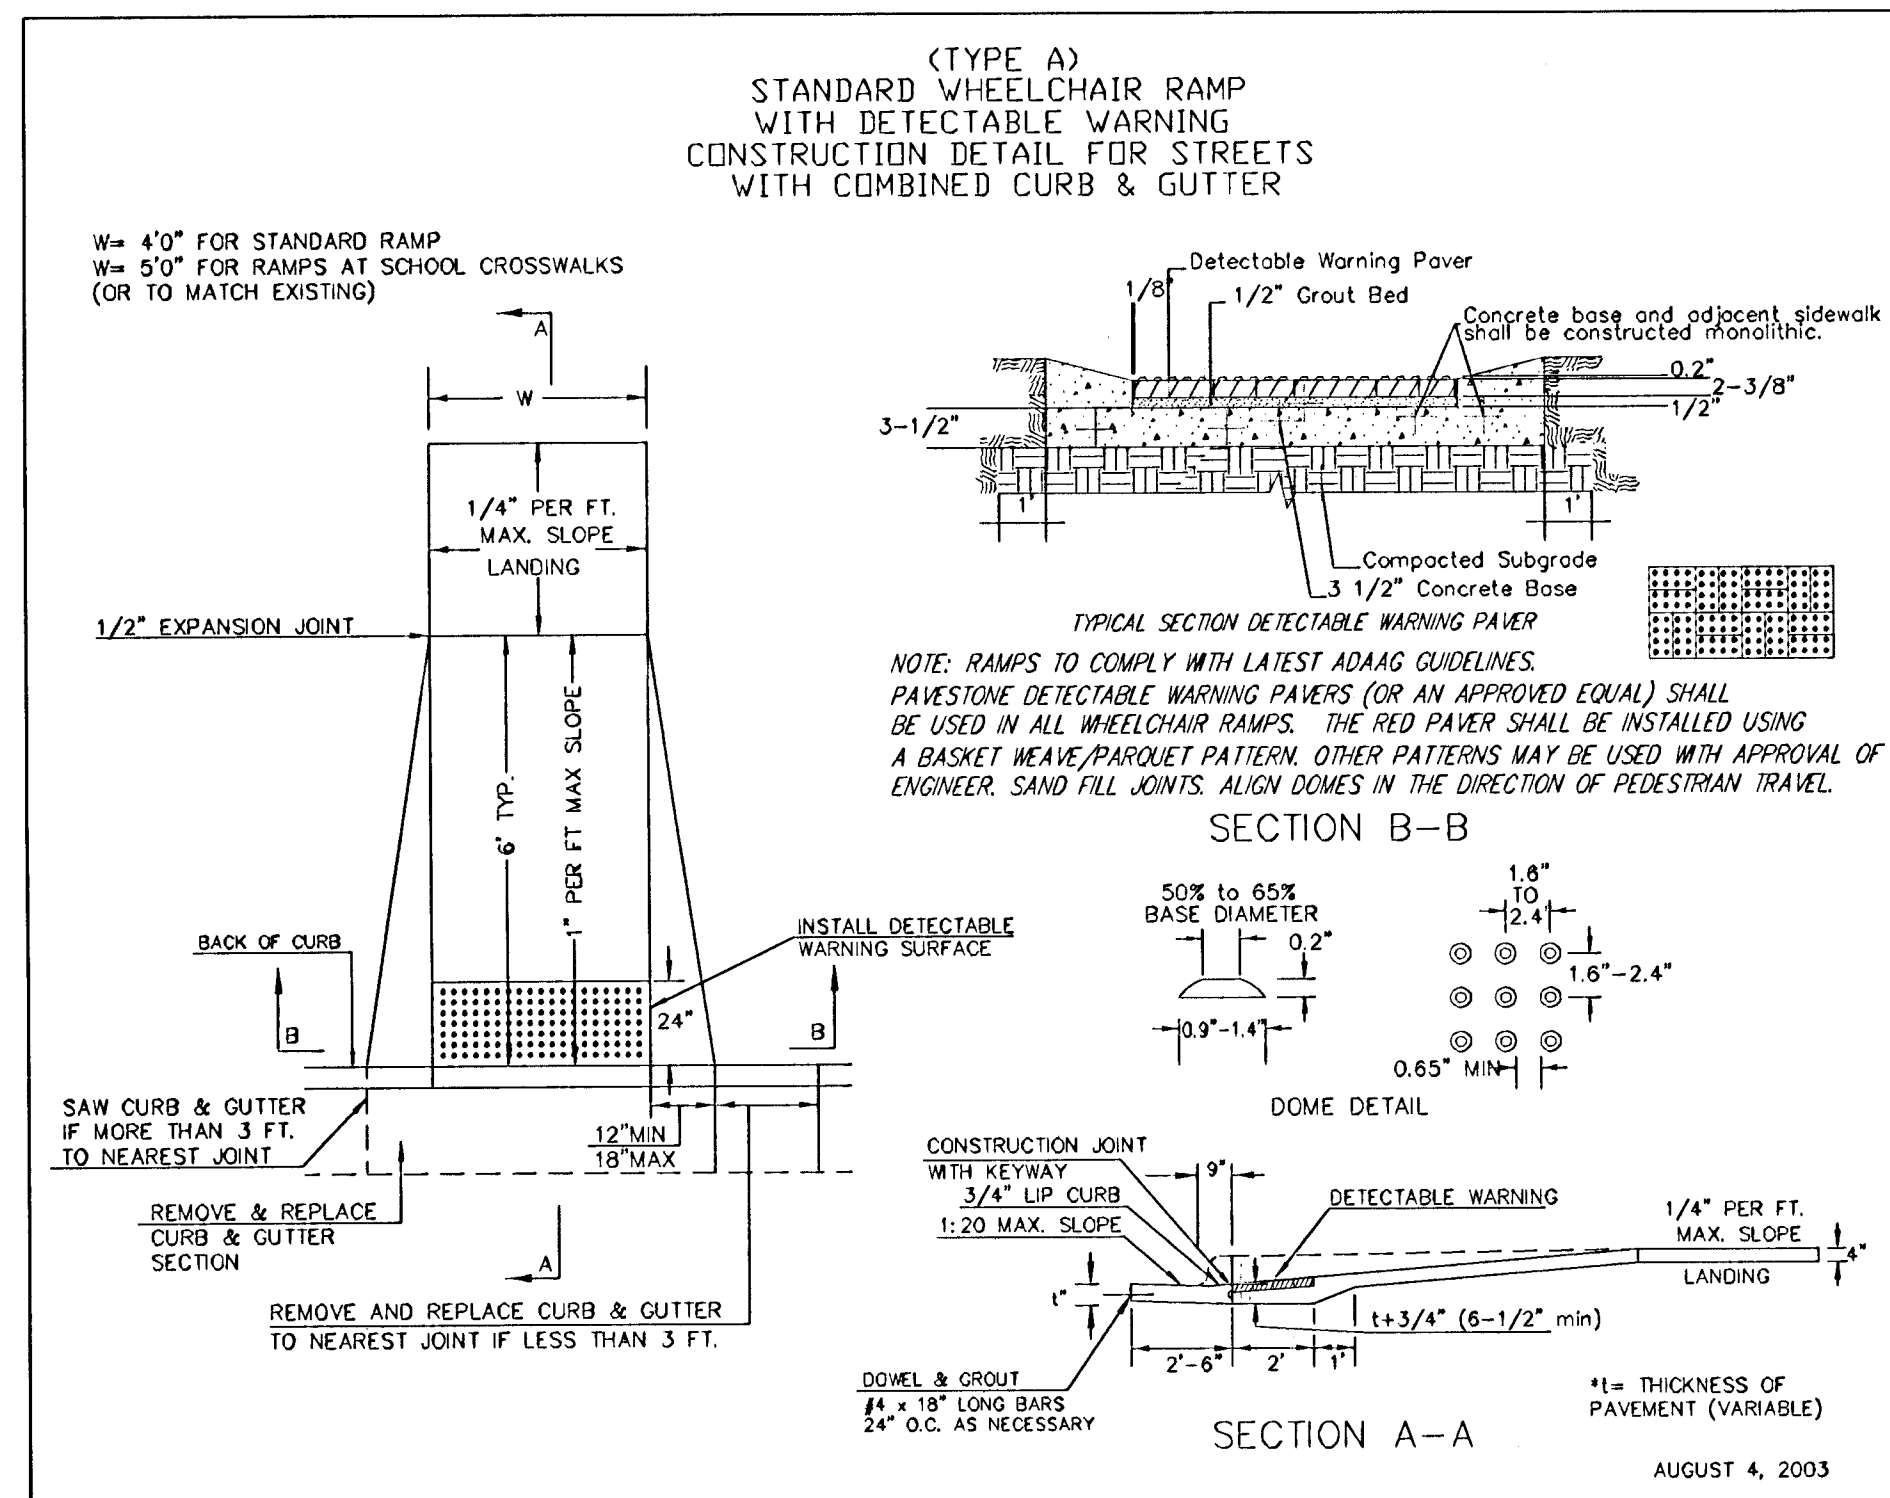


WHEELCHAIR RAMP DETAIL

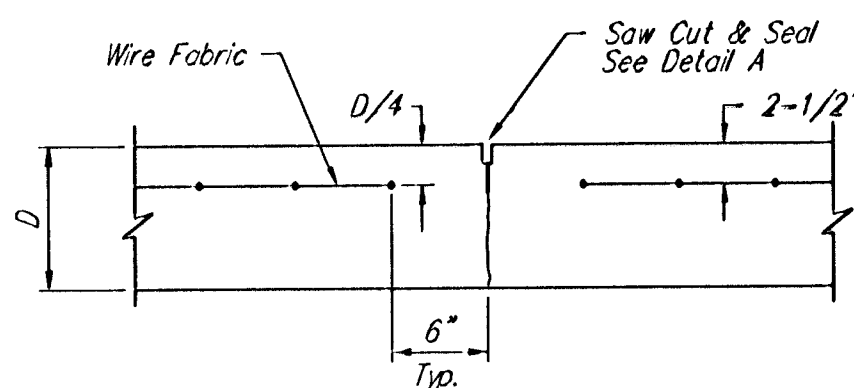


CONTRACTION JOINT DETAIL (C.J.)

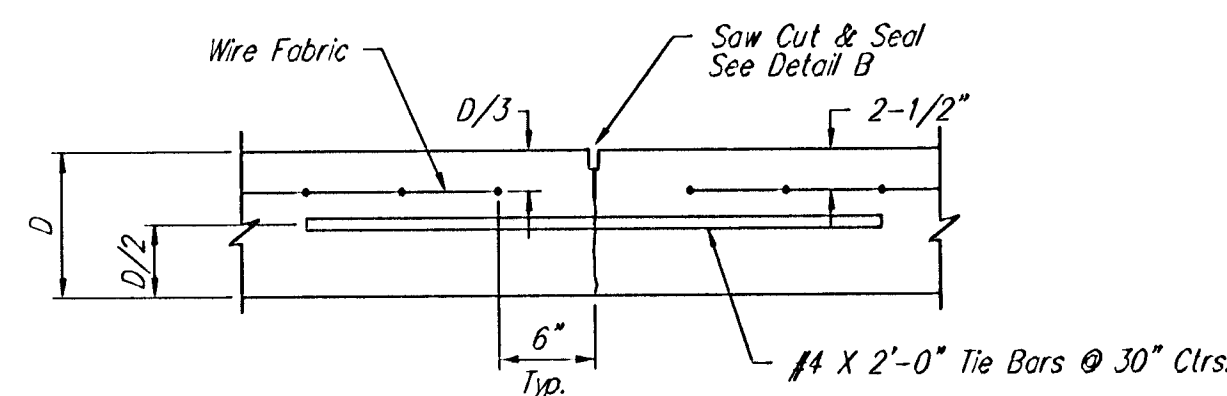


LONGITUDINAL JOINT DETAIL (L.J.)

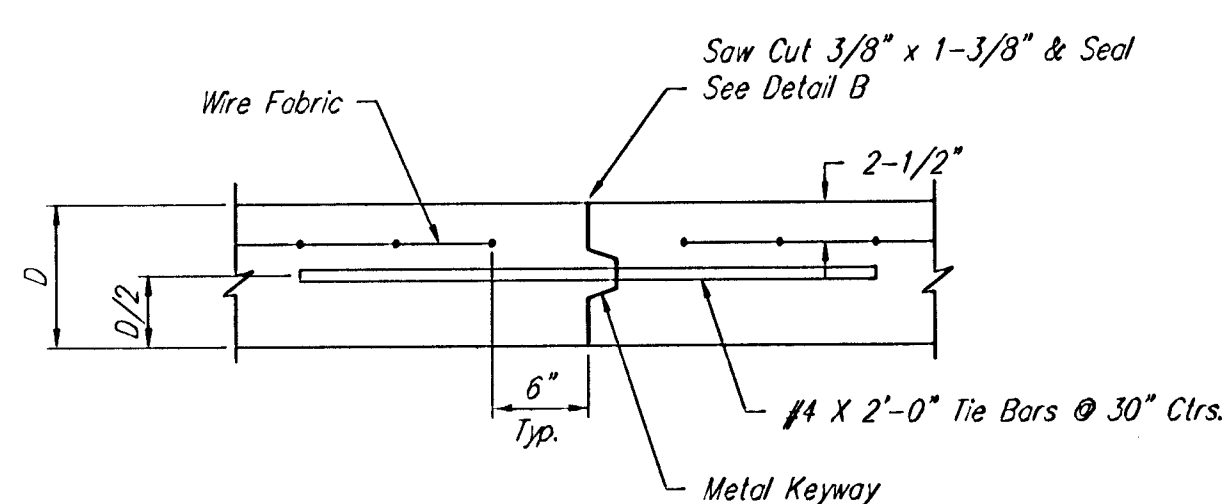


OPTIONAL LONGITUDINAL JOINT DETAIL (L.J.) (CONSTRUCTION JOINT)

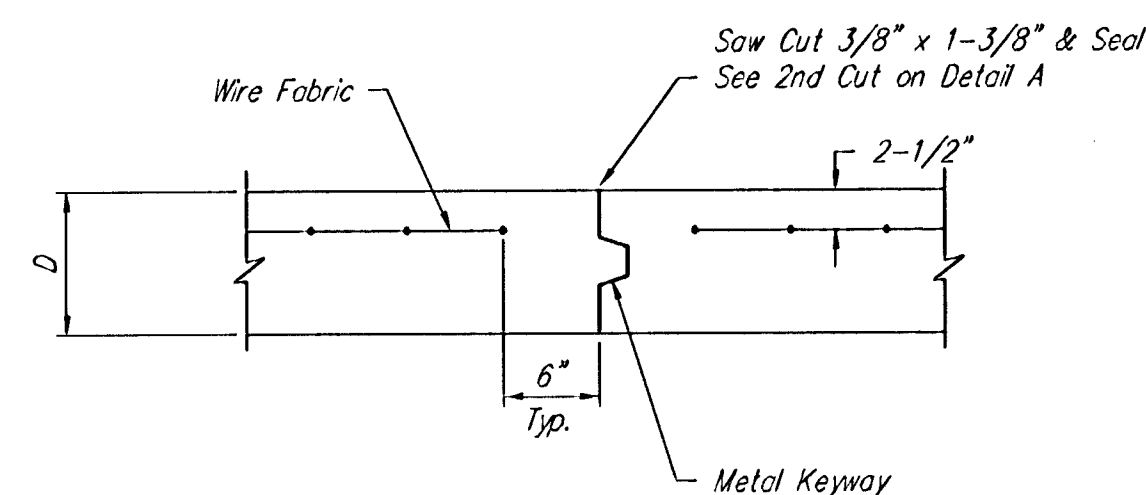


OPTIONAL CONTRACTION JOINT (CONSTRUCTION JOINT)

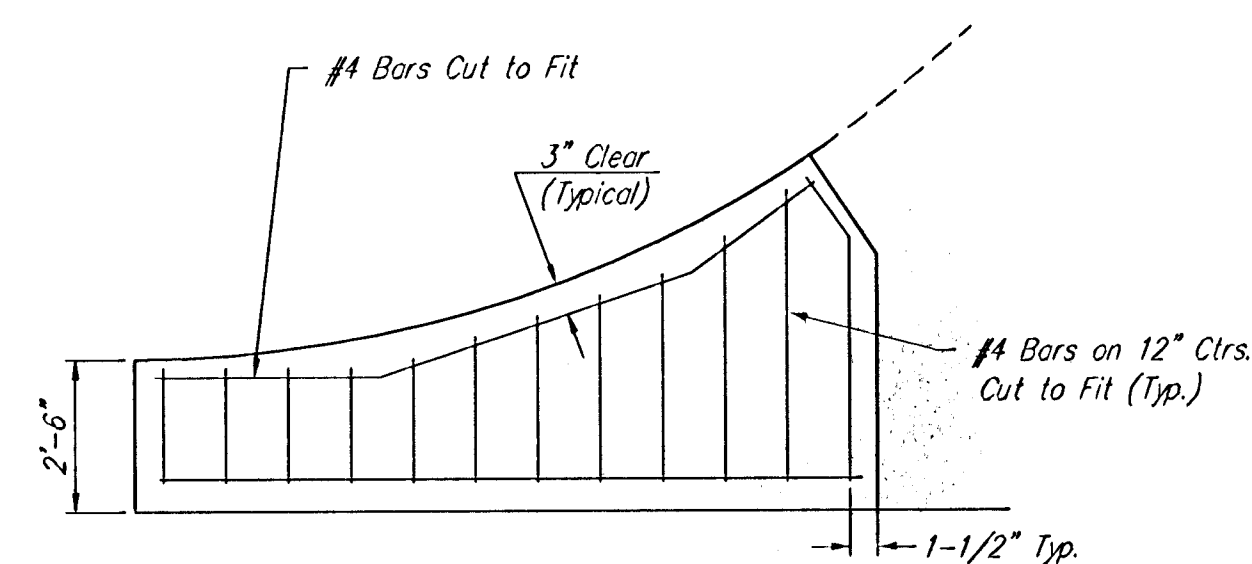



WING REINFORCING DETAIL

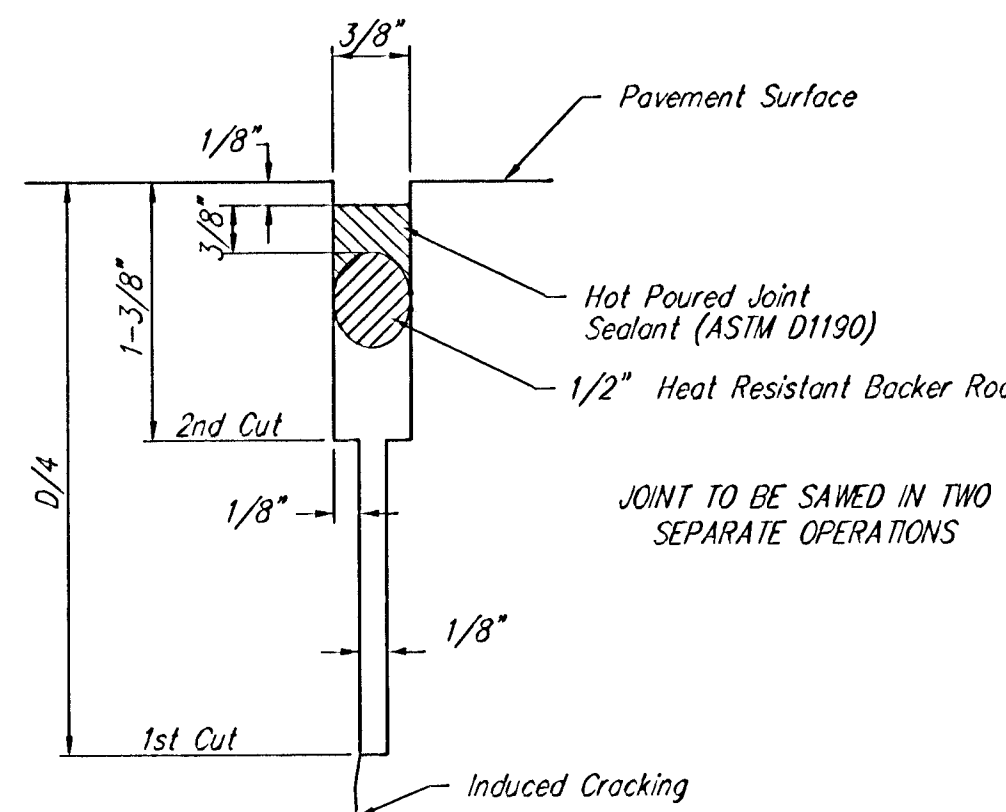

SAW JOINT DETAIL "A"

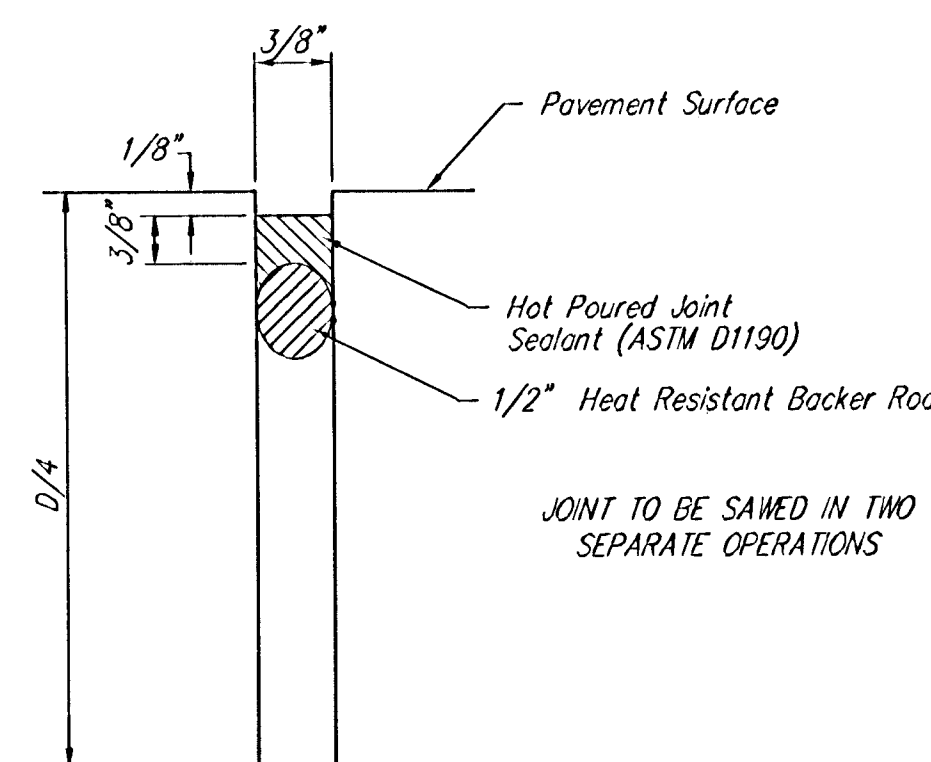

SAW JOINT DETAIL "B"

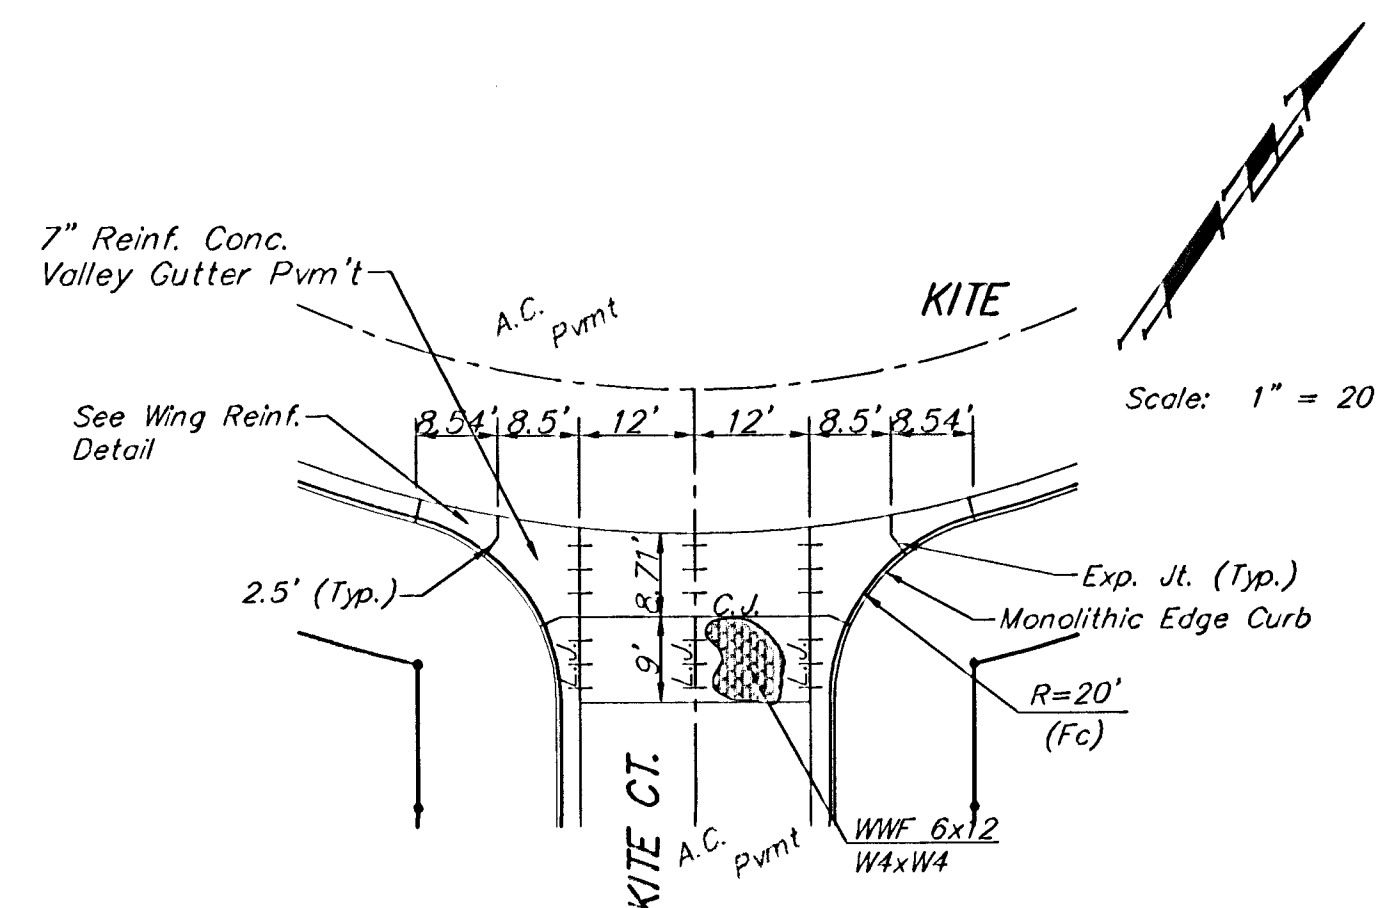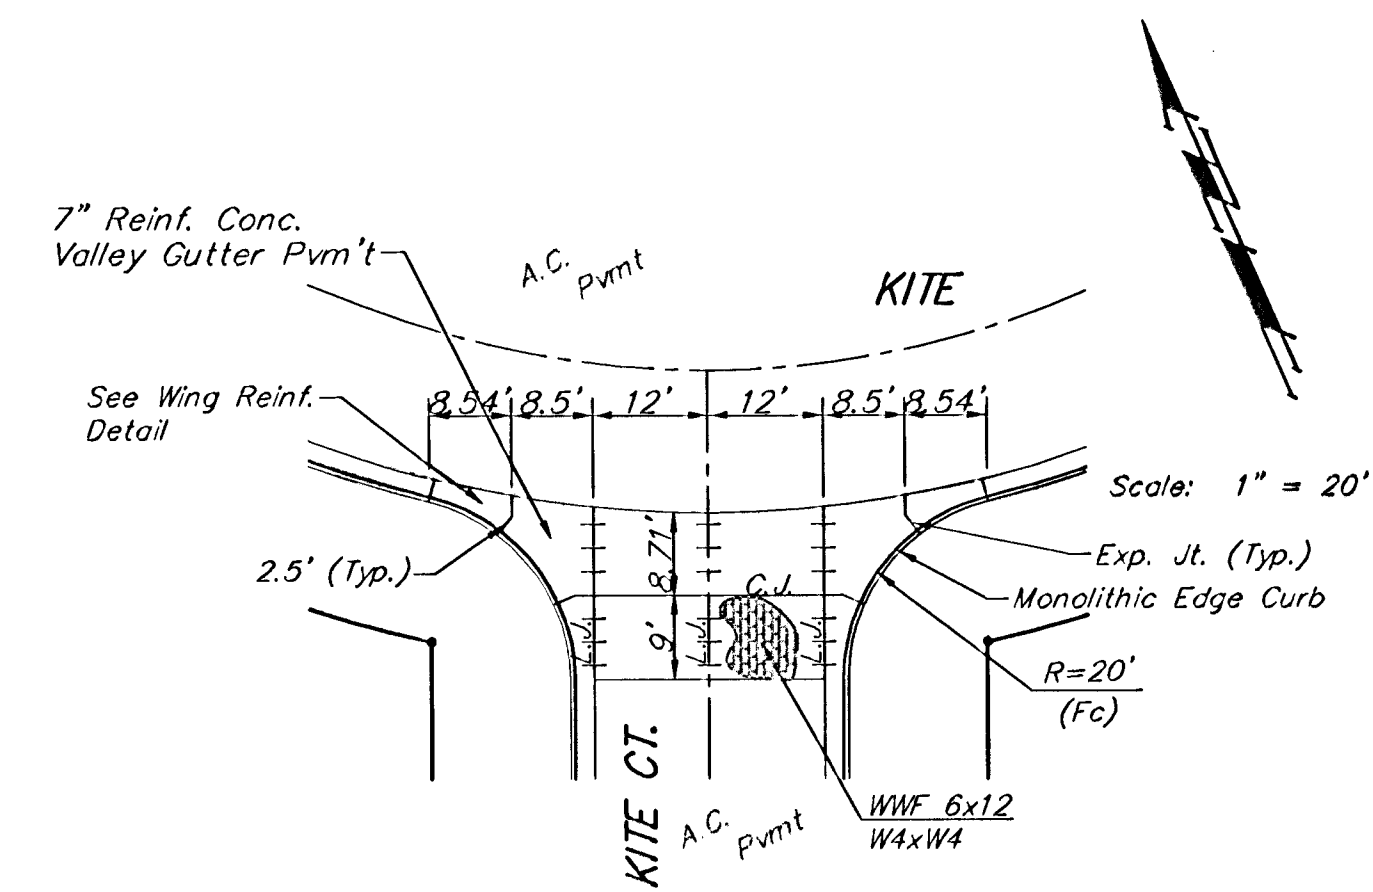

NOTE: 6" X 12" W4XW4 Wire Fabric Reinforcing Shall Be Placed So That The Wires With The 6" Spacing Will Run Parallel With The Longitudinal Joints.

Baughman		VALLEY GUTTER DETAILS	
Baughman Company, P.A. 315 Ella St. Wichita, KS 67211 F 316-262-7271 F 316-262-0149			
ENGINEERING SURVEYING PLANNING LANDSCAPE ARCHITECTURE			
PROJECT NUMBER	472-84264	DESIGN STAFF	DRAWN STAFF
APPROVED		DATE	01/06
REVISIONS		SCALE	NONE
		SHEET	5 OF 44
Falcon Falls 2nd VPI Vgdetail		05-10-E376	