


5744-187CO (cleanout)
Construct Standard Manhole
(removal of an existing cleanout shall be incidental)
Depth unknown / not found

Remove 153 lf of 6" Pipe
Install 153 lf of 8" Pipe

MH 5744-183
Approx depth = 7.2 ft

Estimated 6 Service Reconnections (4")
Estimated 40 lf Silt Fence

SITE 2

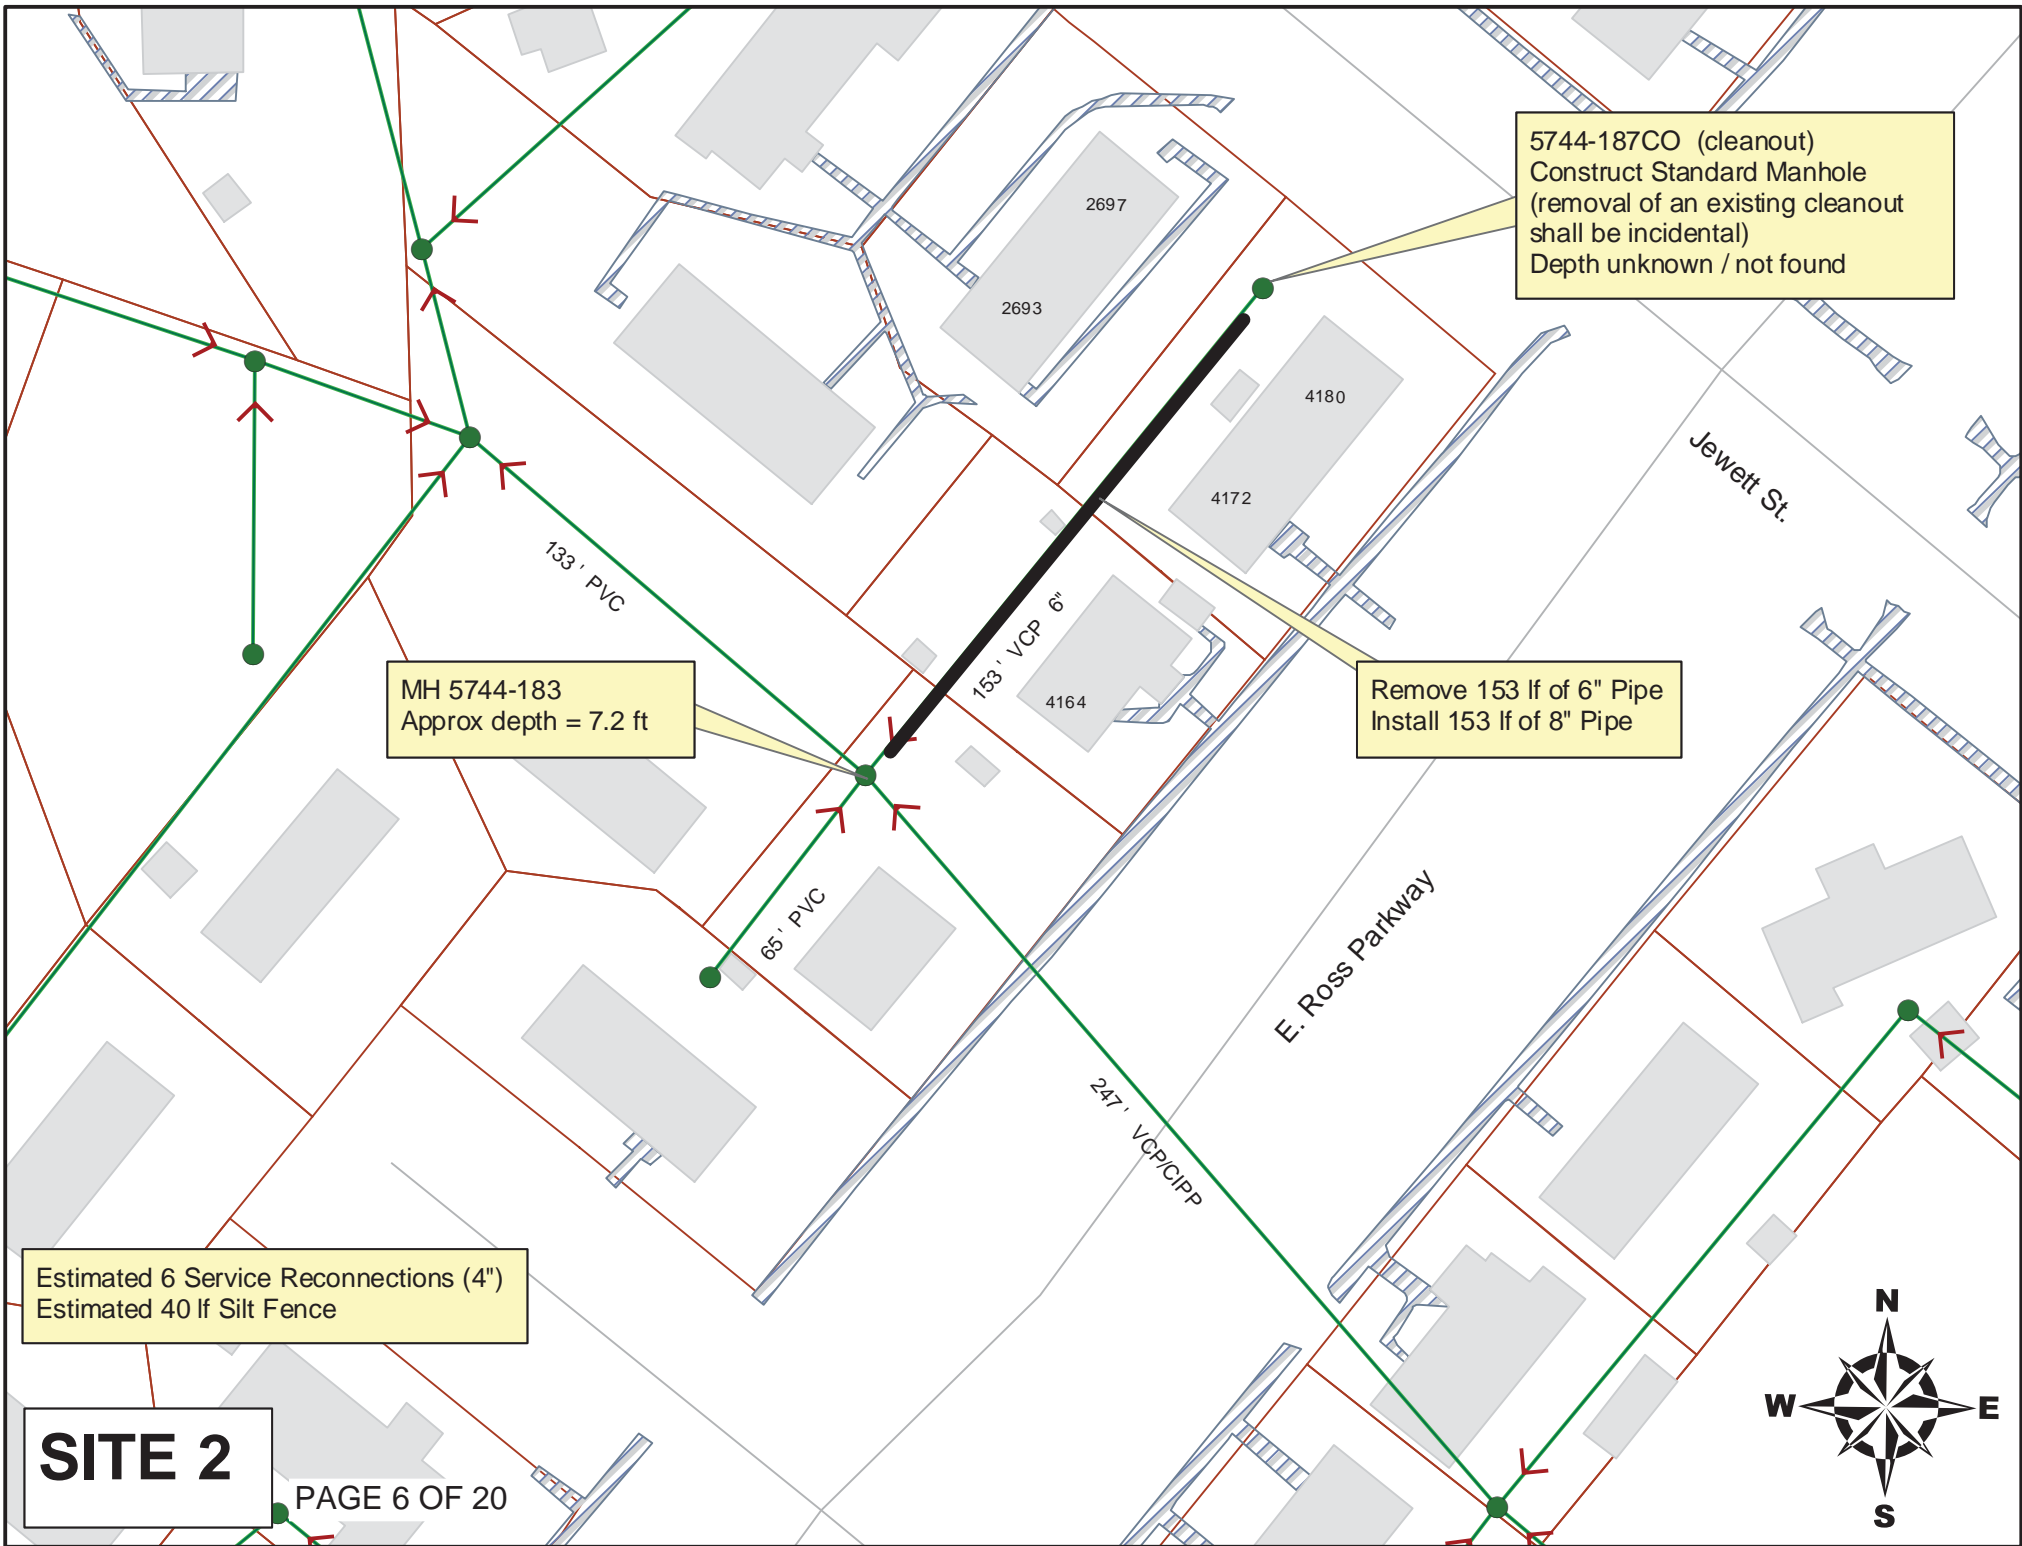





Television Inspection Master Report

6/3/2009
9:49 AM

US Structure: 5744-187CO (cleanout / not found)
DS Structure: 5744-183 4132 E ROSS PKWY

Date Insp: 1/10/2008 Basin: C01A
Dir Televised: Downstream To Upstream

Pipe Information
Project No. : I-078 Dia: 6 Material: VCP Length: 153.0

Obs. #	VTR Counter	Distance	Location	Description	Rating	Obsrvd (gpm)	Est. (gpm)	Ratings		
								Struct	Clean	Remain (gpm)
1		0.0	DS Manhole 5744-183	TV against flow	1					
2		3.4	Upper Right / offset	Broken Pipe	3	0.010	60	0	0.010	
3		7.2	Joint	Offset	2	0.000	0	0	0.000	
4		10.0	Upper Right	Broken Pipe	1	0.004	30	0	0.004	
5		10.6	Lower Left	Grease	1	0.000	0	0	0.000	
6		17.5	Lower Left	Grease	1	0.000	0	0	0.000	
7		21.6	Lower Left	Grease	2	0.000	0	0	0.000	
8		31.9	Lower Left	Grease	1	0.000	0	0	0.000	
9		36.1	Upper Left	Grease	1	0.000	0	0	0.000	
10		50.8	Joint	Gapped Joint & Roots	2	0.000	0	0	0.000	
11		63.8	Upper Right	Crack-Radial	1	0.001	1	0	0.001	
12		67.1	4164 E ROSS PKY	South 4" Clay Wye Service	1	0.000	0	0	0.000	
13		72.8	Joint	Gapped Joint	2	0.000	0	0	0.000	
14		80.9	Joint	Offset Joint & Roots	3	0.010	20	0	0.010	
15		85.6	Joint	Roots	1	0.002	1	1	0.002	
16		90.6	Joint	Roots	1	0.002	1	1	0.002	
17		95.7	Joint	Roots	1	0.002	1	1	0.002	
18		98.2	Lower Left	Crack-Radial & Roots	2	0.002	2	0	0.002	
19		113.6	4164 E ROSS PKY	4" Clay Wye Service	1	0.000	0	0	0.000	
20		113.6	North	4" Clay Wye Service	1	0.000	0	0	0.000	
21		122.8	Upper Left	Grease	1	0.000	0	0	0.000	
22		129.4	Joint	Roots	1	0.002	1	1	0.002	
23		132.2	Joint	Roots	1	0.002	1	1	0.002	
24		137.1	Joint	Roots	1	0.002	1	1	0.002	
25		142.3	Joint	Roots	1	0.002	1	1	0.002	
26		145.0	Joint	Roots	2	0.004	2	4	0.004	
27		150.5	2693 S JEWETT ST	N. 4" Clay Wye Service	1	0.000	0	0	0.000	
28		150.9	4172 E ROSS PKY	S. 4" Clay Wye Service	1	0.000	0	0	0.000	
29		151.3	Upper Right	Broken Pipe	3	0.010	60	0	0.010	
30		152.4	US CLEANOUT	4172 E ROOS PKY						