


Remove 265 lf of 6" Pipe
Install 265 lf of 8" Pipe

Estimated 12 Service Reconnections (4")
Estimated 40 lf Silt Fence

MH 5744-153
Reconstruct Outside Drop (West)
Approx depth = 8.5 ft

5744-157CO (cleanout)
Construct Standard Manhole
(removal of an existing cleanout shall be incidental)
Depth unknown / not found
(shed east of cleanout)

SITE 3

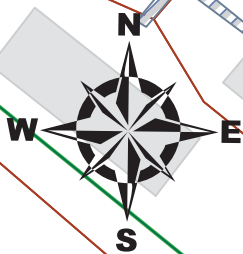



E ROSS PKWY

S JEWETT ST





Television Inspection Master Report

6/3/2009
9:48 AM

US Structure: 5744-157CO (cleanout) 4256 E ROSS PKWY Date Insp: 9/30/2008 Basin: C01A
 DS Structure: 5744-153 Dir Televised: Down->Up

Pipe Information

Shape: Round Length Status: VCP
 Dia/Ht: 6 Material: VCP
 Length: 265.0 Slope: 0.580

Project No. : I-077
 Index:
 Surface:

Obs. #	VTR	Counter	Distance	Location	Description	Rating	Obsrvd (gpm)	Est. (gpm)	Ratings			
									Struct	Clean	Remain (gpm)	
1			0.0	DS Manhole	tv against the flow	1	0.000	0.000	0	0	0.000	
4256 E ROSS PKY												
2			6.0	Joint	Roots	1	0.002	0.002	1	1	0.002	
3			8.6	Joint	Roots	2	0.004	0.004	2	4	0.004	
4			10.9	Upper Right	Grease	1	0.000	0.000	0	0	0.000	
5			13.6	Joint	Roots	2	0.004	0.004	2	4	0.004	
6			16.2	Joint	Roots	1	0.002	0.002	1	1	0.002	
7			17.2	Upper Right	Grease	1	0.000	0.000	0	0	0.000	
8			18.9	Joint	Roots	2	0.004	0.004	2	4	0.004	
9			21.3	Joint	Roots	1	0.002	0.002	1	1	0.002	
10			23.8	Joint	Roots	1	0.002	0.002	1	1	0.002	
11			28.3	Joint	Roots	2	0.004	0.004	2	4	0.004	
12			33.8	Joint	Roots	1	0.002	0.002	1	1	0.002	
13			36.5	Joint	Roots	2	0.004	0.004	2	4	0.004	
14			43.0	South	Wye Service	2	0.000	0.000	0	0	0.000	
4248 E ROSS PKY												
4" Clay Wye Connection												
15			43.5	Joint	Roots	1	0.002	0.002	1	1	0.002	
16			48.7	Joint	Roots	1	0.002	0.002	1	1	0.002	
17			53.5	Joint	Roots	1	0.002	0.002	1	1	0.002	
18			56.1	Joint	Roots	1	0.002	0.002	1	1	0.002	
19			73.5	South	Wye Service	1	0.000	0.000	0	0	0.000	
4240 E ROSS PKY												
4" Clay Wye Connection												
20			73.9	Joint	Roots	1	0.002	0.002	1	1	0.002	
21			75.9	Joint	Roots	1	0.002	0.002	1	1	0.002	
22			77.6	Joint	Roots	1	0.002	0.002	1	1	0.002	
23			79.2	Lower Right	Crack-Horizontal	1	0.001	0.001	1	0	0.001	
24			82.3	Upper Left	Crack-Horizontal	1	0.001	0.001	1	0	0.001	
25			82.3	Upper Left	Grease	1	0.000	0.000	0	0	0.000	
26			84.2	Invert	Broken Pipe	1	0.004	0.004	30	0	0.004	
27			84.2	Joint	Roots	2	0.004	0.004	2	4	0.004	
28			85.4	Lower Left	Grease	1	0.000	0.000	0	0	0.000	
29			89.6	Joint	Roots	3	0.008	0.008	5	8	0.008	



Television Inspection Master Report

6/3/2009
9:48 AM

US Structure: 5744-157CO (cleanout)
DS Structure: 5744-153

4256 E ROSS PKWY

Date Insp: 9/30/2008
Dir Televised: Down->Up

Basin: C01A

30	93.9	Joint	Roots	1	0.002	1	1	0.002
31	100.4	Joint	Roots	1	0.002	1	1	0.002
32	102.8	Joint	Roots	1	0.002	1	1	0.002
33	104.9	Joint	Roots	1	0.002	1	1	0.002
34	106.9	Joint	Roots	1	0.002	1	1	0.002
35	118.7	South	Break-In Conn	1	0.001	0	0	0.001
4232 E ROSS PKY			4" Predco Saddle					
36	118.7	North	Wye Service	2	0.000	0	0	0.000
2682 S JEWETT			4" Clay Wye Connection					
37	133.2	Joint	Roots	1	0.002	1	1	0.002
38	133.8	Lower Left	Crack-Radial	1	0.001	1	0	0.001
39	137.3	Lower Right	Broken Pipe	1	0.004	30	0	0.004
40	149.7		Break-In Conn	1	0.001	0	0	0.001
4224 E ROSS PKY			4" Predco Saddle					
41	149.6	North	Wye Service	1	0.000	0	0	0.000
2686 S JEWETT			4" Clay Wye Connection					
42	164.7	Joint	Roots	1	0.002	1	1	0.002
43	166.8	Upper Left	Crack-Horizontal	1	0.001	1	0	0.001
44	166.8	Joint	Roots	1	0.002	1	1	0.002
45	167.3	Lower Right	Broken Pipe	1	0.004	30	0	0.004
46	168.6	Joint	Roots	1	0.002	1	1	0.002
47	169.7	Lower Right	Crack-Horizontal	1	0.001	1	0	0.001
48	171.5	Lower Right	Crack-Horizontal	2	0.002	2	0	0.002
49	175.4	Lower Right	Crack-Horizontal	1	0.001	1	0	0.001
50	176.5	South	Break-In Conn	2	0.002	0	0	0.002
4216 E ROSS PKY			4" Predco Saddle					
51	176.4	North	Wye Service	1	0.000	0	0	0.000
2690 S JEWETT			4" Clay Wye Connection					
52	185.5	Joint	Roots	1	0.002	1	1	0.002
53	216.6	Lower Right	Broken Pipe	1	0.004	30	0	0.004
54	218.9	Lower Right	Crack-Horizontal	1	0.001	1	0	0.001
55	224.9	South	Wye Service	4	0.000	60	0	0.000
4208 E ROSS PKY			4" Clay Wye Connection					
56	225.0	North	Wye Service	1	0.000	0	0	0.000
2694 S JEWETT			4" Clay Wye Connection					
57	233.5	Lower Left	Broken Pipe	1	0.004	30	0	0.004
58	262.7	South	Wye Service	1	0.000	0	0	0.000
4200 E ROSS PKY			4" Clay Wye Connection					
59	262.7	North	Wye Service	2	0.000	0	0	0.000
2698 S JEWETT			4" Clay Wye Connection					
60	264.3	US Cleanout	Comment: ROOTS	1	0.000	0	0	0.000
4200 E ROSS PKY								