



PROJECT NO.	SHEET NO.	TOTAL SHEETS
472-76-245-82324-000-000-001	11	20

• UNDERDRAIN AGGREGATE
PERCENT OF AGGREGATE RETAINED

1"	0
3/4"	0-10
3/8"	45-80
#4	90-100
#8	95-100

ROCK QUALITY SHALL CONFORM TO THE REQUIREMENTS SPECIFIED BY THE KDOT 1990 EDITION STANDARD SPECIFICATION SUBSECTION 1102 FOR DURABILITY CLASS I.



PAVEMENT UNDERDRAIN LOCATIONS		
STREET	STATION	SIDE
WILD ROSE	18+67.14	RT.
WILD ROSE	18+85	LT.
WILD ROSE	22+92	LT.
WILD ROSE	23+10.62	RT.

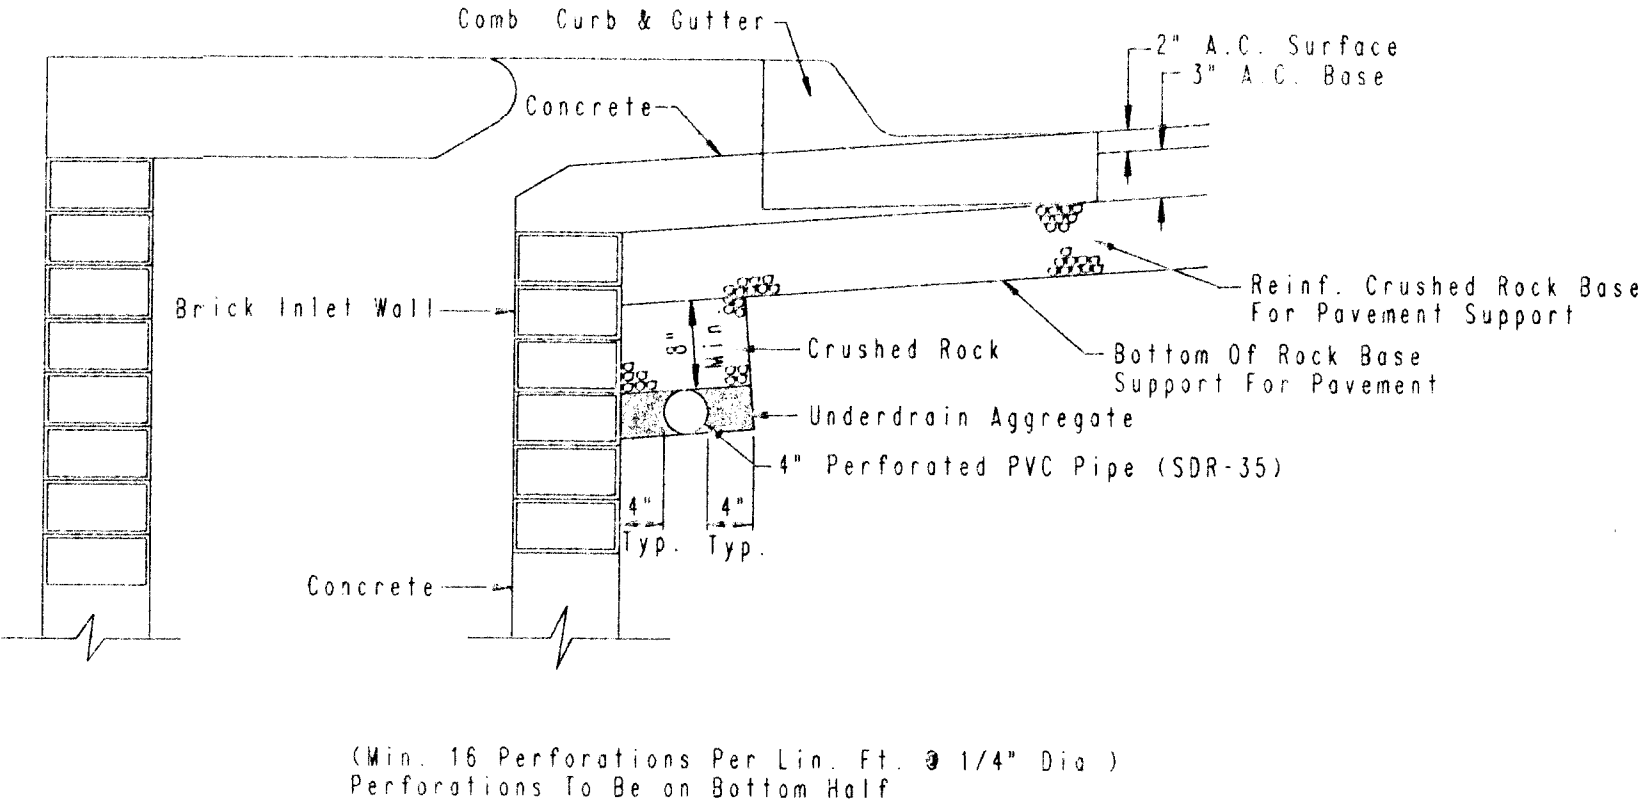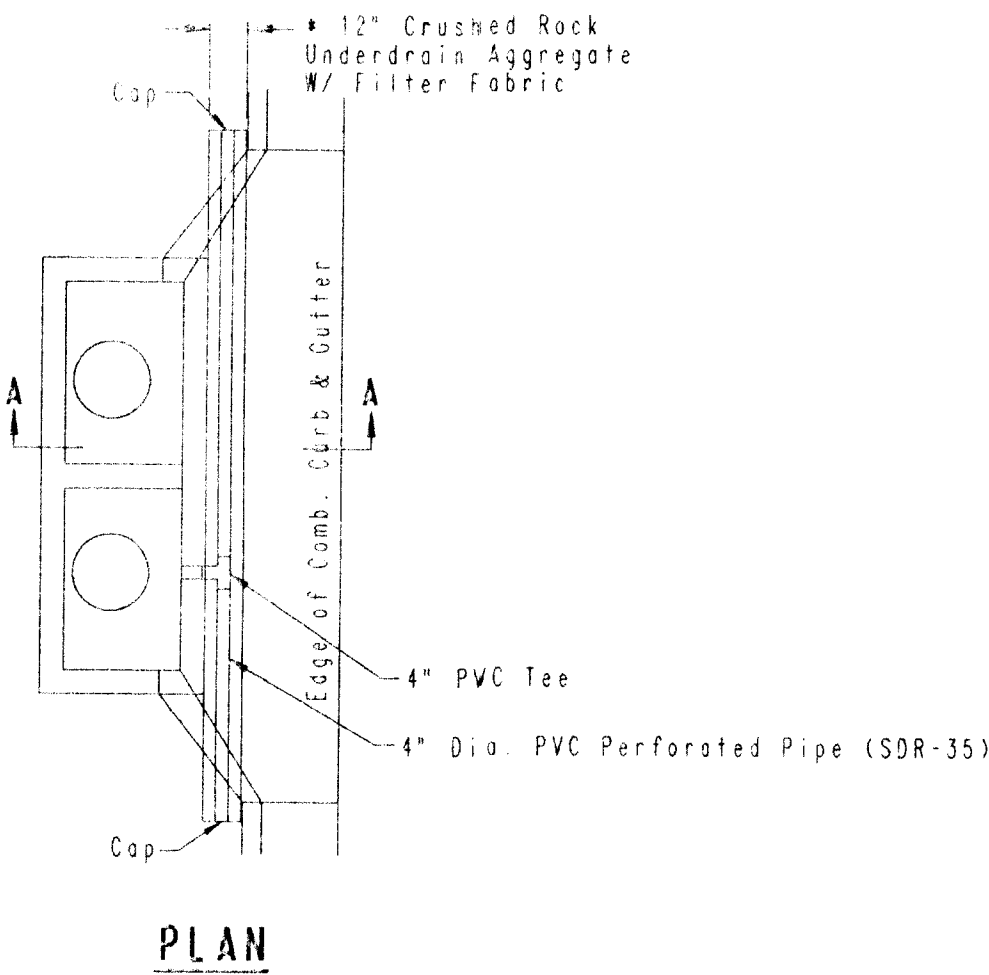


SECTION A-A

PAVEMENT UNDERDRAIN DETAIL
For Alternate 1 Only

NOTE: PLACE 4" PVC PERFORATED PIPE AT ALL DRAINAGE SUMP LOCATIONS.
COST OF UNDERDRAIN SYSTEM TO BE INCIDENTAL TO THE REINFORCED CRUSHED ROCK SUBGRADE.
INLET TYPE MAY VARY FROM THAT SHOWN.
PAVEMENT CONTRACTOR WILL BE REQUIRED TO INSTALL SDR 35, 4" PERFORATED DRAIN PIPE AND TEE AS INDICATED IN THE DETAILS ABOVE. A PIPE STUB HAS BEEN INSTALLED THROUGH WALLS OF CURB INLETS BY OTHERS IN A MANNER ALLOWING CONNECTION OF ADDITIONAL DRAIN PIPE AND TEE AS REQUIRED BY DETAILS ABOVE.

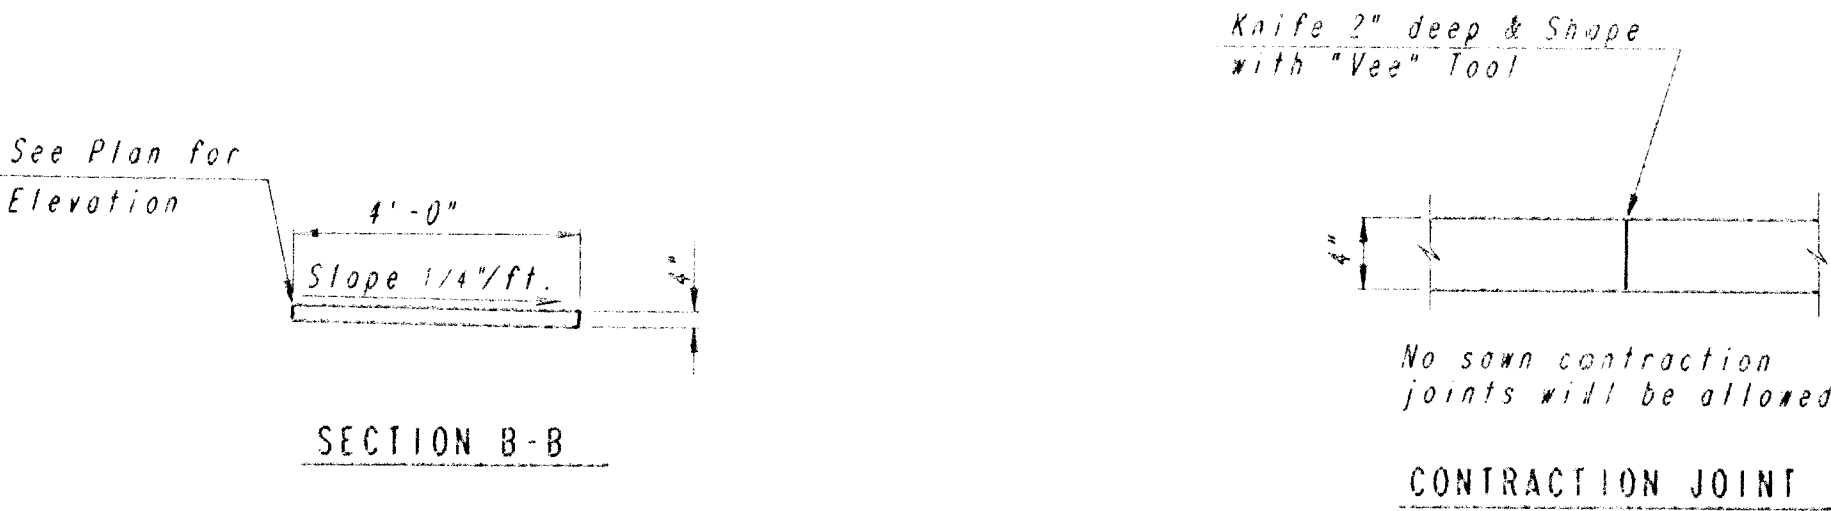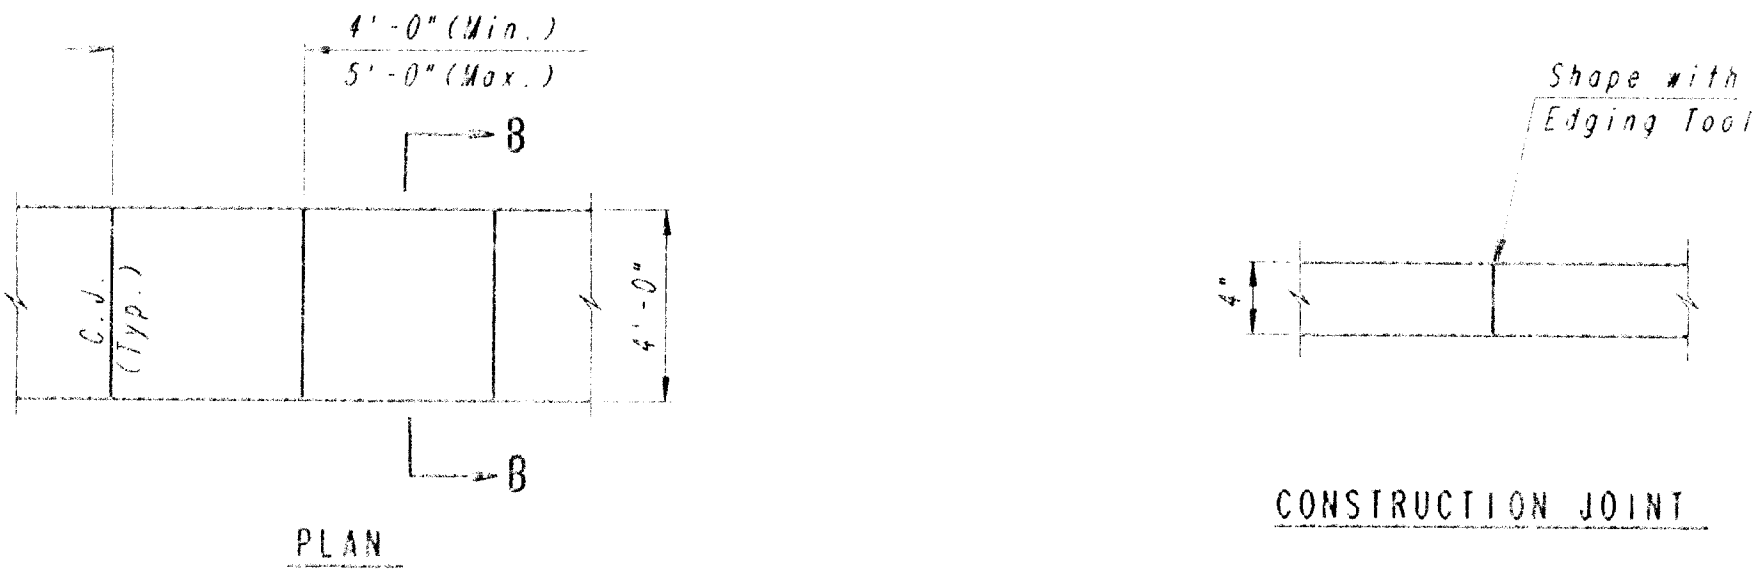

4" WALK DETAILS

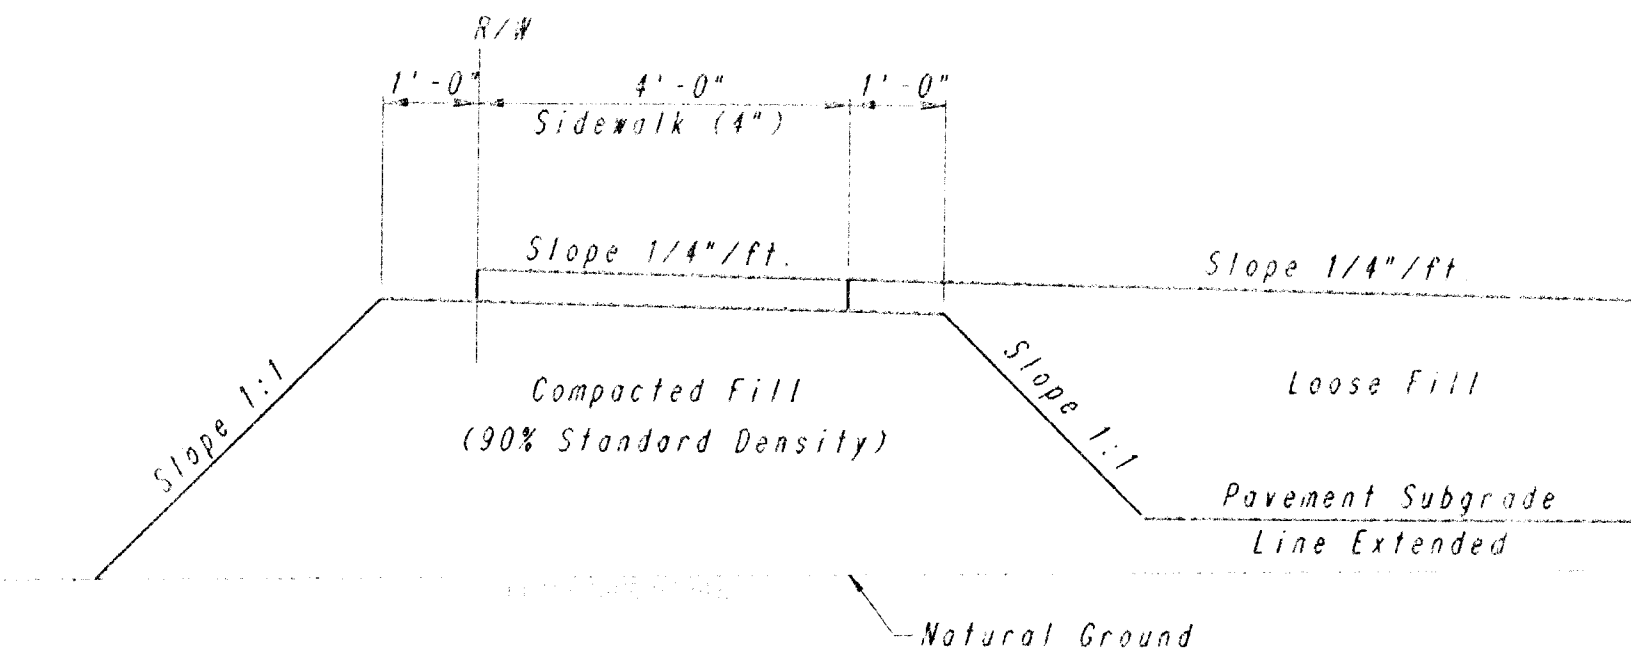

COMPACTED FILL DETAIL
WHERE SIDEWALK IS CONSTRUCTED
(See Plan Sheets for Locations)

PLAN	SURVEYED	BY	DATE
NOTE BOOK PLOTTED NO.	ALIGNED CHECKED NO.		
	DATE LAST CHECKED		

DRAWING NAME: SD-8365 WILD PAN DTL
LOCATION: W4 A1123
CENTER COORDINATES:
EASTING: 41123
NORTHING: 41123
DATE LAST WORKED ON:
DRAWN: DUNN

FOREST LAKES PHASE NO. 8			
MISCELLANEOUS PAVING DETAILS			
PROFESSIONAL ENGINEERING CONSULTANTS, P.A. ENGINEERS WICHITA, KANSAS			
Designed by	WMB, GDD	Checked by	
Drawn by	DEP	Date	JAN, 1994
		Job No.	93695