
P.O.T. ℄ 1 STA. 0+39.98
1. 1/2" REBAR CAPPED "PEC PA"
2. "□" ON N.W. CORNER WEST HEADWALL OF RCP 55.8' NNW

P.O.T. ℄ 1 STA. 2+00.00 (℄ EXISTING LEVEE)
1. 1/2" REBAR CAPPED "PEC PA"
2. "□" ON N.W. CORNER WEST HEADWALL OF RCP 107.71' S
3. 60d NAIL IN NORTH FACE 18" COTTONWOOD 49.40' W

P.O.T. ℄ 1 STA. 7+53.61 (℄ EXISTING LEVEE)
1. FOUND 1/2" BAR
2. NAIL AND SHINER IN TOP OF BRACED FENCE POST 49.14'W

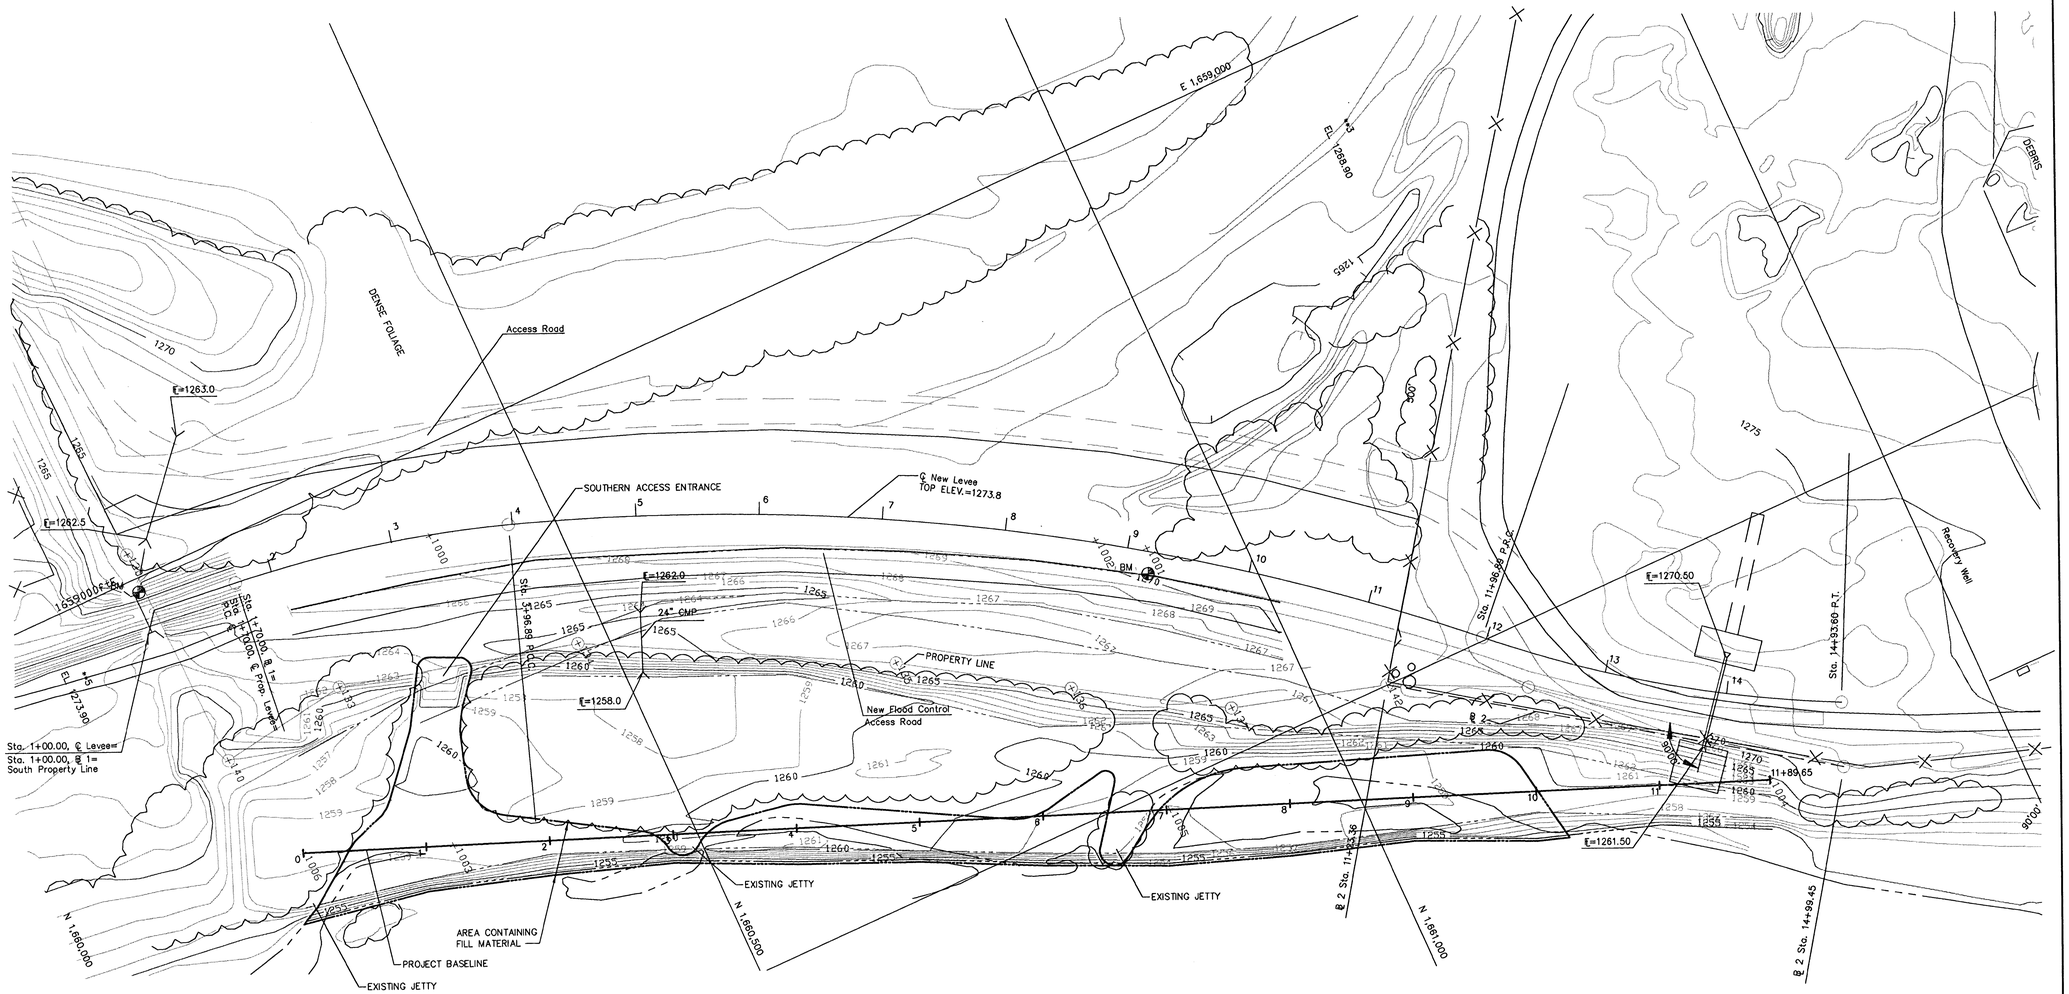

REVISED 2/23/94

NOTES:

1. THE ORDINARY HIGH WATER MARK (OHWM) ACROSS THE PROJECT SITE IS AT ELEV. 1255 AT BASE LINE STATION 0+00 AND ELEV. 1257 AT STATION 11+89.65.
2. THE PROJECT SITE, AND ALL AREA RIVERWARD FROM THE LEVEE IS WITHIN A 100 YEAR FLOODWAY, AS DEFINED BY FEMA.
3. THE AREA SHOWN AS THE LOCATION OF FILL MATERIAL WAS PREVIOUSLY A RELATIVELY FLAT AREA. SOIL TYPE IS RIVER DEPOSITS, PRIMARILY SAND. THE AREA WAS PARTIALLY SUBMERGED BY SHALLOW WATER. GRASSES AND SHRUBS GREW ON DRY PORTIONS OF THE AREA.

N

SCALE: 1"=50'

B.M.: "□" ON N.W. CORNER WEST HEADWALL OF PIPE UNDER DIKE (STA. 0+93, 17.5' LT.)
ELEV. 1268.27

B.M.: T-POST AT SOUTH SIDE GRAVEL ROAD (STA. 9+20, 17.4' RT.)
ELEV. 1266.29

CITY OF WICHITA, KS.

ARKANSAS RIVER BANK RESTORATION PLAN
SITE PLAN
EXISTING CONDITIONS

Design	DLM
Drawn by	BDM
Checked by	DLM
Date	1/17/94
Job no.	94008SP1

MID-KANSAS ENGINEERING CONSULTANTS INC.
3500 NORTH ROCK ROAD
BUILDING #800
WICHITA, KANSAS 67226 (316) 636-5566

Sheet 2 of 4