


MH # 5948-073
Approx depth = 9.0 ft

MH # 5948-072
Approx depth = 6.0 ft

Install 239 lf of 8"
Cured-in-Place Liner

SITE 7

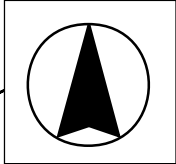

7-2

8TH

830

6501

6512

MARJORIE

WOODLAWN

Aerial View



Television Inspection Master Report

3/30/2007
7:40 AM

US Structure: 5948-073 830 N WOODLAWN BLVD Date Insp: 2/15/2007 Basin: E01H
DS Structure: 5948-072 6501 E 8TH ST Dir Televised: Up->Down

Pipe Information

Shape: Round Project No.: H-007 Dia: 8 Material: VCP Length: 239 Slope: 0.402

Inspection Information

Crew: Percent Full: Tape ID:
Weather: Sunny Purpose: TV Existing Line Counter Start:
Surface Cond: Trees & Fences Flow: Normal Flow Counter Stop:

Obs. #	VTR #	Counter Comment	Distance	Location	Description	Rating	Obsrvd (gpm)	Est. (gpm)	Ratings Struct	Clean	Remain (gpm)
1			0.0	US Manhole 5948-073	(NOTE: large concrete pad for RV parking is over the sewer line)						
			1.0	Offset Joint							
2			14.0	North	Wye Service	4					
				ROOTS 830 NORTH WOODLAWN							
3			17.0		Sealed Off Wye South	1					
4			18.0	Joint	Roots	3					
5			28.0	Upper Left	Broken Pipe	3					
6			31.0	Crown	Broken Pipe	3					
7			34.0	Crown	Crack-Horizontal	3					
8			36.0	Crown	Crack-Horizontal	3					
9			40.0	Joint	Roots	3					
10			40.0	Crown	Broken Pipe	3					
11			43.0	Crown	Broken Pipe	4					
12			44.0	South	Break-In Conn / Roots	5					
13			45.0	Crown	Broken Pipe	4					
14			52.0	Joint	Roots	3					
15			55.0	Joint	Roots	3					
16			58.0	Joint	Roots	3					
17			114.0		Wye Service	1					
18			117.0		Wye Service / Roots	5					
19			168.0		Sealed Off Wye North	1					
20			201.0		Break-In Conn	3					
				ROOTS 6409 EAST 8TH ST. NORTH							
21			205.0	South	Wye Service	5					
				ROOTS 6420 EAST MAJORIE							
22			238.0	Joint	Offset	4					
23			238.0	DS Manhole		1					
24			238.0		Stopped Inspection	5					

NOTE:
The video skips from 205' to 228' so we do not see that 23' of pipe on the video.

DUE TO BAD OFFSET WE WILL REVERSE SET-UP

REVERSE SETUP:

Obs. #	VTR #	Counter Comment	Distance	Location	Description	Rating	Obsrvd (gpm)	Est. (gpm)	Ratings Struct	Clean	Remain (gpm)
1			0.0	DS Manhole 5948-072	TELEVISIONING AGAINST THE FLOW						
					WE WILL TELEVISION APROX 3 FT TO FINISH LINE						
3			3.0	Joint	Offset	5					
					BROKEN PIPE / Stopped Inspection						
					STOPPED DUE TO OFFSET & BROKEN PIPE / TOTAL DISTANCE FOR LINE IS 239 FT						

NOTE: DOWNSTREAM 10 LF OF PIPE WAS REPLACED "BY OTHERS" / PIPE STILL IN POOR COND. BUT CAN BE LINED

7-3