

**15-1**

MH # 5946-351  
Approx depth = 11.1 ft

MH # 5946-041  
Approx depth = 9.7 ft

WHITTIER

INDIANAPOLIS

294'

290'

657 S.  
Armour

CALHOUN

7310 E.  
Gilbert

ARMOUR

ARMOUR


GILBERT

268'

356'

Install 290 lf of 8"  
Cured-in-Place Liner

**SITE 15**

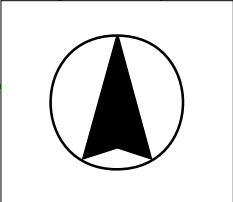

15-2

INDIANAPOLIS

CALHOUN


ARMOUR

7310 E. Gilbert

657 S. Armour

GILBERT

Aerial View

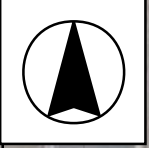

# Television Inspection Master Report

10/4/2005  
1:56:57PM

US Manhole: 5946-351      7310 E GILBERT ST      Date Insp: 2/25/2004      Basin: E01H  
 DS Manhole: 5946-041      657 S ARMOUR RD      Dir Televised: Upstream To Downstream

## Pipe Information

Shape: Round      Length Status:      Project No.: G-078  
 Dia/Ht Width: 8 0      Material: VCP      Index:  
 Length: 290.3      Slope: 0.393      Surface:

## Inspection Information

Crew: 692      Percent Full: 10      Tape ID: 4248  
 Weather: Sunny      Purpose: TV Existing Line      Counter Start: 7.55  
 Surface Cond: Trees & Fences      Flow: Normal Flow      Counter Stop:

Obs. #	VTR Counter	Distance	Location	Description	Rating	Obsrvd (gpm)	Est. (gpm)	Ratings Struct	Clean	Remain (gpm)
1		0.0	US Manhole 5946-351							0.000
2		20.0	North	Wye Service	1	0.000	0	0	0	0.000
3		31.0	South	Wye Service	1	0.000	0	0	0	0.000
4		82.0	North	Wye Service	1	0.000	0	0	0	0.000
5		89.0	South	Break-In Conn	1	0.001	0	0	0	0.001
6		91.0	South	Wye Service / Sealed Off	1	0.000	0	0	0	0.000
7		131.0	Invert	Broken Pipe	2	0.008	44	0	0	0.008
8		146.0	Invert	Broken Pipe	3	0.010	60	0	0	0.010
9		147.0	North	Break-In Conn	1	0.001	0	0	0	0.001
10		151.0	South	Wye Service	2	0.000	0	0	0	0.000
11		202.0	Joint	Roots	2	0.004	2	4	4	0.004
12		206.0	Joint	Roots	2	0.004	2	4	4	0.004
13		208.0	South	Wye Service	2	0.000	0	0	0	0.000
14		210.0	North	Break-In Conn	1	0.001	0	0	0	0.001
15		211.0	Joint	Roots	2	0.004	2	4	4	0.004
16		226.0	Joint	Roots	2	0.004	2	4	4	0.004
17		235.0	Joint	Roots	2	0.004	2	4	4	0.004
18		247.0	Joint	Roots	2	0.004	2	4	4	0.004
19		250.0	Joint	Roots	2	0.004	2	4	4	0.004
20		267.0	South	Wye Service	2	0.000	0	0	0	0.000
21		270.0	North	Wye Service	1	0.000	0	0	0	0.000
22		287.0	DS Manhole 5946-041							0.000

(this manhole not recently inspected due to a dog and a locked gate)

# 15-3