
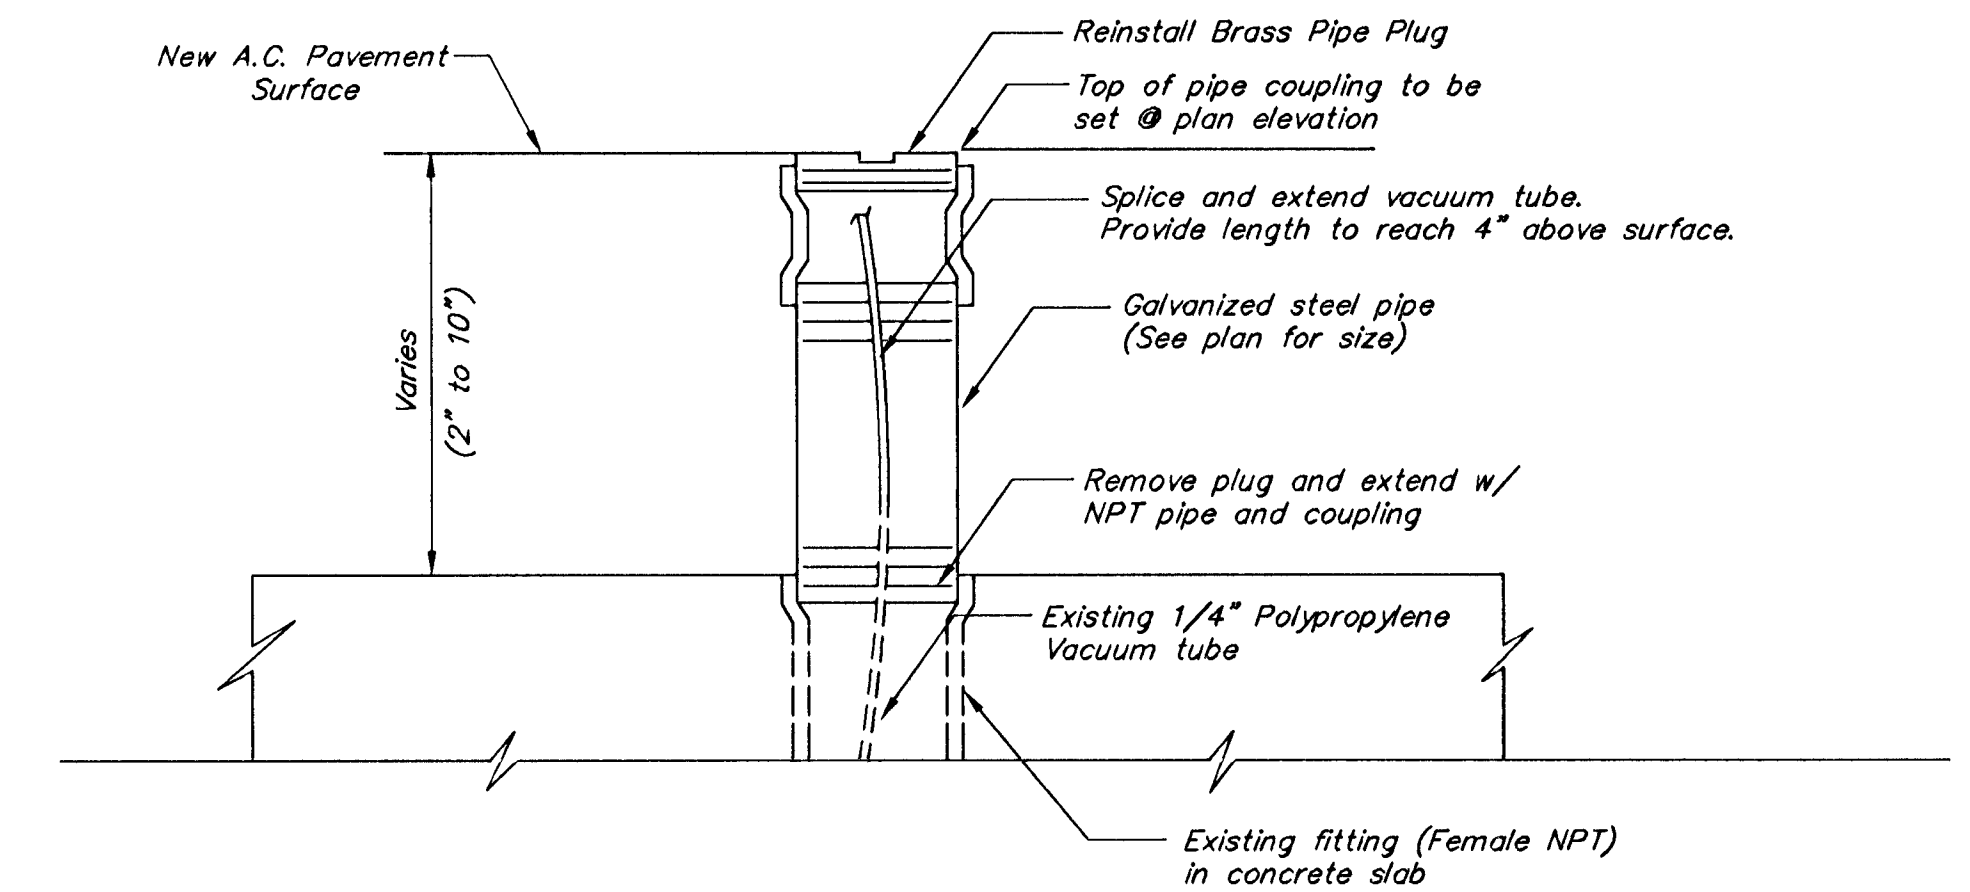
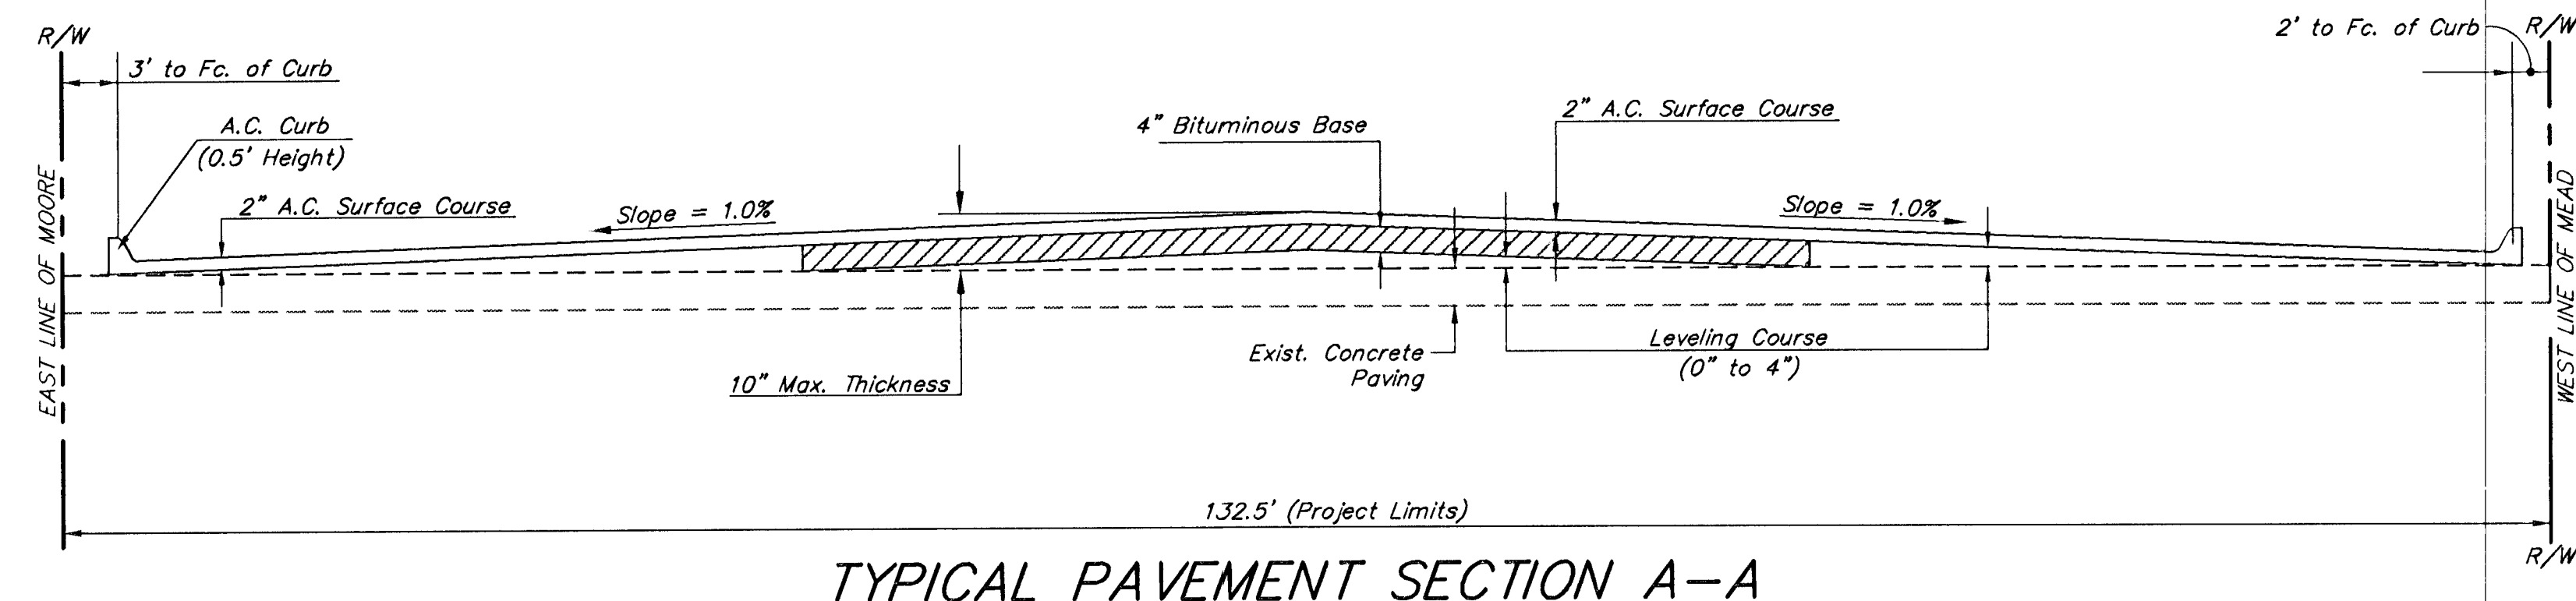
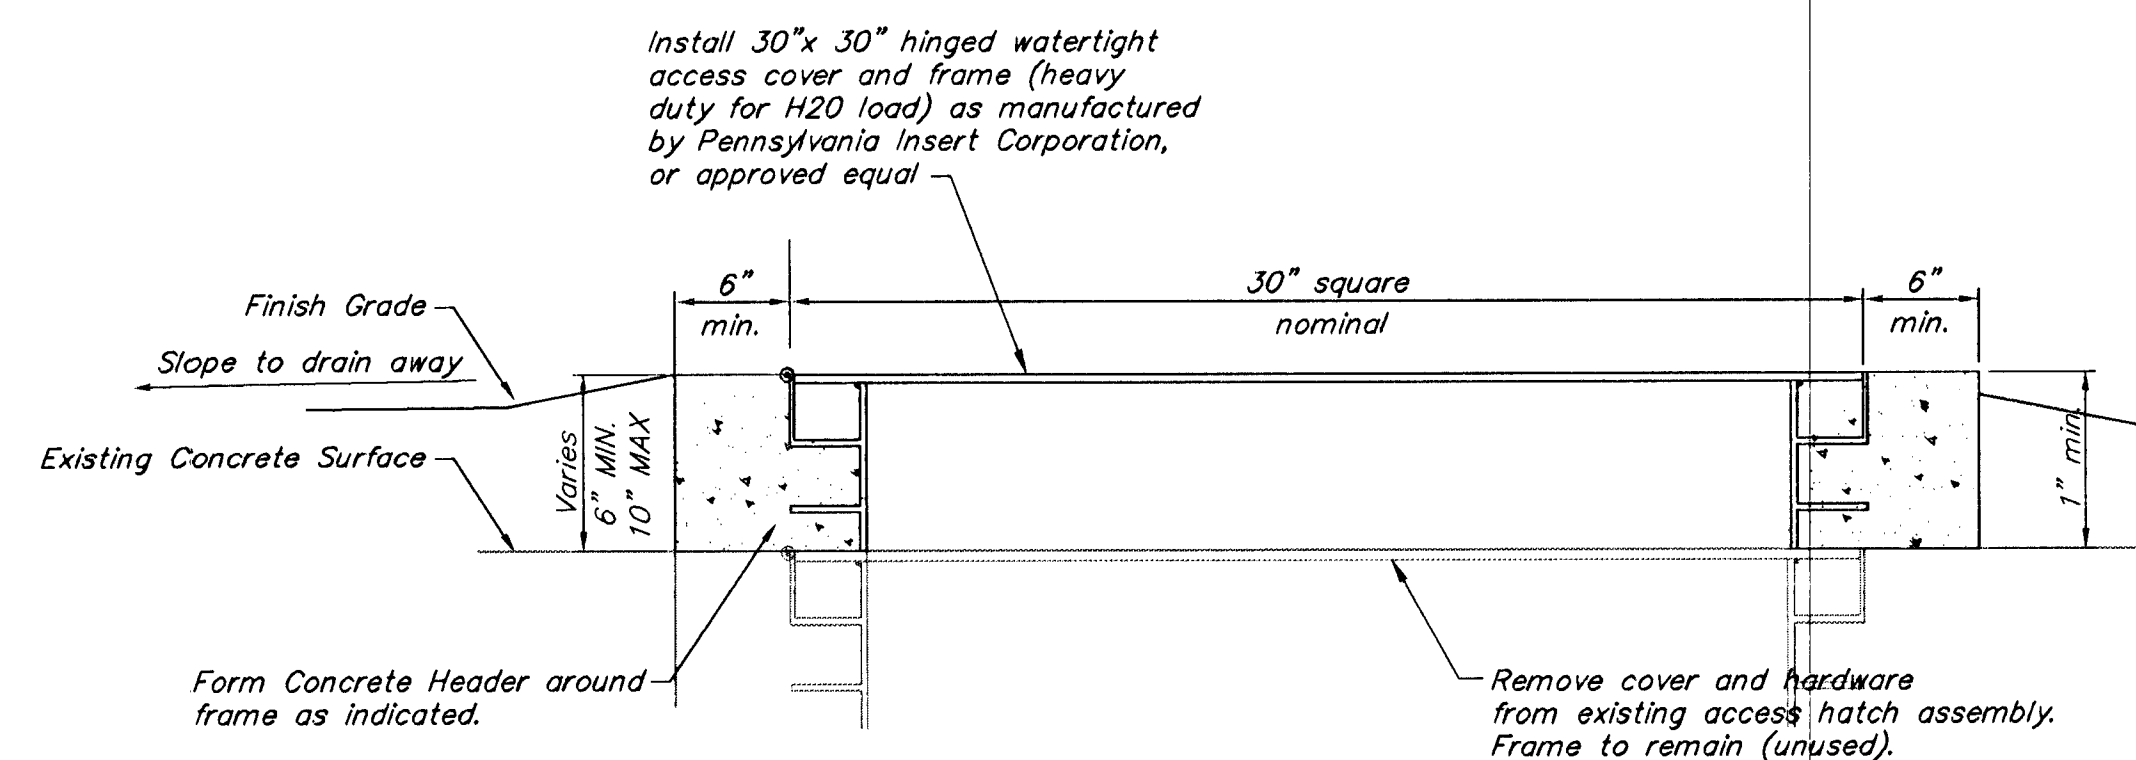
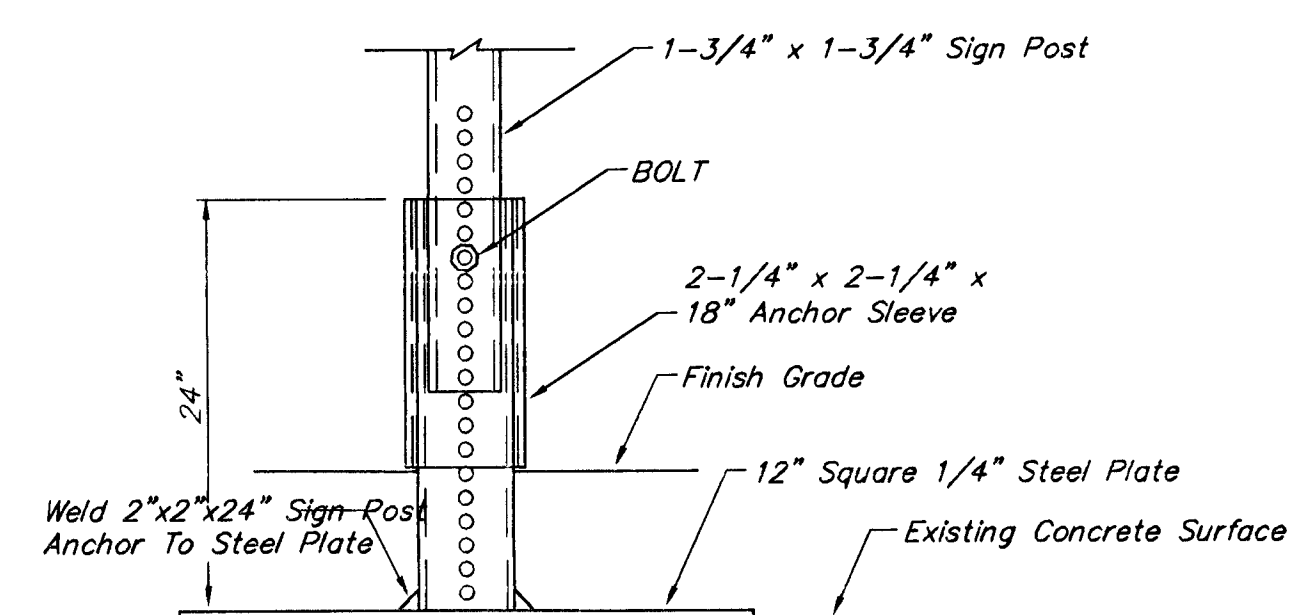
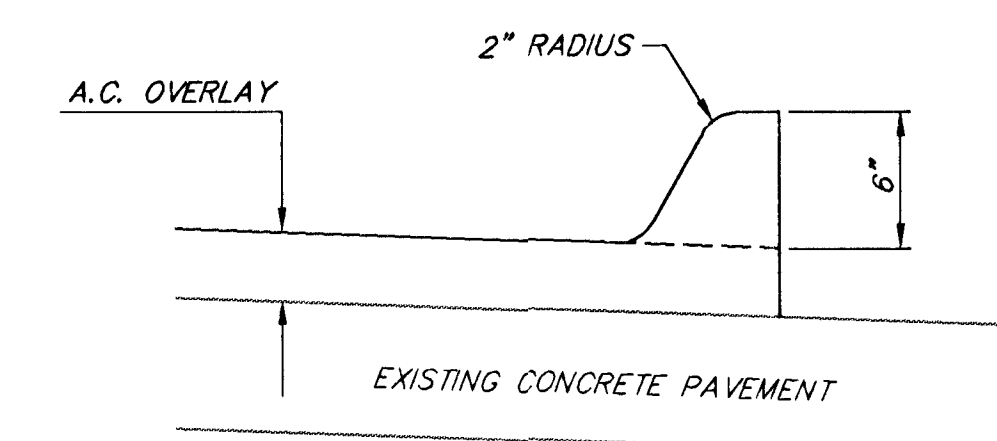
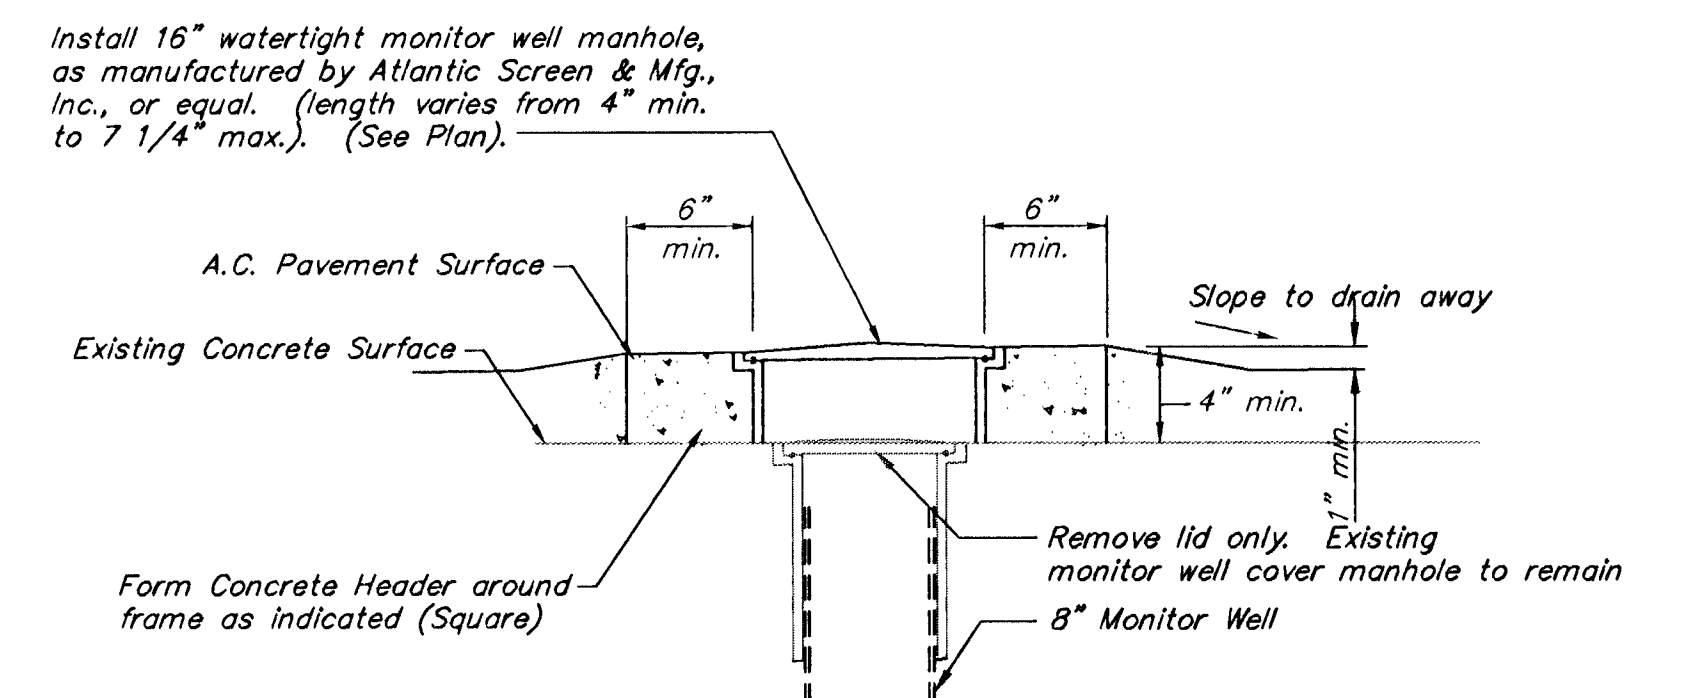


	<u>% Retained</u>
2 1/2"	0
3/4"	20 to 60
#4	50 to 80
#40	80 to 94
#200	90 to 98

Rock quality shall conform to the requirements specified by the KDOT 1990 Edition Standard Specification Subsection 1102 for durability Class I.

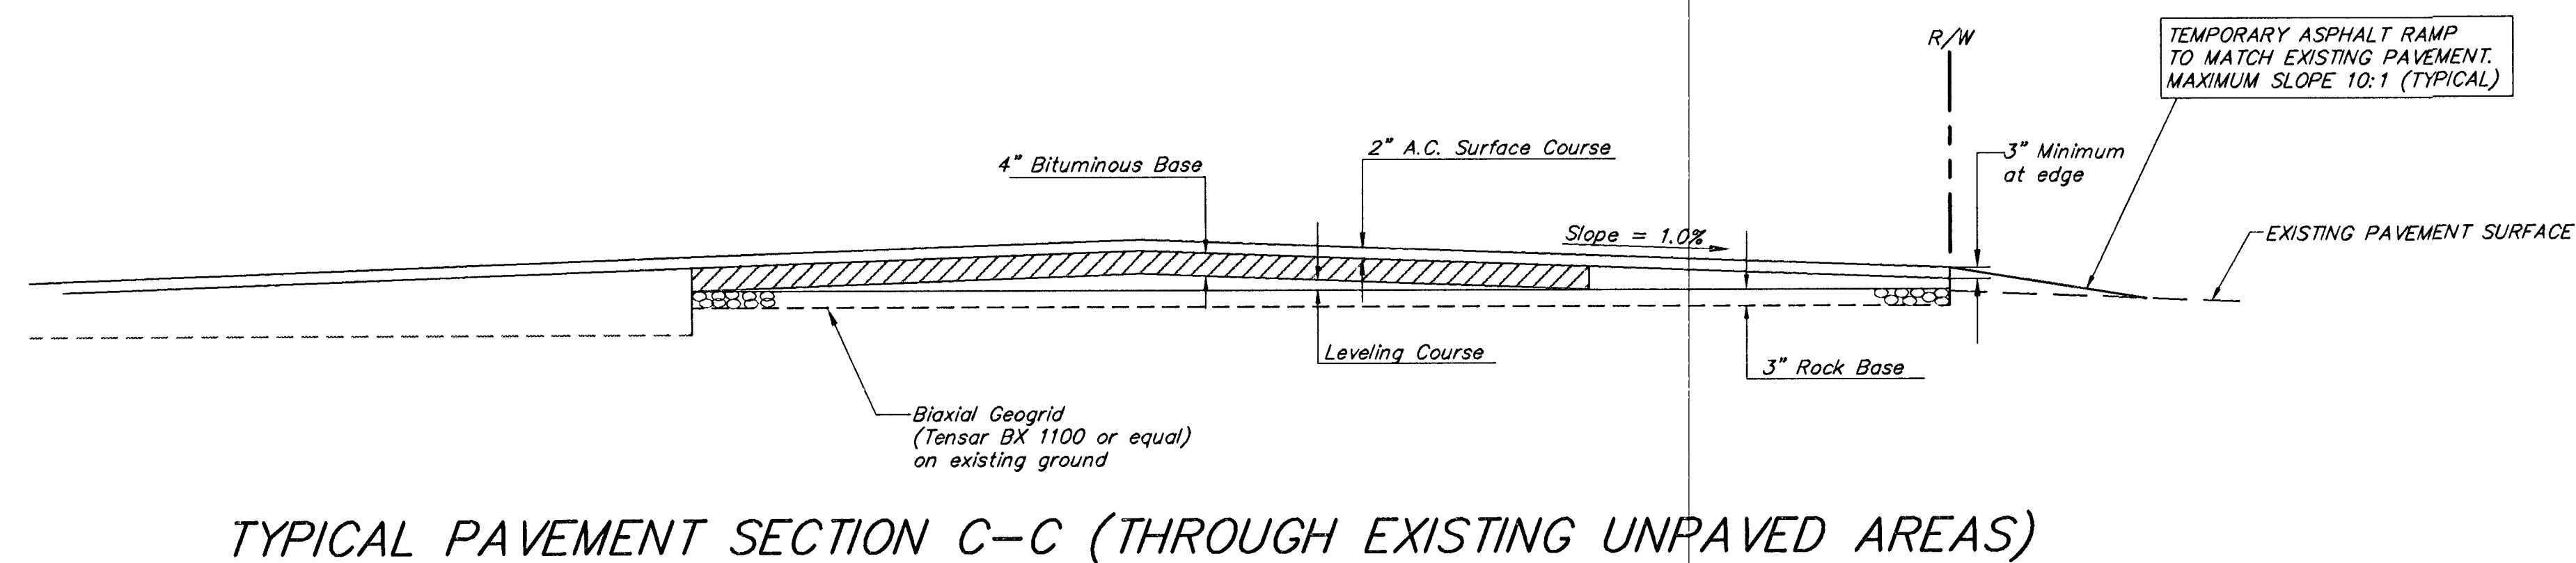

PIT COVER DETAIL

MONOLITHIC ASPHALT CURB DETAIL

REVISED 4-25-94 REV. MONITOR WELL COVER DIMENSIONS

REVISED 4-12-94 REV. MONITOR WELL AND PIT
COVER DETAILS

REVISED 4-5-94 ADDED TYPICAL SECTION C-C
PIPE PLUG ADJUSTMENT DETAIL

PIPE PLOG ADJUSTMENT DETAILS OLD TOWN STREET IMPROVEMENTS TYPICAL DETAILS "COLEMAN B" PARKING LOT			
SRB 924 NORTH MAIN WICHITA, KANSAS 67203 316-264-8008 FAX 264-4621		REVISED	
SAVOY, RUGGLES & BOHM, P. A. ENGINEERING & SURVEYING			
PROJECT NUMBER		INDEX CODE	
		790865	
DRAWN	DESIGN	REVIEW	DATE
T. Brooks	T. Ruggles		2/14/94
		UTILITY	SRB JOB
			113E