


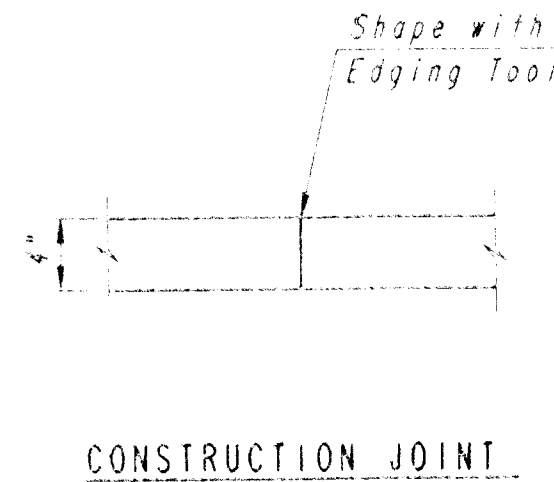


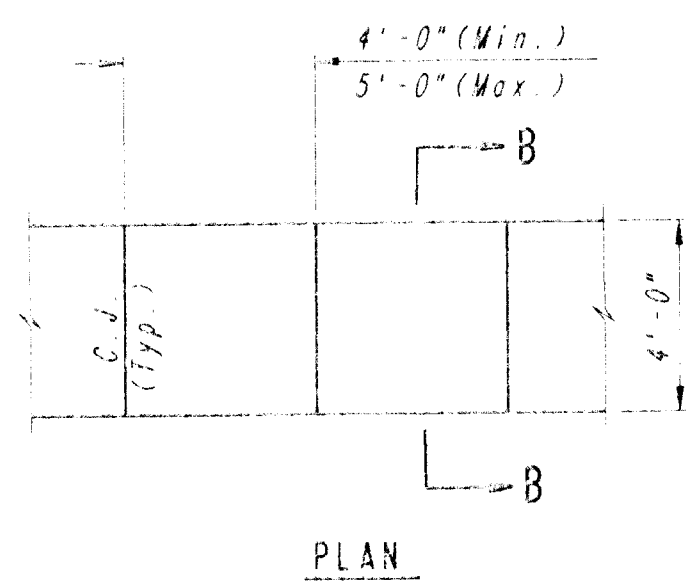

CONSTRUCTION JOINT

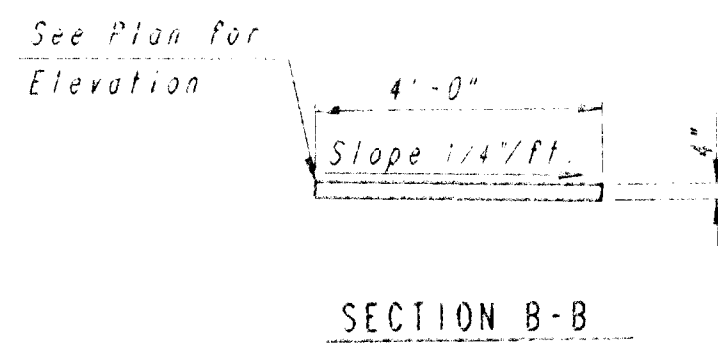


SECTION B-B

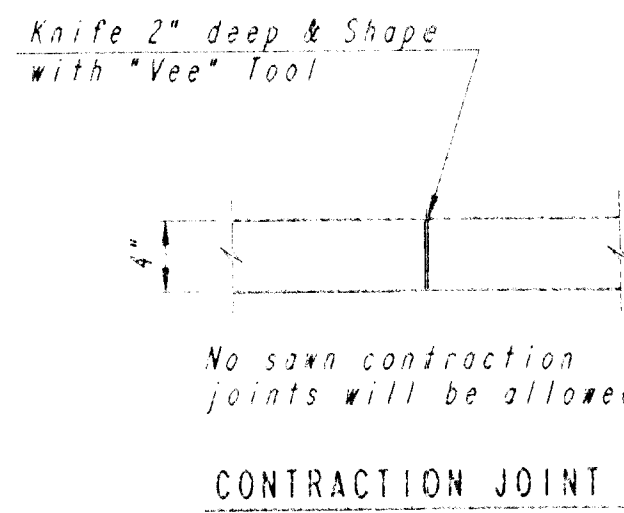


CONTRACTION JOINT

4" WALK DETAILS

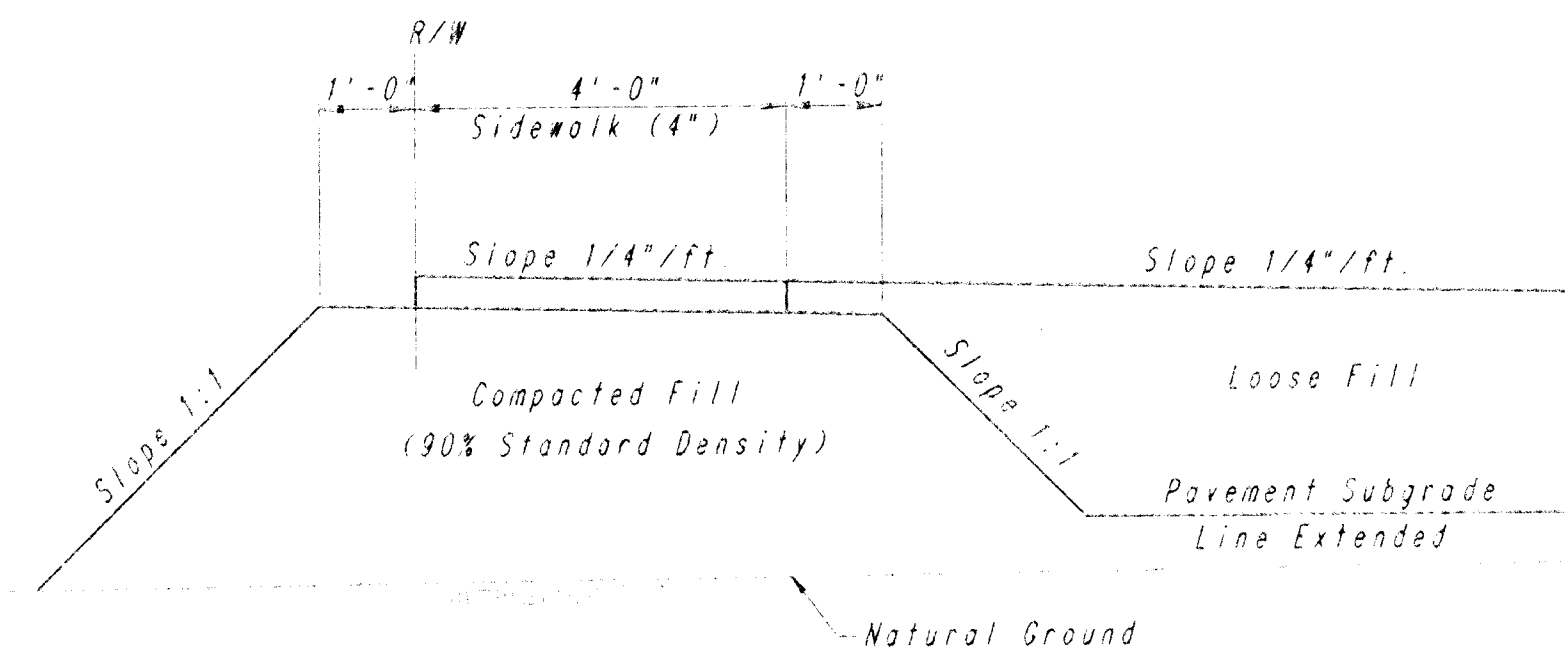

COMPACTED FILL DETAIL
WHERE SIDEWALK IS CONSTRUCTED
(See Plan Sheets for Locations)

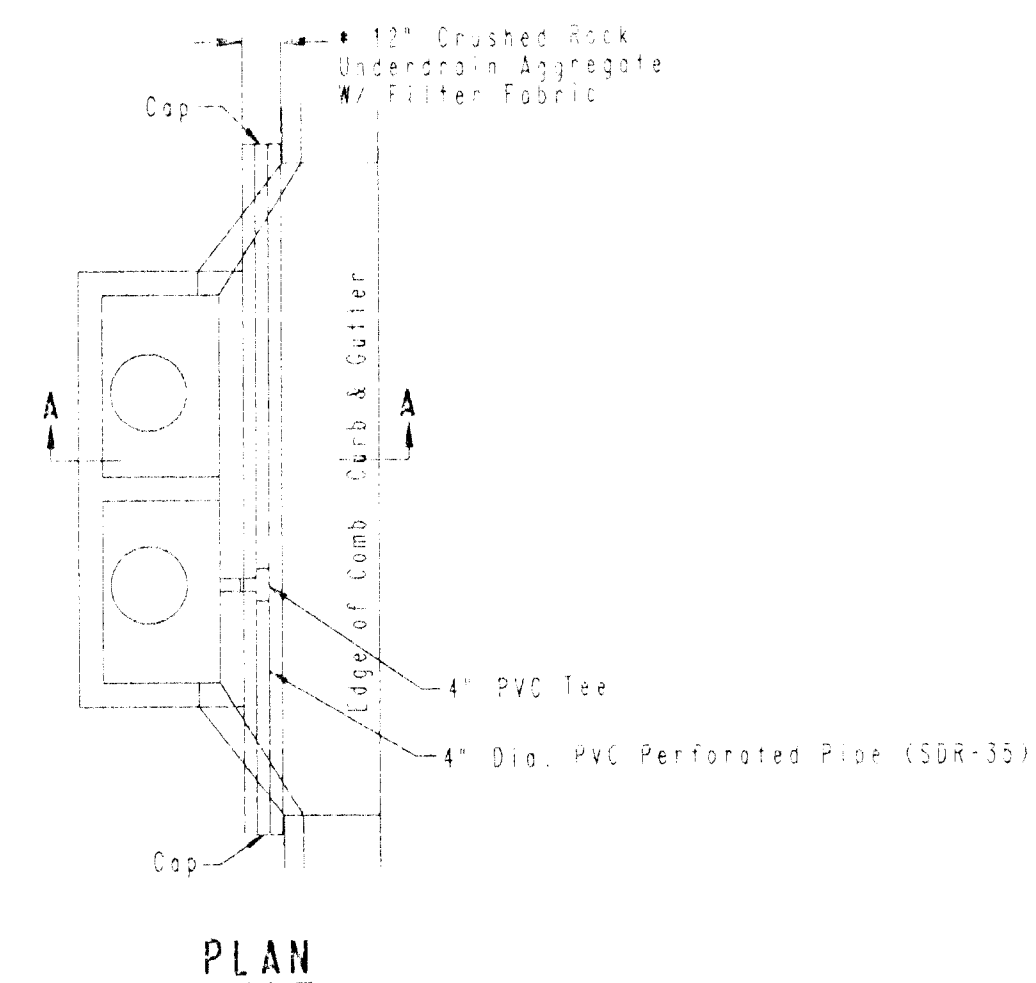

PLAN


★ UNDERDRAIN AGGREGATE
PERCENT OF AGGREGATE RETAINED

1"	0
3/4"	0-10
3/8"	45-85
1/4"	90-100
#8	95-100

ROCK QUALITY SHALL CONFORM TO THE REQUIREMENTS SPECIFIED BY THE KDOT 1990 EDITION STANDARD SPECIFICATION SUBSECTION 1102 FOR DURABILITY CLASS 1.

PAVEMENT UNDERDRAIN LOCATIONS

STREET	STATION	SIDE
WILD ROSE	10+80	LT.
WILD ROSE	10+80	RT.

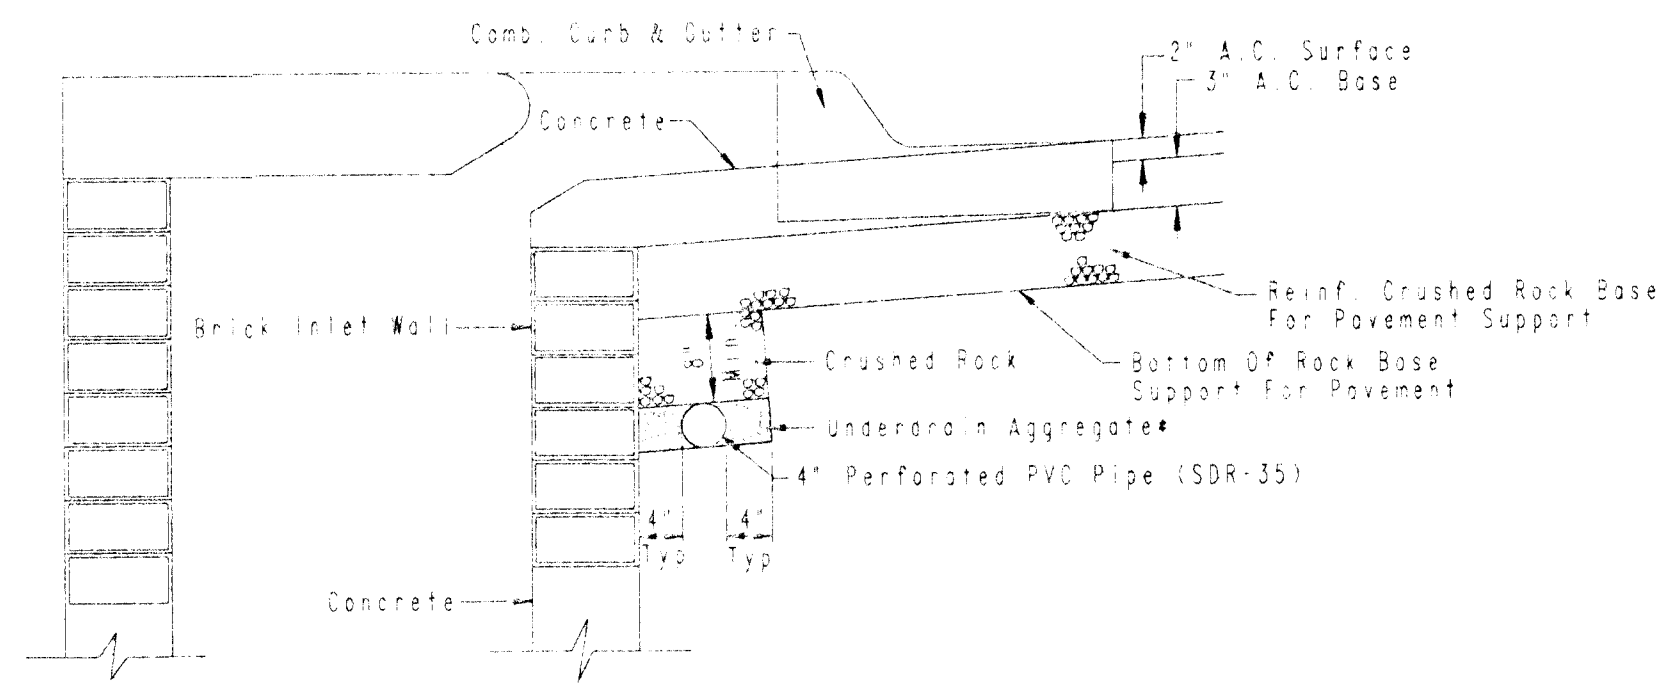

(Min. 16 Perforations Per Lin. Ft. @ 1/4" Dia.)
Perforations To Be on Bottom Half

SECTION A-A

PAVEMENT UNDERDRAIN DETAIL
For Alternate 1 Only

NOTE: PLACE 4" PVC PERFORATED PIPE AT ALL DRAINAGE SWP LOCATIONS.
COST OF UNDERDRAIN SYSTEM TO BE INCIDENTAL TO THE REINFORCED CRUSHED ROCK SUBGRADE.
INLET TYPE MAY VARY FROM THAT SHOWN.
PAVEMENT CONTRACTOR WILL BE REQUIRED TO INSTALL SDR 35, 4" PERFORATED DRAIN PIPE AND TEE AS NOTICED IN THE DETAILS ABOVE. A PIPE STUD HAS BEEN INSTALLED THROUGH WALLS OF CURB INLETS BY OTHERS IN A MANNER ALLOWING CONNECTION OF ADDITIONAL DRAIN PIPE AND TEE AS REQUIRED BY DETAILS ABOVE.

PLAN	SURVEYED	DATE
NOTED	BY	
NO. OF REVISIONS		
NO. OF REVISIONS		

DRAWING NAME: 32-53694 MISC PAV DET
LOCATION: 04 4606
CENTER COORDINATES:
ROTATION ANGLE:
DATE LAST WORKED ON:
DRAWN BY: DUNN

FOREST LAKES
PHASE NO. 7

MISCELLANEOUS PAVING
DETAILS

PROFESSIONAL ENGINEERING CONSULTANTS, P.A.
ENGINEERS
WICHITA, KANSAS

Designed by	MWB, GDD	Checked by	
Drawn by	DEP	Date	JAN. 1994
		Job No.	93694